

# PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Email: mirage1195@gmail.com Mobile: 9061 0543

## ACCIDENT VEHICLE INSPECTION REPORT

Report no : 18M0121.KTC  
Vehicle no : JTP6174

### 1 REFERENCE

Date of inspection : 5 January 2021  
Requested by : Gurpreet Singh Mohinder  
c/o Blk 18 Voon Lay Way  
#02-138 Tradehub 21  
Singapore 609966  
Type of survey : Independent  
Repairer : KaToom Customs  
25 Kaki Bukit Ave 4, #05-90 Synergy @Kaki Bukit, Singapore 417800  
Date of accident : 23 December 2020

### 2 VEHICLE DATA

Make/model : Honda FS150FJ2  
Chassis no : PMKKC2760KB231287  
Engine no : Blocked  
Date of registration : 2019  
Engine capacity : 149 cc  
Colour : Red

### 3 STATIC CONDITION CHECK

Steering : Affected  
Foot brakes : Serviceable  
Hand brakes : Serviceable  
Paintwork : Good  
General Condition : Fair

### 4 TIRE CONDITION CHECK mm/MAKE SIZE

Front tread	: 4 mm/Maxxis	90/80-17
Rear tread	: 4 mm/Maxxis	140/90-17

### 5 BRIEF DESCRIPTION OF DAMAGE

Front forks bent, front clamp bent, RH front side fairing broken, front LEDs broken/leg snapped, handle bar bent, chassis – bent at the front post area, tail set scraped/distorted, pipe cover missing/arbaded, front wheel rim bent, etc. Please see para. 8 of this report for more details.

### 6 REMARKS

This inspection is carried out on a "WITHOUT PREJUDICE" basis and I have not authorized any repairs.

### 7 RECOMMENDATION

Cost of repairs : \$3,900.00 (lump sum)  
Estimated no of days : Seven (7)



# 8 ASSESSMENT OF DAMAGE AND COSTS

Report no: 18M0121.KTG  
Vehicle no: JTP6174

## A SPARE PARTS

Description	Qty	Assessed Condition	Repairer's Amount	Revised Amount
Fork assy LH	1	bent	750.00	750.00 380
Fork assy RH	1	bent	750.00	750.00 380
Triple clamp	1	serviceable	300.00	0.00 X
Front clamp	1	bent	150.00	150.00 ✓
Cone bearing	1	necessary	110.00	110.00 ✓
Handbar	1	bent	195.00	195.00 ✓
Rider footrest assy RH	1	abraded	220.00	220.00 150
Rider footrest assy LH	1	serviceable	220.00	0.00 X
Front step holder set	1	bent	102.00	102.00 50
Rear step holder	1	bent	102.00	102.00 50
Headlamp holder	1	serviceable	380.00	0.00 X
Front LED RH	1	abraded/leg snapped	55.00	55.00 ✓
Front LED LH	1	broken	55.00	55.00 ✓
Pillion footrest assy RH	1	bent	220.00	220.00 140
Pillion footrest assy LH	1	broken	220.00	220.00 140
Rear brake pump	1	serviceable	350.00	0.00 X
Brake switch	1	serviceable	135.00	0.00 X
Radiator hose set	1	serviceable	88.00	0.00 X
Basket	1	bent/deformed	225.00	225.00 160
Mirror RH	1	dislodged/missing	90.00	90.00 60
Mirror LH	1	reused	90.00	0.00 X
Tail set	1	scraped/distorted	129.00	129.00 ✓
Pipe cover	1	missing/abraded	155.00	155.00 80
Front tyre	1	serviceable	220.00	0.00 X
Front cowling	1	dented/cracked	120.00	120.00 ✓
Front cowling support panel	1	broken	95.00	95.00 ✓
Brake lever	1	bent	22.00	22.00 ✓
Rear brake pedal	1	abraded/bent	45.00	45.00 ✓
Front wheel axle bolt	1	bent	55.00	55.00 ✓
Front wheel fender	1	broken	40.00	40.00 ✓
Front side fairing RH	1	broken	95.00	95.00 ✓
		Subtotal of the above	5,311.00	3,528.00
		Discount 10% / 10%	531.10	352.80
		Subtotal 1:	4,779.90	3,175.20
(Special nett)				
Decal	1	necessary	500.00	500.00 250
Engine oil	1	Not applicable	35.00	0.00 X
Coolant	1	Not applicable	30.00	0.00 X
Grip c/balancer RH	1	end abraded	65.00	65.00 ✓
Front number plate	1	missing	15.00	15.00 ✓
		Subtotal 2:	630.00	565.00
		Total cost of parts:	5,409.90	3,740.20

2756

2480.60

330



Report no: 18M0121.KTC  
Vehicle no: JTP6174

**B LABOUR**

Towing.

50.00

~~50.00~~ 40

Press frame.

550.00

~~550.00~~ 300

Rim repair/realignment/balancing.

575.00

~~120.00~~ 80

Labour

500.00

~~400.00~~ 300

Total cost of labour:

1,675.00

1,120.00

Total cost of repair:

7,084.90

4,860.20

**9 CONCLUSION**

The revised or adjusted cost of repairs to restore the vehicle is

\$4,860.20

(a) However, the recommended cost of repair based on lump sum basis would be

\$3,900.00

(b) The estimated number of days taken to complete the repairs would be  
(1<sup>st</sup> re-inspection conducted on 6 January 2021)  
(Post Repair Inspection conducted on 8 April 2021)

Seven (7)

The above recommendations in my view are fair and reasonable for the restoration of the vehicle to its pre-accident condition.

**Note: Lump Sum Repair Basis**

This means the repairer is allowed to replace the damaged parts with used, reconditioned or new parts, or repair it to a roadworthy condition.

Prepared by:

Liaw Leong San

Licensed Automotive Appraiser

Dated: 28 April 2021

total: 3530.40.

L/S: 2.8K.

OS Pays

**LKK Auto Consultants** hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: