



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### Affiliated to Federation Internationale Des Experts En Automobile

SINGAPORE CIVIL DEFENCE FORCE (MHA05)

Ref: CS/SCD21005436/Eqf3e2

91 UBI AVE 4  
SINGAPORE 408827  
SINGAPORE 408827

Date: 20/05/2021

ATTN: JAMIN TAN

Code: SCD

#### 1. Policy Particulars :- THIRD PARTY CLAIM

|                              |                |            |
|------------------------------|----------------|------------|
| Insured Veh.                 | Veh. Inspected | YP 3526A   |
| Policy No. MHASCD06000068523 | Coverage (\$)  | 0.00       |
| Claim No.                    | Excess (\$)    | 0.00       |
| Assign From JAMIN TAN        | Assign Date    | 04/05/2021 |

#### 2. Vehicle Particulars & Condition

|              |                   |              |                    |
|--------------|-------------------|--------------|--------------------|
| Make & Model | HINO XZU710R      | c.c          | 4009               |
| Engine No.   | HIDDEN            | Year of Reg. |                    |
| Chassis No.  | JHHUCS0H70K016708 | Colour       | WHITE              |
| Odometer     | -                 | Steering     | IN ORDER           |
| Brakes       | IN ORDER          | Modification | STANDARD ALLOY RIM |
| General      | FAIR              |              |                    |

#### 3. Conditions of Tyres

|                | Size     | Make   | Balance |
|----------------|----------|--------|---------|
| R/H Front Tyre | 195 R15C | DUNLOP | 4 mm    |
| L/H Front Tyre | 195 R15C | DUNLOP | 4 mm    |
| R/H Rear Tyre  | 195 R15C | DUNLOP | 4 mm    |
| L/H Rear Tyre  | 195 R15C | DUNLOP | 4 mm    |

#### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION.  
DAMAGES SEE DETAILS.

#### 5. General Information

|                |                                                                                   |            |
|----------------|-----------------------------------------------------------------------------------|------------|
| Accident Date  | Inspection Date                                                                   | 06/05/2021 |
| Survey held at | K & S BODYWERK ENGINEERING PTE LTD<br>2B SUNGEI KADUT DRIVE,#01, SINGAPORE 729555 |            |

#### 5a. Remarks

|  |
|--|
|  |
|--|



Registration No. YP 3526A

| S/N | ITEM DESCRIPTION                  | PARTS     |           |                                        |                                     | MAN-HOUR QTY |
|-----|-----------------------------------|-----------|-----------|----------------------------------------|-------------------------------------|--------------|
|     |                                   | PARTS QTY | Condition | PARTS COST PER UNIT (\$) AFTER MARK UP | TOTAL PARTS COST (\$) AFTER MARK UP |              |
| B   | MATERIALS                         |           |           |                                        |                                     |              |
| 1   | Wind screen glass                 |           | Broken    |                                        |                                     |              |
| 2   | W/S moulding upper                |           | Necessary |                                        |                                     |              |
| 3   | W/S moulding RH                   |           | Necessary |                                        |                                     |              |
| 4   | W/S moulding LH                   |           | Necessary |                                        |                                     |              |
| 5   | Panel Front Side LH               |           | Missing   |                                        |                                     |              |
| 6   | Panel Front Side RH               |           | Missing   |                                        |                                     |              |
| 7   | Head lamp LH                      |           | Broken    |                                        |                                     |              |
| 8   | Head lamp RH                      |           | Broken    |                                        |                                     |              |
| 9   | Protector Front Cover Panel       |           | Crushed   |                                        |                                     |              |
| 10  | Panel Assy Front                  |           | Dented    |                                        |                                     |              |
| 11  | Crowl Top Panel Sub Assy Outer    |           | Missing   |                                        |                                     |              |
| 12  | Front Panel Lower                 |           | Dented    |                                        |                                     |              |
| 13  | Radiator Grille                   |           | Broken    |                                        |                                     |              |
| 14  | Radiator Grille Bracket           |           | Missing   |                                        |                                     |              |
| 15  | Radiator Grille Seal No. 1        |           | Necessary |                                        |                                     |              |
| 16  | Radiator Grille Seal No. 2        |           | Necessary |                                        |                                     |              |
| 17  | Radiator Grille Ornament Plate    |           | Necessary |                                        |                                     |              |
| 18  | Bar Front Bumper                  |           | Dented    |                                        |                                     |              |
| 19  | Reinforcement Front Bumoer Top    |           | Dented    |                                        |                                     |              |
| 20  | Reinforcement Front Bumper Bottom |           | Dented    |                                        |                                     |              |
| 21  | Fog lamp LH                       |           | Broken    |                                        |                                     |              |
| 22  | Fog lamp RH                       |           | Broken    |                                        |                                     |              |
| 23  | Wiper Spare Tank                  |           | Missing   |                                        |                                     |              |
| 24  | Emblem "300"                      |           | Necessary |                                        |                                     |              |
| 25  | Emblem "HINO"                     |           | Necessary |                                        |                                     |              |
| 26  | Radiator grill emblem             |           | Necessary |                                        |                                     |              |
| 27  | Emblem "816"                      |           | Necessary |                                        |                                     |              |

|                |                                                                                                         |                         |           |  |  |           |
|----------------|---------------------------------------------------------------------------------------------------------|-------------------------|-----------|--|--|-----------|
| 28             | LH Mirror Assy                                                                                          |                         | Broken    |  |  |           |
| 29             | Heater Piping inlet                                                                                     |                         | Bent      |  |  |           |
| 30             | Heater Piping outlet                                                                                    |                         | Bent      |  |  |           |
| 31             | Air damper case Assy                                                                                    |                         | Broken    |  |  |           |
| 32             | Heater Radiator Unit                                                                                    |                         | Broken    |  |  |           |
| 33             | Low Pitch Horn                                                                                          |                         | Bent      |  |  |           |
| 34             | Cooler Liquid Pipe                                                                                      |                         | Bent      |  |  |           |
| 35             | Cooler Suction Pipe                                                                                     |                         | Bent      |  |  |           |
| 36             | Front Number Plate                                                                                      |                         | Bent      |  |  |           |
| 37             | Front Panel Sticker                                                                                     |                         | Necessary |  |  |           |
|                |                                                                                                         |                         |           |  |  |           |
| A              | <b>LABOUR DESCRIPTION</b>                                                                               |                         |           |  |  |           |
|                |                                                                                                         |                         |           |  |  |           |
| 1              | Remove & replace shattered wind screen & moulding                                                       |                         |           |  |  | 6         |
| 2              | Water seepage test for wind screen                                                                      |                         |           |  |  | 1         |
| 3              | Replace dislodged R/H& L/H corner panel                                                                 |                         |           |  |  | 2         |
| 4              | Remove & replace shattered R/H & L/H head lamps & fog lamps                                             |                         |           |  |  | 4         |
| 5              | Panel beat dented front inner panel                                                                     |                         |           |  |  | 8         |
| 6              | Replace damage front panel cowl cover, radiator grille, cowl top panel, number plate and apply stickers |                         |           |  |  | 8         |
| 7              | Replace damage front bumper & bumper supports                                                           |                         |           |  |  | 4         |
| 8              | Replace damage spare tank                                                                               |                         |           |  |  | 2         |
| 9              | Remove & replace damage heater tank pipings                                                             |                         |           |  |  | 2         |
| 10             | Remove & replace air intake housing                                                                     |                         |           |  |  | 2         |
| 11             | Remove & replace horn                                                                                   |                         |           |  |  | 0.5       |
| 12             | Remove & replace damaged air con pipings and top up gas                                                 |                         |           |  |  | 4         |
| 13             | Panel beat dented driver door                                                                           |                         |           |  |  | 3         |
| 14             | Panel beat dented passenger door                                                                        |                         |           |  |  | 3         |
| 15             | Replace damage LH blind spot mirror glass                                                               |                         |           |  |  | 0.5       |
| 16             | Align dash board                                                                                        |                         |           |  |  | 6         |
| 17             | Re-wiring for head lamp, fog lamp, horn                                                                 |                         |           |  |  | 4         |
| 18             | Putty & spray paint entire front cabin                                                                  |                         |           |  |  | 30        |
|                |                                                                                                         |                         |           |  |  |           |
| <b>COSTING</b> |                                                                                                         | <b>TOTAL PARTS COST</b> |           |  |  |           |
|                |                                                                                                         | <b>TOTAL MAN-HOUR</b>   |           |  |  | <b>90</b> |
|                |                                                                                                         |                         |           |  |  |           |

Registration No. YP 3526A

Registration No. YP 3526A

Vehicle Inspected By



CHEN TSUE YEE  
*Automotive Assessor*



ADRIAN LING WAI PING  
*B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI*  
*Licensed Appraiser*

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### PHOTOGRAPHS FOR VEHICLE NO. YP 3526A

### INSPECTION





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

