

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/III21005445/UGA3Q2**Date:** 04/03/2022REFERENCE

Handling Insurer: India International Insurance Pte Ltd Policy No: D19MFL0000741_01

Claimant Vehicle No : YP2812E **Insured Vehicle No :** YP4106Y

Date of Loss: 12/06/2020 Nature of Claim: TP Claim No: MFL2020D0001091

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **YP2812E**

Make & Model: MITSUBISHI FUSO, 7.5 D FM65FM2RDEB (M) Engine No: 6M60215148

Reg. Date: 13/06/2016 (Man. Year: 2016) Chassis No: FM65FMA30086

Colour: Blue Odometer: 211578 km

Engine Capacity: 7545 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 295/80 R22.5 Rear Tyre Size: 295/80 R22.5 (D)

Front Left Side: Austone 5 mm Rear Left Side: Austone 5/5 mm

Front Right Side: Austone 5 mm Rear Right Side: Austone 5/5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	5,084.17	1,770.15	3,314.02	65.18
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,380.00	870.00	510.00	36.96
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	6,464.17	2,640.15	3,824.02	59.16
Approved Total (Overridden) (S\$)		2,100.00		
Nett Amount (S\$)	6,464.17	2,100.00	4,364.17	67.51
+ Loss of Use (3.0 x S\$120.00/day) (S\$)		360.00		
+ Doc/Search Fee (S\$)		7.45		
Nett Liability (S\$)		2,467.45		
Global Sum Settlement (S\$)		2,400.00		

INSPECTION

Date of Assignment: 04/05/2021

Date Inspected: 04/05/2021 Inspected At:

Liu's Brother Auto Engineering Workshop (HQ)
 BLK 1 KAKI BUKIT AVE 6, #01-01 AUTO BAY @
 KAKI BUKIT
 Singapore 417883

Estimated Period of Repair: 2.0 days

Adjuster: MARCUS CHUA**Manager:** Chong Pui Lin

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 27 Oct 2021)	
Parts:	N/A	MITSUBISHI FUSO 7.5 D FM65FM2RDEB (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for YP2812E)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Dented	1,828.25 F	*1,109.98 FL
2	1		*FRONT BUMPER REINFORCEMENT	Repair	1,002.50 F	*- FL
3	1		*FRONT GRILLE	Cracked	795.12 F	*795.12 FL
4	1		*FRONT GRILLE INNER	Cracked	455.10 F	*455.10 FL
5	1		*FRONT HEAD LAMP	Not Necessary	1,003.20 F	*- FL
					Sub Total (S\$)	5,084.17
					- List Item Discount on L Items 0.00/25.00% (S\$)	0.00
					Total Parts (S\$)	5,084.17
						1,770.15

F=Franchise part. L=ListItemDisc.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CHECK ALL WIRING & ELECTRICAL COMPONENT FOR PROPER FUNCTION	New	50.00	20.00
2	LABOR FOR PANEL BEATING ,CUT,WELD ,STRAIGHTEN & REPLACING PARTS ETCS	New	580.00	400.00
3	TO PUTTY & SPRAY PAINTING & INCLUDING TOUCH UP PAINT ON ACCIDENT AFFECTED	New	750.00	450.00
Gross Labour Cost (\$\$)			1,380.00	870.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >