

# LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

MSIG Insurance (Singapore) Pte. Ltd.  
4 Shenton Way, #21-01 SGX Centre 2  
Singapore 068807

**Our File No:** CS/MSG21005456/T1TF3E2

**Date:** 09/06/2021

### REFERENCE

|                   |                |                  |            |                  |
|-------------------|----------------|------------------|------------|------------------|
| Insured/Claimant: | Chin Fung Chow | Policy No:       | 1001420285 |                  |
| Date of Loss:     | 29/04/2021     | Nature of Claim: | OD         | Claim No: 256753 |

### DESCRIPTION & IDENTIFICATION OF VEHICLE

|                             |                                           |             |                   |
|-----------------------------|-------------------------------------------|-------------|-------------------|
| Reg No:                     | SKT4614S                                  |             |                   |
| Make & Model:               | TOYOTA COROLLA ALTIS, 1.6 CLASSIC CVT (A) | Engine No:  | 1ZR503998         |
| Reg. Date:                  | 10/06/2015 (Man. Year: 2015)              | Chassis No: | MR053REH104531420 |
| Colour:                     | Black                                     | Odometer:   | 252463 km         |
| Engine Capacity:            | 1598 cc                                   |             |                   |
| Market Value/New Car Price: | S\$50,000.00                              |             |                   |
| Sum Insured (S\$):          | 0.00                                      |             |                   |

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

|                          |                         |                      |                          |                         |
|--------------------------|-------------------------|----------------------|--------------------------|-------------------------|
| General Condition:       | Steering (Serviceable): | Yes                  | Footbrake (Serviceable): | Yes                     |
| Handbrake (Serviceable): | Yes                     | Engine Modification: | No                       | Pre-accident Condition: |

### CONDITION OF TYRES

|                   |               |                  |               |
|-------------------|---------------|------------------|---------------|
| Front Tyre Size:  | 205/55 R16    | Rear Tyre Size:  | 205/55 R16    |
| Front Left Side:  | Achilles 6 mm | Rear Left Side:  | Achilles 6 mm |
| Front Right Side: | Achilles 6 mm | Rear Right Side: | Achilles 6 mm |

*The above values represent the remaining tyre treads depth*

| COST OF CLAIMS                      | Repairer's      | Adjuster's      | Difference      | Diff %       |
|-------------------------------------|-----------------|-----------------|-----------------|--------------|
| Parts                               | 4,688.20        | 3,550.80        | 1,137.40        | 24.26        |
| Miscellaneous Items                 | 406.00          | 326.00          | 80.00           | 19.70        |
| Labour                              | 800.00          | 800.00          | 0.00            | 0.00         |
| Paintwork Labour                    | 526.96          | 526.96          | 0.00            | 0.00         |
| Towing                              | 0.00            | 0.00            | 0.00            |              |
| <b>Calculated Gross Total (S\$)</b> | <b>6,421.16</b> | <b>5,203.76</b> | <b>1,217.40</b> | <b>18.96</b> |
| <b>- Excess (S\$)</b>               | 0.00            | 500.00          | -500.00         |              |
| <b>(S\$)</b>                        | 6,421.16        | 4,703.76        | 1,717.40        | 26.75        |
| <b>+ GST 7.00/7.00% (S\$)</b>       | 449.48          | 329.26          | 120.22          | 26.75        |
| <b>Nett Amount (S\$)</b>            | <b>6,870.64</b> | <b>5,033.02</b> | <b>1,837.62</b> | <b>26.75</b> |

### INSPECTION

|                             |            |                   |                                                                                                     |
|-----------------------------|------------|-------------------|-----------------------------------------------------------------------------------------------------|
| Date of Assignment:         | 04/05/2021 | Present Location: | SMRT Automotive Services Pte Ltd (Woodlands)                                                        |
| Date Inspected:             | 05/06/2021 | Inspected At:     | SMRT Automotive Services Pte Ltd (Woodlands)<br>60 Woodlands Industrial Park E4<br>Singapore 757705 |
| Estimated Period of Repair: | 7.0 days   |                   |                                                                                                     |

**Adjuster:** MOHD TAUFIKH BIN HAMID

**Manager:** DENISE TAY KWEE CHENG

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

(REPAIR COST NOT CONCLUDE)

(EXCLUDE CHECK ITEMS S\$805.20 NETT)

## REPAIR DETAILS

### Reference

**Part Source:** MRM-SG    Version: 1.0 (Last Synchronised: 09 Jun 2021)

**Parts:** 143    TOYOTA COROLLA ALTIS 1.6 CLASSIC CVT (A) (Catalogue:Merimen Singapore 1.0)

**Labour:** Repairer's (Price-denominated Standard List)

**Print Code:** (Unsubmitted, no print-code for SKT4614S)

**Validity:** These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

**Further Info:** Items/values not in reference catalogue are prefixed with an asterisk \*.

### Recommended Parts

| No. | Qty | Part No. | Particulars                           | Condition     | Repairer's | Amount    |
|-----|-----|----------|---------------------------------------|---------------|------------|-----------|
| 1   | 1   | NA       | <b>*BONNET</b><br>(WCP)               | Dented        | 380.00 F   | *380.00 F |
| 2   | 1   | NA       | <b>*BONNET INSULATION</b><br>(WCP)    | Crumpled      | 120.00 F   | *120.00 F |
| 3   | 1   | NA       | <b>*BONNET LOCK</b><br>(WCP)          | Jammed        | 80.00 F    | *80.00 F  |
| 4   | 1   | NA       | <b>*BONNET STAND</b><br>(WCP)         | Not Necessary | 40.00 F    | *- F      |
| 5   | 1   | NA       | <b>*CONDENSER CPL</b><br>(WCP)        | Crumpled      | 320.00 F   | *320.00 F |
| 6   | 1   | NA       | <b>*COOLING FAN</b><br>(WCP)          | * Check       | 70.00 F    | *- F      |
| 7   | 1   | NA       | <b>*ENGINE HEAD TOP CVR</b><br>(WCP)  | Crumpled      | 120.00 F   | *120.00 F |
| 8   | 1   | NA       | <b>*EXPANSION TANK</b><br>(WCP)       | Crumpled      | 68.00 F    | *68.00 F  |
| 9   | 1   | NA       | <b>*FAN HOUSING</b><br>(WCP)          | * Check       | 110.00 F   | *- F      |
| 10  | 1   | NA       | <b>*FAN MOTOR</b><br>(WCP)            | * Check       | 180.00 F   | *- F      |
| 11  | 1   | NA       | <b>*FRONT BONNET SEAL</b><br>(WCP)    | Necessary     | 35.00 F    | *35.00 F  |
| 12  | 1   | NA       | <b>*FRONT BUMPER</b><br>(WCP)         | Crumpled      | 220.00 F   | *220.00 F |
| 13  | 1   | NA       | <b>*FRONT GRILLE</b><br>(WCP)         | Crumpled      | 180.00 F   | *180.00 F |
| 14  | 1   | NA       | <b>*FRT BUMPER ABSORBER</b><br>(WCP)  | Crumpled      | 60.00 F    | *60.00 F  |
| 15  | 1   | NA       | <b>*FRT BUMPER SUPPORT</b><br>(WCP)   | Not Necessary | 150.00 F   | *- F      |
| 16  | 1   | NA       | <b>*HIGH TONE HORN</b><br>(WCP)       | Crumpled      | 60.00 F    | *60.00 F  |
| 17  | 1   | NA       | <b>*INNER FRT PANEL CPL</b><br>(WCP)  | Dented        | 300.00 F   | *300.00 F |
| 18  | 1   | NA       | <b>*INTAKE MANIFOLD</b><br>(WCP)      | * Check       | 280.00 F   | *- F      |
| 19  | 1   | NA       | <b>*L/BONNET HINGE</b><br>(WCP)       | * Check       | 32.00 F    | *- F      |
| 20  | 1   | NA       | <b>*LEFT HEADLAMP ASSY</b><br>(WCP)   | Crumpled      | 290.00 F   | *290.00 F |
| 21  | 1   | NA       | <b>*LEFT RETAINER</b><br>(WCP)        | Broken        | 35.00 F    | *35.00 F  |
| 22  | 1   | NA       | <b>*LOW TONE HORN</b><br>(WCP)        | * Check       | 60.00 F    | *- F      |
| 23  | 1   | NA       | <b>*LWR RADIATOR GRILLE</b><br>(WCP)  | Cut           | 70.00 F    | *70.00 F  |
| 24  | 1   | NA       | <b>*R/BONNET HINGE</b><br>(WCP)       | Not Necessary | 32.00 F    | *- F      |
| 25  | 1   | NA       | <b>*R/F WHEELHOUSE COVER</b><br>(WCP) | Cut           | 60.00 F    | *60.00 F  |
| 26  | 1   | NA       | <b>*RADIATOR</b><br>(WCP)             | Crumpled      | 450.00 F   | *450.00 F |
| 27  | 1   | NA       | <b>*RIGHT HEADLAMP ASSY</b><br>(WCP)  | Crumpled      | 290.00 F   | *290.00 F |

| No. | Qty | Part No. | Particulars                  | Condition     | Repairer's | Amount   |
|-----|-----|----------|------------------------------|---------------|------------|----------|
| 28  | 1   | NA       | *RIGHT RETAINER<br>(WCP)     | Crumpled      | 35.00 F    | *35.00 F |
| 29  | 1   | NA       | *UPP RADIATOR COVER<br>(WCP) | Crumpled      | 55.00 F    | *55.00 F |
| 30  | 1   | NA       | *WASHER CONTAINER<br>(WCP)   | Not Necessary | 80.00 F    | *- F     |
| 31  | 1   | NA       | *SUNDRY PARTS<br>(NPA)       | Not Necessary | 0.00 F     | *- F     |

F=Franchise part.

|                                           |          |          |
|-------------------------------------------|----------|----------|
| Sub Total (\$\$)                          | 4,262.00 | 3,228.00 |
| + Margin on L,N Items 10.00/10.00% (\$\$) | 426.20   | 322.80   |
| Total Parts (\$\$)                        | 4,688.20 | 3,550.80 |

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

| No                         | Qty | Particulars                                         | Repairer's | Amount |
|----------------------------|-----|-----------------------------------------------------|------------|--------|
| <b>Miscellaneous Items</b> |     |                                                     |            |        |
| 1                          | 10  | BONNET INSULATOR CLIP<br>(NECESSARY)                | 20.00      | 20.00  |
| 2                          | 10  | FRONT BUMPER CLIP<br>(NECESSARY)                    | 20.00      | 20.00  |
| 3                          | 1   | FRONT BUMPER PARKING SENSOR<br>(NECESSARY)          | 280.00     | 200.00 |
| 4                          | 1   | FRONT NUMBER PLATE<br>(NECESSARY)                   | 50.00      | 50.00  |
| 5                          | 5   | FRONT RADIATOR GRILLE CLIP<br>(NECESSARY)           | 10.00      | 10.00  |
| 6                          | 5   | FRONT SUPPORT PANEL TOP GARNISH CLIP<br>(NECESSARY) | 10.00      | 10.00  |
| 7                          | 8   | FRONT SUPPORT SPLASHIELD CLIP RH<br>(NECESSARY)     | 16.00      | 16.00  |
| Sub Total (\$\$)           |     |                                                     | 406.00     | 326.00 |

Recommended Labour

| No                       | Particulars                   | Lab.Type | Repairer's | Amount   |
|--------------------------|-------------------------------|----------|------------|----------|
| <b>Paintwork Labour</b>  |                               |          |            |          |
| 1                        | Total Paint Labour            | New      | 350.00     | 350.00   |
| 2                        | Total Paint Materials         | New      | 176.96     | 176.96   |
| <b>Labour Items</b>      |                               |          |            |          |
| 3                        | Total Panel/Mechanical Labour | New      | 800.00     | 800.00   |
| Gross Labour Cost (\$\$) |                               |          | 1,326.96   | 1,326.96 |

Report was unsubmitted during this print-out.

< END OF ESTIMATES >