

YM933SK. 2008 Sept.

Mitsubishi Canter. 2877cc

FE84BEA10258

TP AXA

Xiao Tay.

Front Bumper. Dented

864 ✓

Front Bumper Bracket RH. ^{HP} _{re}

153 +

Handlup RH. ^{HP} _{re}

586 x

Front RH Signal Lamp. Cracked

208 ✓

Front RH Reflector. Cracked

75 -

Front Grille

710. +

Front Grille Logo. ^{HP} _{re}

58 +

Front Grille Clips.

30(SN) +

Front RH Door Dented.

1827 ✓

Front RH Door Hinge. Best

132 ✓

Front RH Door Inner Trim Board ^{HP} _{re}

594 x

Front RH Door Inner Trim Board Clips. ^{HP} _{re}

30(SN) +

Front RH Door Weatherstripe ^{HP} _{re}

348 +

Front RH Step Garnish ^{HP} _{re}

290 ✓

YM 9335K.

Panel Beating

Spray Painting

Wiring.

To transfer door fittings.

Inst. 3396

Len 25%: 2547.

~~700~~ 450

~~600~~ 400

~~50~~ 30

~~150~~ 80

Labour: 860

Total: 3407

L/S: 2.7K

04 Days.

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: