



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2203427

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 06/06/2022
Reference CC3/CTI21005618/Tea3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHC 6641A
Insured Veh. XE 6155L
Claim No. SNM21D202694/C02
Policy No. DMCVSNW00011752100
Accident Date 07/05/2021
Inspection Date 07/05/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI21005618/Tea3q2 Date: 06/06/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	XE 6155L	Veh. Inspected	SHC 6641A
	Policy No.	DMCVSNW00011752100	Coverage (\$)	0.00
	Claim No.	SNM21D202694/C02	Excess (\$)	0.00
	Assign From		Assign Date	07/05/2021
2. Vehicle Particulars & Condition				
	Make & Model	KIA OPTIMA	c.c	1685
	Engine No.	HIDDEN	Year of Reg.	2015
	Chassis No.	KNAGM414MF5578375	Colour	SILVER
	Odometer	-	Steering	IN ORDER
	Brakes	IN ORDER	Modification	NIL
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	205/65 R15	MAXXIS	6 mm
	L/H Front Tyre	205/65 R15	MAXXIS	6 mm
	R/H Rear Tyre	205/65 R15	MAXXIS	6 mm
	L/H Rear Tyre	205/65 R15	MAXXIS	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	07/05/2021	Inspection Date	07/05/2021
	Survey held at	PREMIER AUTOMOTIVE SERVICES PTE LTD 23 CHANGI SOUTH AVENUE 2 #01-02 SINGAPORE 486443		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 6641A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT N/S HEAD LAMP	NOT NECESSARY	1,028.00	-
1	BONNET GRILLE	CRACKED	385.00	385.00
1	FRONT BUMPER	TORN	531.00	531.00
1	FRONT BUMPER EMBLEM	NOT NECESSARY	44.00	-
2	FRONT BUMPER N/S & O/S SIDE RETAINER @\$16.00	O/S NOT NECESSARY / N/S NECESSARY	32.00	16.00
1	FRONT BUMPER N/S UPPER BRACKET	NOT NECESSARY	16.00	-
1	FRONT BUMPER N/S SUPPORT BRACKET	NOT NECESSARY	16.00	-
1	FRONT BUMPER N/S PROTECTOR	NOT NECESSARY	51.00	-
1	FRONT BUMPER N/S FOG LAMP COVER	NOT NECESSARY	66.00	-
1	FRONT BUMPER CENTRE GRILLE	NOT NECESSARY	174.00	-
1	FRONT BUMPER LOWER STIFFER	NOT NECESSARY	134.00	-
1	FRONT BUMPER LIP	MISSING	52.00	52.00
1	FRONT N/S FENDER	BENT	384.00	384.00
1	FRONT N/S FENDER INNER SHIELD	TORN	120.00	120.00
1	FRONT N/S WHEEL COVER	DEFORMED	116.00	116.00
1	FRONT N/S RIM	TO REPAIR SEE LABOUR	246.00	-
1	FRONT N/S LOWER ARM	NOT NECESSARY	439.00	-
1	FRONT N/S SHOCK ABSORBER	NOT NECESSARY	330.00	-
1	FRONT N/S BALL JOINT	NOT NECESSARY	59.00	-
1	FRONT N/S KNUCKLE ARM	NOT NECESSARY	547.00	-
1	FRONT N/S KNUCKLE BEARING	NOT NECESSARY	157.00	-
1	FRONT N/S STABILIZER LINK	NOT NECESSARY	86.00	-
1	N/S MIRROR ASSY	CRACKED	590.00	590.00
	LESS 10% DISCOUNT		-560.30	-219.40
			5,042.70	1,974.60
<u>SPECIAL NETT ITEMS</u>				
1	FRONT BUMPER CLIPS (SN)	NECESSARY	48.00	30.00
1	FRONT N/S FENDER STICKER (SN)	NECESSARY	30.00	30.00

Report Ref No. CC3/CTI21005618/Tea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET FRONT N/S FENDER INNER SHIELD CLIPS (SN)	NECESSARY	28.00	20.00
1	SUNDRY (SN)	NOT NECESSARY	50.00	-
			156.00	80.00
	LABOUR			
	TO CHECK FRONT N/S WHEEL ALIGNMENT .		80.00	80.00
	TO DISMANTLE /REFIT FRONT N/S UNDERCARRIAGE .	NOT NECESSARY	250.00	-
	TO DISMANTLE /REFIT THE INNER GARNISHES ,INNER LININGS ,INNER TRIMS ,CUSHION SEAT ,CARPET ,ETC TO FACILITATE REPAIRS .	NOT NECESSARY	180.00	-
	TO LABOUR CHARGE FOR DISMANTLE AND RENEW THE ACCIDENT DAMAGED PARTS.INCLUDING KNOCK -OUT ,STRAIGHTEN ,REPAIR ,RESHAPE AND ADJUST OF THE SAME ETC .INCLUSIVE OF THE REPAIR OF FRONT N/S RIM .		800.00	400.00
	TO PUTTY AND SPRAY PAINTING ON FRONT BUMPER ,FRONT N/S FENDER ,BONNET GRILLE .		600.00	600.00
	TO APPLY RUSTPROOFING ON THE REPAIRED AND REPLACED PANELS.		150.00	30.00
			2,060.00	1,110.00
GRAND TOTAL			7,258.70	3,164.60
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,500.00

Report Ref No. CC3/CTI21005618/Tea3q2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 6641A

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

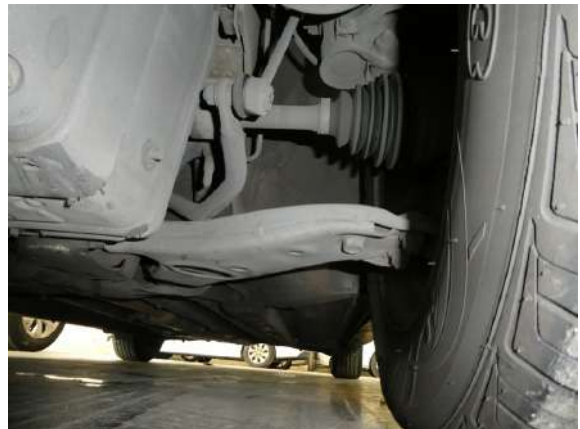



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

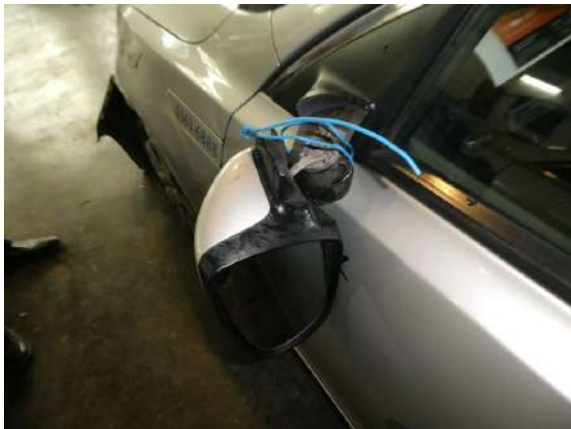



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHC 6641A

RE-INSPECTION

