

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CS/CTI21005681/KQF3N2**Date:** 15/09/2021**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMCVSNA00053312000

**Claimant Vehicle No :** SJJ3116J **Insured Vehicle No :** YM8923U

Date of Loss: 29/04/2021 Nature of Claim: TP Claim No: SNM21D202674/C02/TANKL

**DESCRIPTION & IDENTIFICATION OF VEHICLE**

Reg No: **SJJ3116J**

Make & Model: HONDA FIT, 1.3 G (A) Engine No: L13A4097102

Reg. Date: 08/09/2008 (Man. Year: 2008) Chassis No: GE61087333

Colour: Metallic Black Odometer: 176475 km

Engine Capacity: 1339 cc

Market Value/New Car Price: N/A

Sum Insured (\$\$): **Market Value/New Car Price**

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

**CONDITION OF TYRES**

Front Tyre Size: 195/55 R15 Rear Tyre Size: 195/55 R15

Front Left Side: Dunlop 7 mm Rear Left Side: Yokohama 8 mm

Front Right Side: Dunlop 7 mm Rear Right Side: Yokohama 8 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	280.00	280.00	0.00	0.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	150.00	110.00	40.00	26.67
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Gross Total (\$\$)</b>	<b>430.00</b>	<b>390.00</b>	<b>40.00</b>	<b>9.30</b>
<b>+ GST 7.00/7.00% (\$\$)</b>	30.10	27.30	2.80	9.30
<b>Nett Amount (\$\$)</b>	<b>460.10</b>	<b>417.30</b>	<b>42.80</b>	<b>9.30</b>

**INSPECTION**

Date of Assignment: 01/09/2021 Present Location: Cheng Hoe Motor Pte Ltd (Yishun)

Date Inspected: 30/08/2021 Inspected At: Cheng Hoe Motor Pte Ltd (Yishun)

Estimated Period of Repair: 1.0 days Blk 1019 #01-374/382, Yishun Industrial Park A Singapore 768761

**Adjuster:** KENNETH KONG**Manager:** SHIAU CHAN

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Reference

<b>Part Source:</b>	MRM-SG	Version: 1.0 (Last Synchronised: 15 Sep 2021)
<b>Parts:</b>	144	HONDA FIT 1.3 G (A) (Catalogue:Merimen Singapore 1.0)
<b>Labour:</b>	Repairer's	(Price-denominated Standard List)
<b>Print Code:</b>	(Unsubmitted, no print-code for SJJ3116J)	
<b>Validity:</b>	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
<b>Further Info:</b>	Items/values not in reference catalogue are prefixed with an asterisk *.	

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*1 PC FRT RH SIDE MIRROR	Jammed	250.00 F	*250.00 F
2	1		*1 PC FRT RH SIDE MIRROR COVER	Cracked	30.00 F	*30.00 F
<b>Total Parts (S\$)</b>						<b>280.00</b>

F=Franchise part.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	REMOVE & REFIX FRT RH SIDE MIRROR & CHECK SYSTEM	New	50.00	50.00
2	PUTTY & RESPRAY ON THE SIDE MIRROR COVER	New	100.00	60.00
<b>Gross Labour Cost (\$)</b>			<b>150.00</b>	<b>110.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >