

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG21005718/URS3Q2
Date: 01/11/2021**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1800060322
Claimant Vehicle No :	FBR27E	Insured Vehicle No :	GBH4037C
Date of Loss:	07/05/2021	Nature of Claim:	TP
		Claim No:	4397158575SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	FBR27E	Engine No:	MD38E2014509
Make & Model:	HONDA CRF250R, 250cc (M)	Chassis No:	MLHMD38A6D5006363
Reg. Date:	16/01/2015 (Man. Year: 2014)	Odometer:	61649 km
Colour:	Red/White		
Engine Capacity:	250 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:		Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	3.00-21	Rear Tyre Size:	4.00-18
Front Left Side:	Dunlop 6 mm	Rear Left Side:	Dunlop 6 mm
Front Right Side:	0 mm	Rear Right Side:	0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,171.00	545.50	625.50	53.42
Miscellaneous Items	0.00	0.00	0.00	
Labour	315.00	300.00	15.00	4.76
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	1,486.00	845.50	640.50	43.10
Approved Total (Overridden) (S\$)		670.00		

(S\$)	1,486.00	670.00	816.00	54.91
+ GST 7.00/7.00% (S\$)	104.02	46.90	57.12	54.91
Nett Amount (S\$)	1,590.02	716.90	873.12	54.91
+ Loss of Use (3.0 x S\$20.00/day) (S\$)		60.00		
+ Doc/Search Fee (S\$)		2.00		
Nett Liability (S\$)		778.90		

INSPECTION

Date of Assignment: 11/05/2021

Date Inspected: 11/05/2021

Estimated Period of Repair: 3.0 days

Inspected At:

Ban Hock Hin Co. Pte Ltd (HQ)
No. 6 Defu Lane 4
Singapore 539410

Adjuster: MARCUS CHUA**Manager:** Jaslin Kok Chin Yi

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*COVER FRONT FORK	Cracked	149.00 F	*149.00 FL
2	1		*COVER FRONT SIDE LH	Serviceable	174.00 F	*- FL
3	1		*COVER FRONT UPPER LH	Serviceable	138.00 F	*- FL
4	1		*COVER HEADLIGHT	Cut	174.00 F	*174.00 FL
5	1		*FASTENER, DUAL LOCK (11X28)	Not Necessary	31.00 F	*- FL
6	1		*MUDGUARD FRONT ASSY	Cut	139.00 F	*139.00 FL
7	1		*STAND SIDE	Bent	133.00 F	*133.00 FL
8	1		*STICKER COVER FRONT SIDE LH	Not Necessary	126.00 F	*- FL
9	1		*STICKER COVER FRONT UPPER LH	Not Necessary	83.00 F	*- FL
10	1		*STICKER NO PLATE FRONT (SILVER) STRAIGHT	Necessary	24.00 FS	*10.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	1,171.00	605.00
- List Item Discount on L Items 0.00/10.00% (\$\$)	0.00	59.50
Total Parts (\$\$)	1,171.00	545.50

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	LABOUR QUOTED FOR DISMANTLING AND INSTALLATION OF PARTS	New	315.00	300.00
Gross Labour Cost (S\$)			315.00	300.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >