



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2200174

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 07/01/2022
Reference CC3/CTI21005720/Kra3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHB 9999D
Insured Veh. GBG 6984K
Claim No. SNM21D202732/LKKDS
Policy No. DMCVSWW00081392000
Accident Date 06/05/2021
Inspection Date 10/05/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERS SINGAPORE 079909			Ref: CC3/CTI21005720/Kra3q2 Date: 07/01/2022 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBG 6984K	Veh. Inspected	SHB 9999D	
Policy No.	DMCVSWW00081392000	Coverage (\$)	0.00	
Claim No.	SNM21D202732/LKKDS	Excess (\$)	0.00	
Assign From		Assign Date	10/05/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS (A)	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2020	
Chassis No.	JTDKB3FU103092815	Colour	M.P WHITE / RED	
Odometer	68164 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	SAILUN	9 mm	
L/H Front Tyre	195/65 R15	SAILUN	9 mm	
R/H Rear Tyre	195/65 R15	SAILUN	9 mm	
L/H Rear Tyre	195/65 R15	SAILUN	9 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	06/05/2021	Inspection Date	10/05/2021	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 9999D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	COVER ,REAR BUMPER	BUCKLED	485.60	485.60
1	REINFORCEMENT SUB-ASSY ,REAR BUMPER	BENT	332.70	332.70
1	GUARD ,REAR BUMPER ,CENTER	BENT	374.50	374.50
1	COVER ,REAR BUMPER ,LOWER	SERVICEABLE	22.00	-
1	RETAINER ,REAR BUMPER SIDE ,LH	DISTORTED	132.60	132.60
1	RETAINER ,REAR BUMPER SIDE ,RH	SERVICEABLE	132.60	-
1	REFLECTOR ASSY ,REFLEX ,LH	CUT	39.00	39.00
1	REFLECTOR ASSY ,REFLEX ,RH	SERVICEABLE	39.00	-
1	BOX ,DECK FLOOR ,LH	DISTORTED	313.00	313.00
1	BOX ,DECK FLOOR ,REAR	SERVICEABLE	105.80	-
1	BOX ,DECK FLOOR ,RH	SERVICEABLE	313.60	-
1	BOARD ,REAR FLOOR ,NO.1	DEFORMED	519.00	519.00
1	PANEL SUB-ASSY ,BODY LOWER BACK	BENT	651.00	651.00
1	COVER ,DECK TRIM ,REAR	BUCKLED	126.70	126.70
1	COVER ,FLOOR UNDER .NO.2 (RH)	SERVICEABLE	241.90	-
1	COVER ,FLOOR UNDER .NO.1 (LH)	SERVICEABLE	175.10	-
1	COVER ,REAR FLOOR (CTR)	SERVICEABLE	229.90	-
1	LENS & BODY ,REAR COMBINATION LAMP ,LH	CRACKED	339.60	339.60
1	LENS & BODY ,REAR COMBINATION LAMP ,RH	SERVICEABLE	339.60	-
1	LENS & BODY ,REAR COMBINATION LAMP ,NO.2 LH	CRACKED	261.00	261.00
1	LENS & BODY ,REAR COMBINATION LAMP ,NO.2 RH	SERVICEABLE	261.00	-
1	LAMP ASSY ,REAR ,LH	CRACKED	293.60	293.60
1	LAMP ASSY ,REAR ,RH	SERVICEABLE	293.60	-
1	LAMP ASSY ,CENTER STOP	SERVICEABLE	192.30	-
1	SPOILER SUB-ASSY ,REAR	SERVICEABLE	1,575.40	-
1	PANEL SUB-ASSY,BACK DOOR	BENT	1,147.80	1,147.80
1	GARNISH SUB-ASSY ,BACK DOOR ,OUTSIDE	CRACKED	913.60	913.60
1	STAY ASSY ,BACK DOOR ,LH	SERVICEABLE	242.50	-
1	STAY ASSY ,BACK DOOR ,RH	SERVICEABLE	242.50	-
1	HINGE ASSY ,BACK DOOR ,LH	TO REPAIR SEE LABOUR	61.00	-

Report Ref No. CC3/CTI21005720/Kra3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	HINGE ASSY ,BACK DOOR ,RH	TO REPAIR SEE LABOUR	61.00	-
1	ORNAMENT SUB-ASSY ,BACK DOOR	NECESSARY	47.90	47.90
1	PLATE ,LUGGAGE COMPARTMENT DOOR NAME ,NO .2	NECESSARY	54.60	54.60
1	PLATE ,BACK DOOR NAME ,NO.1	NECESSARY	54.60	54.60
1	GLASS BACK WINDOW FIX	SHATTERED	761.40	761.40
1	PANEL ASSY ,DECK TRIM SIDE ,LH	SERVICEABLE	355.90	-
1	PANEL ASSY ,DECK TRIM SIDE ,RH	SERVICEABLE	355.90	-
1	PAN ,REAR FLOOR	TO REPAIR SEE LABOUR	583.40	-
	LESS 25% DISCOUNT		-3,168.05	-1,712.05
			9,504.15	5,136.15
	<u>SPECIAL NETT ITEMS</u>			
1	SET PARKING AID (SN)	SHORTED	700.00	220.00
1	SET REAR BUMPER CLIP (SN)	NECESSARY	85.00	50.00
1	REAR NUMBER PLATE WITH MOULDING (SN)	SERVICEABLE	200.00	-
1	REAR FLOOR UNDERCOVER CLIP (SN)	NOT NECESSARY	180.00	-
1	REAR SPOILER CLIP (SN)	NOT NECESSARY	70.00	-
1	BUMPER CENTRE GUARD CLIP (SN)	NOT NECESSARY	80.00	-
1	REAR BUMPER PROTECTOR (SN)	NECESSARY	180.00	30.00
1	REAR BUMPER RETAINER CLIP (SN)	NOT NECESSARY	75.00	-
1	BOOT STICKER TRANSCAB (SN)	NECESSARY	100.00	30.00
1	BOOT STICKER 65553333 (SN)	NECESSARY	100.00	30.00
2	WINDSCREEN SEALANT (SN)	NECESSARY	150.00	80.00
1	WINDSCREEN MOULDING (SN)	NECESSARY	200.00	200.00
1	WINDSCREEN INNER SPONGE SEAL (SN)	NECESSARY	130.00	30.00
			2,250.00	670.00
	<u>LABOUR</u>			
	TO RUST-PROOFING AND APPLY UNDERCOAT OF THE AFFECTED AREAS .		240.00	30.00
	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH,FITTINGS AND OTHER ,TO ENABLE REPAIR.		380.00	60.00

Report Ref No. CC3/CTI21005720/Kra3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.INCLUSIVE OF THE REPAIR OF HINGE ASSY ,BACK DOOR ,LH,HINGE ASSY ,BACK DOOR ,RH AND PAN ,REAR FLOOR .	NOT NECESSARY	1,600.00	700.00
	TO TRANSFER OF REAR END PANEL FITTINGS,ATTACHMENT TO FACILITATE BODYWORK REPAIR.		380.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION .		1,600.00	1,100.00
	TO REMOVE AND REFIT REAR BIG & SMALL W/SCREEN GLASS TO FACILITATE BODYWORK REPAIR.		300.00	180.00
	TO REINSTALL REAR BUMPER PARKING SENSOR .		170.00	50.00
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
			4,840.00	2,140.00
GRAND TOTAL			16,594.15	7,946.15
RECOMMENDED COST OF REPAIRS				7,946.15

Report Ref No. CC3/CT121005720/Kra3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 9999D

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 9999D

RE-INSPECTION

