

SIZE KANG AUTOMOBILE SPRAYING SERVICES

AMK Auto Point

Block 10, Ang Mo Kio Industrial Park 2A, #03-17, Singapore 568047

Telephone: 6481 2712 Fax: 6481 8684

INVOICE

TO: **officer-in-charge**

Date: 12/3/2021

Invoice no. : 104107
Vehicle no. : SJD7614T
Make / Model : HONDA / CROSSROAD

Finalised Amount : \$6,250.00

Total payable amount: \$6,250.00

Anthony Goh

SIZE KANG AUTOMOBILE SPRAYING SERVICES

AUTO PERFORMANCE APPRAISAL

APA

TAX INVOICE

Lee Eng Chye Vincent
C/O Sze Kang Automobile Spraying Services
10 Ang Mo Kio Ind. Park 2A
Ang Mo Kio Auto Point #03-17/09
Singapore 568047

INVOICE NO : APA21002158

DATE : 12/03/2021

VEHICLE NO : SJD7614T

JOB REFERENCE NO : 21/002241

ACCIDENT DATE : 25/02/2021

SURVEY DATE : 01/03/2021

<u>DESCRIPTION</u>	<u>AMOUNT</u>
Survey Fees Inclusive Of Transportation	\$490.00
Photographs (\$1) Per Copies : 63	\$63.00

TOTAL AMOUNT : \$553.00

Notes :

All cheque payment should be "Crossed" and made payable to "Auto Performance Appraisal"

Auto Performance Appraisal



AUTO PERFORMANCE APPRAISAL

APA

VEHICLE SURVEY REPORTS																																				
Lee Eng Chye Vincent C/O Sze Kang Automobile Spraying Services 10 Ang Mo Kio Ind. Park 2A Ang Mo Kio Auto Point #03-17/09 Singapore 568047																																				
1	Reference Job Reference No : 21/002241 Claim No : - Claim Type : Third Party Accident Date : 25/02/2021 Survey Date : 01/03/2021 Survey Report Date : 12/03/2021																																			
2	Particulars Of Vehicle Vehicle Registration No : SJD7614T Make & Model : Honda CrossRoad 1.8 A Vehicle Registration Date : 01/04/2008 Chassis No : RT11005042 Engine No : Blocked Colour : Black																																			
3	Condition Of Vehicle And Tyres <table border="1"><thead><tr><th><u>Mileage (KM)</u></th><th><u>Brakes</u></th><th><u>Steering</u></th><th><u>Modification</u></th></tr></thead><tbody><tr><td>224300</td><td>Serviceable</td><td>Serviceable</td><td>None</td></tr><tr><td colspan="4"> </td></tr><tr><th><u>Tyres</u></th><th><u>Make</u></th><th><u>Size</u></th><th><u>Balance (MM)</u></th></tr><tr><td>Front RHS</td><td>Yokohama</td><td>215/65R16</td><td>5</td></tr><tr><td>Front LHS</td><td>Yokohama</td><td>215/65R16</td><td>5</td></tr><tr><td>Rear RHS</td><td>Yokohama</td><td>215/65R16</td><td>6</td></tr><tr><td>Rear LHS</td><td>Yokohama</td><td>215/65R16</td><td>6</td></tr></tbody></table>				<u>Mileage (KM)</u>	<u>Brakes</u>	<u>Steering</u>	<u>Modification</u>	224300	Serviceable	Serviceable	None	 				<u>Tyres</u>	<u>Make</u>	<u>Size</u>	<u>Balance (MM)</u>	Front RHS	Yokohama	215/65R16	5	Front LHS	Yokohama	215/65R16	5	Rear RHS	Yokohama	215/65R16	6	Rear LHS	Yokohama	215/65R16	6
<u>Mileage (KM)</u>	<u>Brakes</u>	<u>Steering</u>	<u>Modification</u>																																	
224300	Serviceable	Serviceable	None																																	
<u>Tyres</u>	<u>Make</u>	<u>Size</u>	<u>Balance (MM)</u>																																	
Front RHS	Yokohama	215/65R16	5																																	
Front LHS	Yokohama	215/65R16	5																																	
Rear RHS	Yokohama	215/65R16	6																																	
Rear LHS	Yokohama	215/65R16	6																																	
4	Description Of Damages The vehicle sustained damages at left hand portion. (For information of damages please refer to Parts/Labour/Photographs attached)																																			
5	Instruction This survey was conducted entirely on a "WITHOUT PREJUDICE" basis, and we have not authorised any repair.																																			

AUTO PERFORMANCE APPRAISAL

Vehicle Assessment Reports

Annex A

Ref No : 21/002241

Damage And Repair Cost Adjustment

<u>S/No</u>	<u>Qty</u>	<u>Parts Description</u>	<u>Comments/condition</u>	<u>Workshop Estimate (\$)</u>	<u>Our Assessment (\$)</u>
			<u>List Items</u>		
1	1	Front LH side mirror assy	Broken/cracked	652.80	652.80
2	1	Front LH door	Distorted	1,209.70	1,209.70
3	1	Front LH door lower protector	Broken/deformed	231.00	231.00
4	1	Front LH door outer handle	Bent/dented	126.00	126.00
5	1	Front LH door glass	Shattered	528.60	528.60
6	1	Front LH door glass outer moulding	Deformed/bent	113.40	113.40
7	1	Front LH door glass regulator	Bent/jammed	163.50	163.50
8	1	Front LH door glass regulator motor	Malfunction	321.60	321.60
9	1	Front LH door glass channel	Bent	114.60	114.60
10	1	Front LH door inner lock	Bent/jammed	362.50	362.50
11	1	Front LH door weatherstrip	Necessary	150.00	150.00
12	1	Front LH door inner trim board	Deformed/broken	385.30	385.30
13	1 set	Front LH door inner trim board clips	Necessary	60.00	60.00
14	2	Front LH door hinge (Top & bottom)	Bent	164.00	164.00
15	1	Front LH door pillar	To repair	498.70	-
16	1	LH rocker panel	To repair	428.60	-
17	1	LH rocker panel outer cover/skirting	Broken	386.70	386.70
18	1 set	LH rocker panel outer cover/skirting clips	Broken/necessary	60.00	60.00
19	1	Rear LH door	Buckled	1,107.60	1,107.60
20	1	Rear LH door lower protector	Deformed	191.80	191.80
21	1	Rear LH door weatherstrip	Necessary	145.00	145.00
22	1	Rear LH door inner trim board	Serviceable/reuse	321.40	-
23	1 set	Rear LH door inner trim board clips	Necessary	60.00	60.00
24	2	Rear LH door hinge (Top & bottom)	1 pcs bottom bent	134.00	67.00
				7,916.80	6,601.10
Less discount 20%				1,583.36	1,320.22
Total :				6,333.44	5,280.88
			<u>Special Nett Items</u>		
25	1 set	Front/Rear LH door sound proofing insulation	Bent/dented	300.00	300.00
Total :				300.00	300.00
Total Spare Parts :				6,633.44	5,580.88

AUTO PERFORMANCE APPRAISAL

Vehicle Assessment Reports

Annex B

Ref No : 21/002241

Damage And Repair Cost Adjustment

<u>Items</u>	<u>Job Description</u>	<u>Workshop Estimate (\$)</u>	<u>Adjusted Costs (\$)</u>
1	To remove, jack out, straighten, panel beating, align and renew replaced parts.	1,200.00	800.00
2	To putty and respray painting on affected areas.	1,500.00	1,200.00
3	To check & repair wirings.	50.00	30.00
4	To remove, refix both LH door fittings to facilitate repair.	150.00	120.00
5	To conduct computerise wheel alignment test.	80.00	60.00
6	To supplied and applied anti rust treatments.	100.00	60.00
Total Labour :		3,080.00	2,270.00
Total Spare Parts :		6,633.44	5,580.88
Total Labour :		3,080.00	2,270.00
Total Repair Costs :		9,713.44	7,850.88

Assessor's Recommendation

Repairer Estimate : 9,713.44
Our Adjustment : 7,850.88

Remarks

The repairer has agreed to undertake the repair on a lump sum basis of \$6,250.00, with a repair period of 6 working days.

Surveyed By:



Lek Boon Hwee
Automobile Appraiser


APA

Job Reference No : 21/002260



APA

Job Reference No : 21/002260

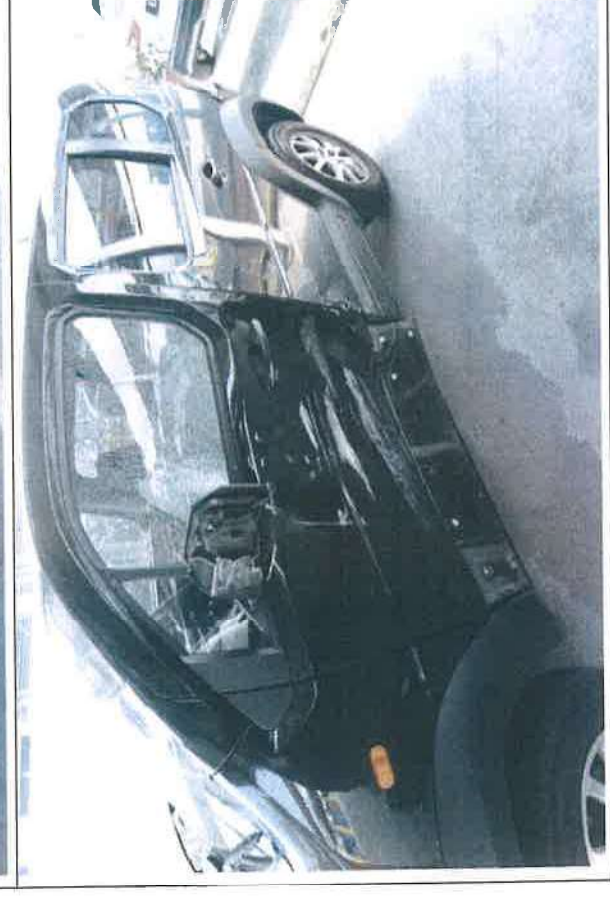

APA

Job Reference No : 21/002260



APA

Job Reference No : 21/002260



APA

Job Reference No : 21/002260




APA

Job Reference No : 21/002260





APA

Job Reference No : 21/002260

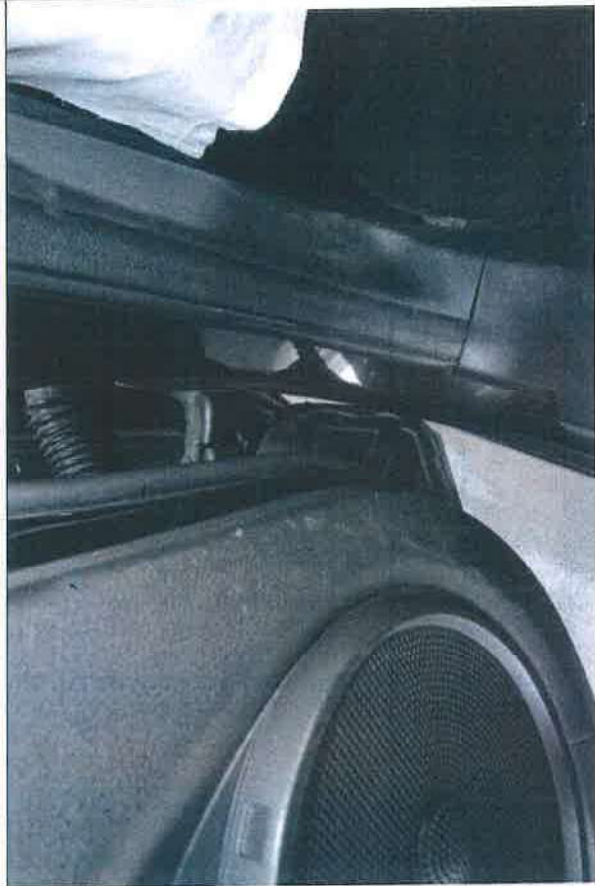



APA

Job Reference No : 21/002260

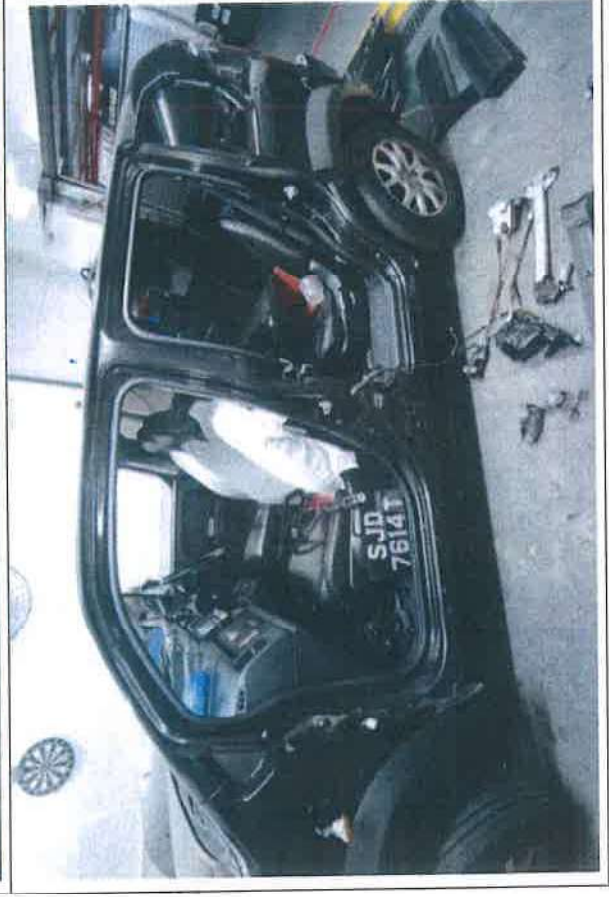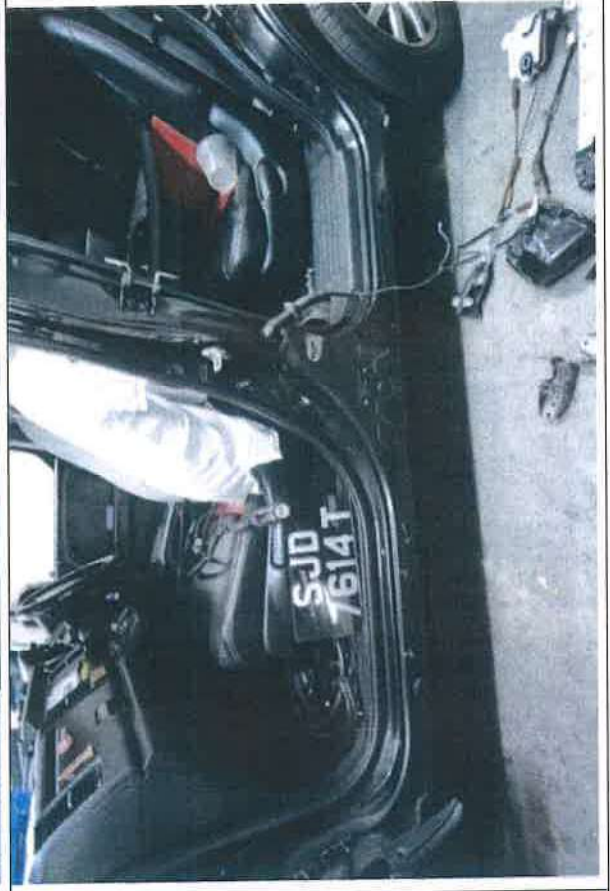



APA

Job Reference No : 21/002260

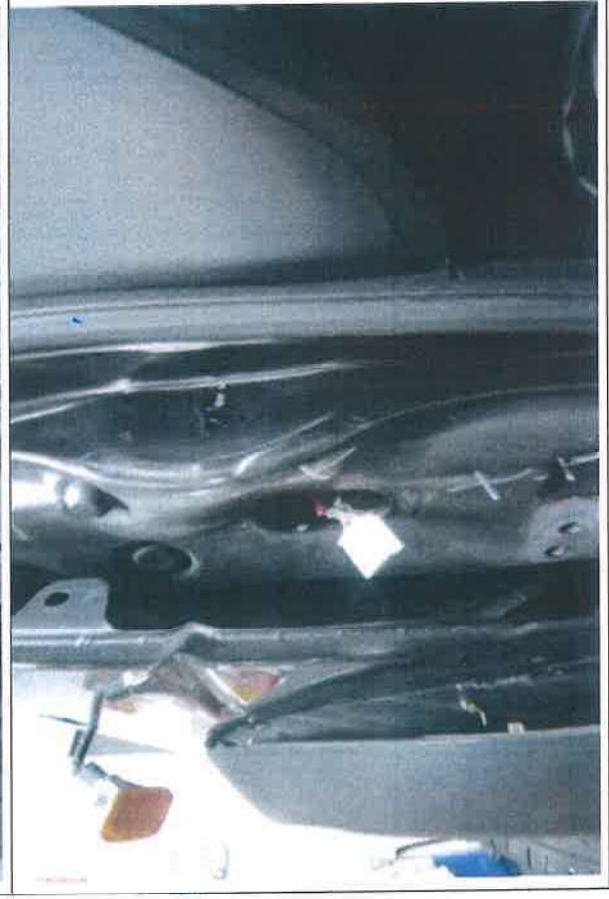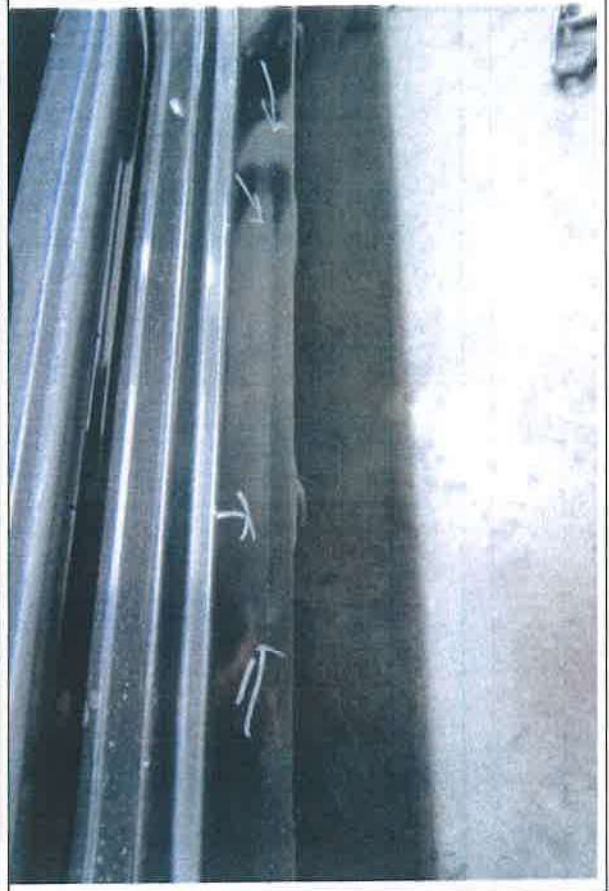


APA

Job Reference No : 21/002260

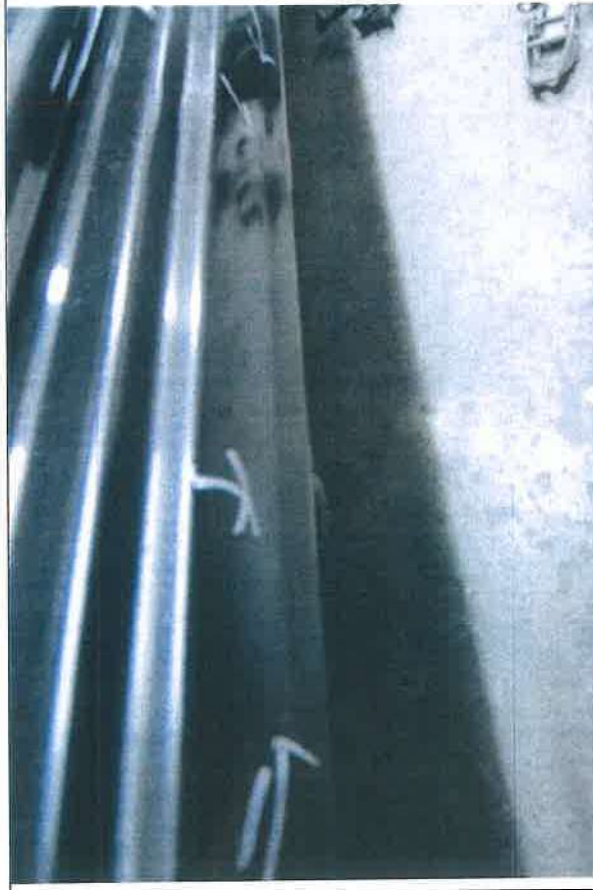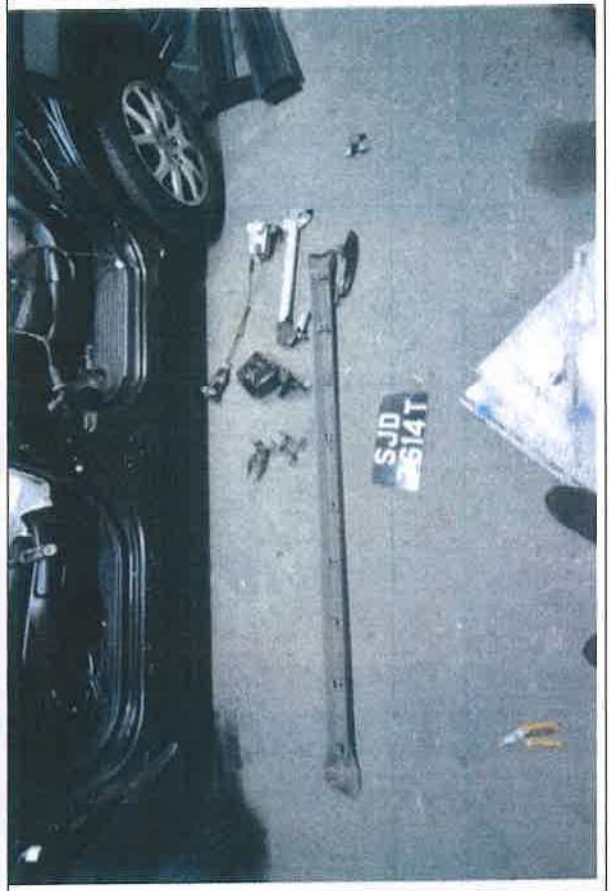

APA

Job Reference No : 21/002260

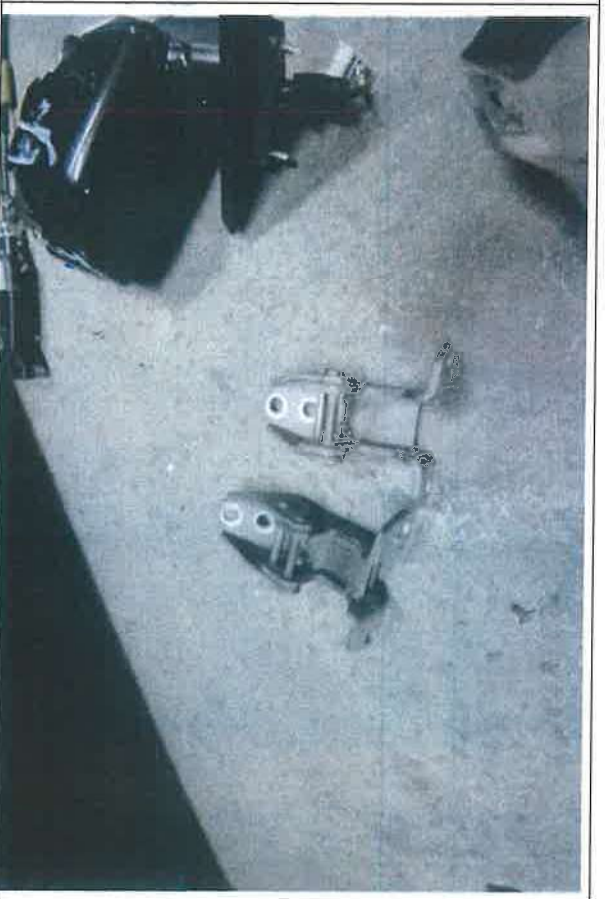


APA

Job Reference No : 21/002260



APA

Job Reference No : 21/002260

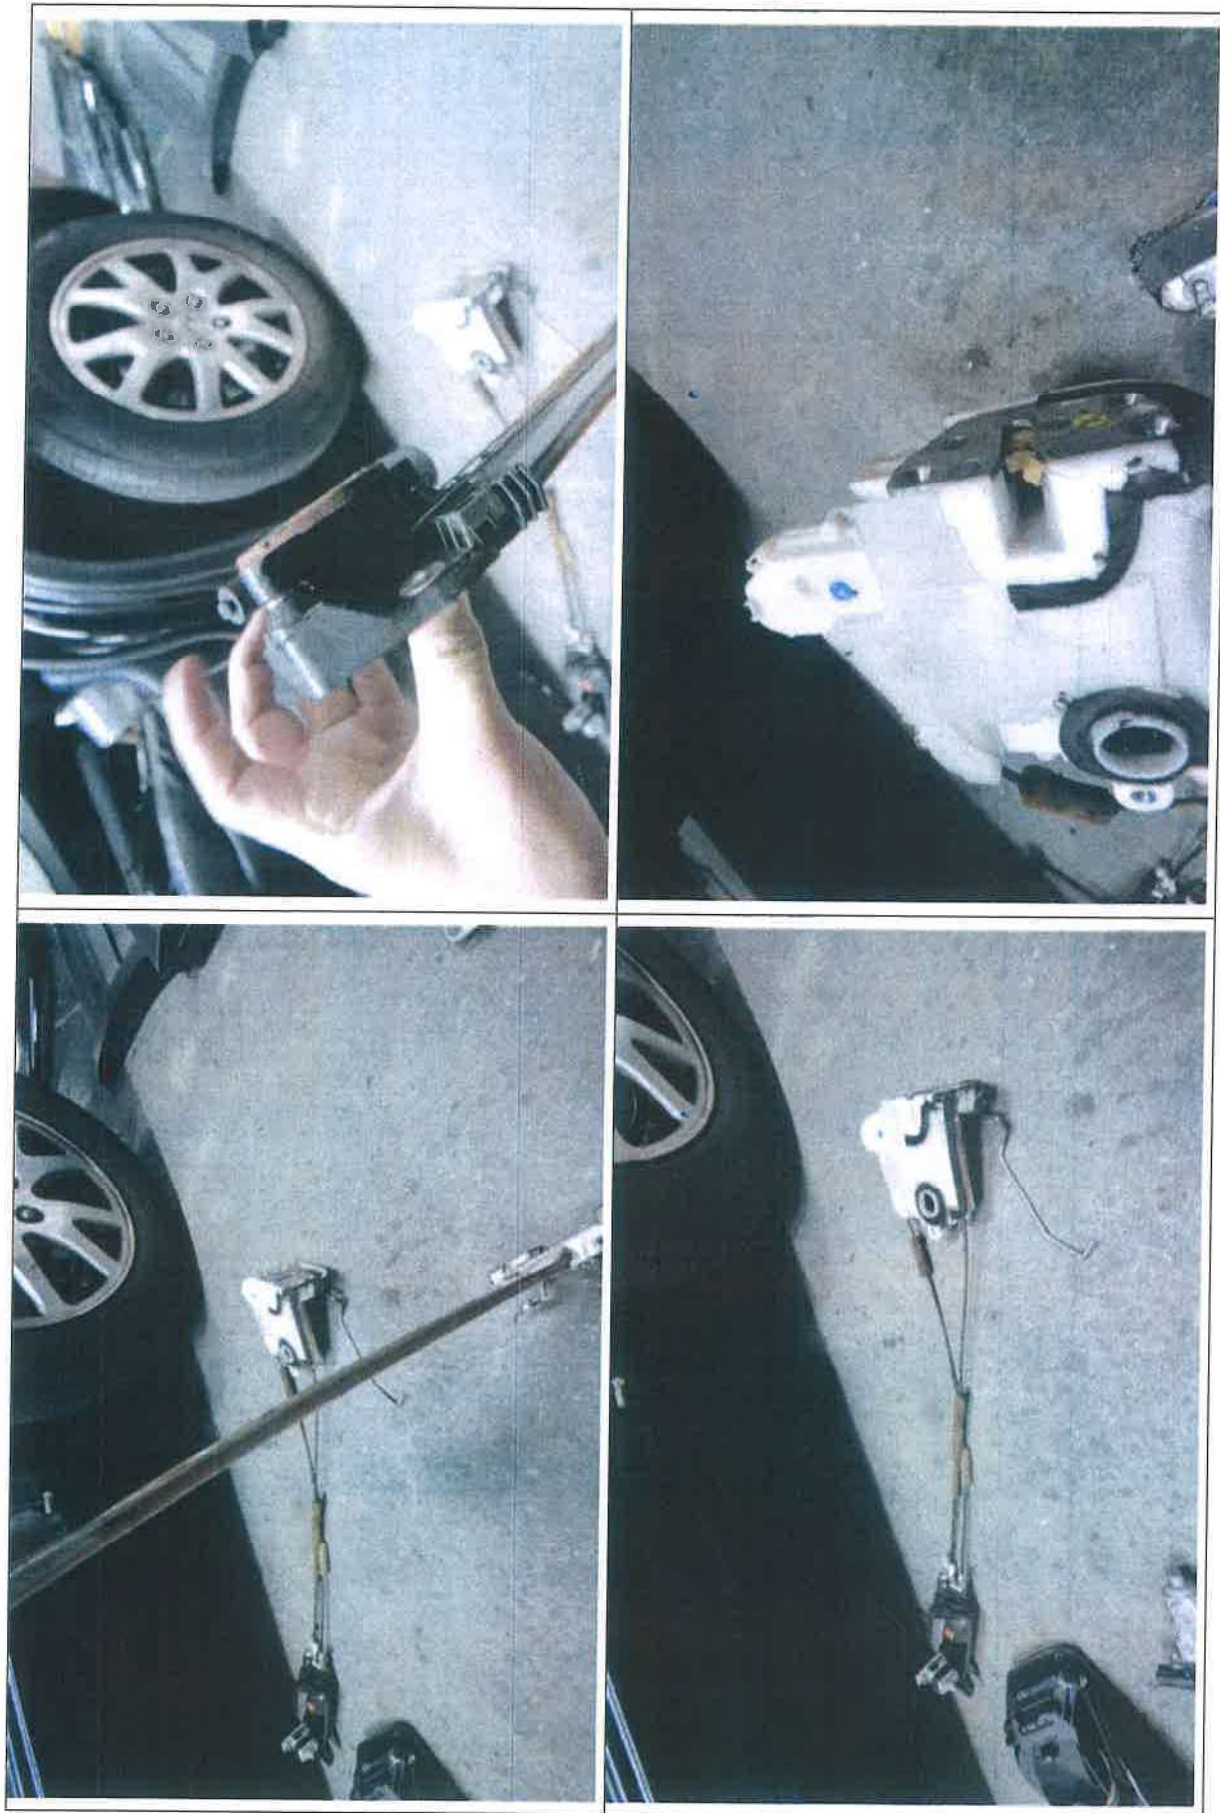

APA

Job Reference No : 21/002260



APA

Job Reference No : 21/002260



APA

Job Reference No : 21/002260

