

K A A S
kelvin automotive appraising services

6 tampines st 73, #01-03, singapore 528825
tel: 6746 2118 fax: 6746 1148
reg no: 53058468m

Claim Reference : -
Insured Vehicle No. : -
Thirty Party Veh No. : -
Officer-In-Charge : -

Our Reference : KAAS/6201/3564/TP/04.21
Date : 21 April 2021

To: Asia Express Car Rental Pte Ltd
c/o 25 Kaki Bukit Road 4
#01-55, Synergy @ Kaki Bukit
Singapore 417800

VEHICLE APPRAISAL REPORT

Name of Workshop : Apex Motoring
Place of inspection : 25 Kaki Bukit Road 4 #01-55, Synergy @ Kaki Bukit, Singapore 417800
Date of Assignment : 12 April 2021
Date of Accident : 09 April 2021
Date of Inspection : 12 April 2021

PARTICULARS OF INSPECTED VEHICLE

Registration No.	: SMK3564H	Chassis Frame No.	: GB71085174
Make / Model	: Honda Freed Hybrid 1.5G (A)	Engine No. (Logcard)	: LEB5622719
Year of Manufacture/Reg	: 2018	Odometer Reading	: 173,256KM
Colour	: White		
Class / Type	: MPV		

CONDITION OF VEHICLE DURING SURVEY (Visual & Static Check Only)

General Condition : Excellent
Paintwork : Excellent
Market Value : -
Scrap Value : -

U/S 83000
1 day

CONDITION OF TYRES ON VEHICLE

	<u>Make/Size</u>	<u>Thread Balance</u>
Front L	DUNLOP 185 / 65 R15	8 mm
Front R	DUNLOP 185 / 65 R15	8 mm
Rear L	DUNLOP 185 / 65 R15	8 mm
Rear R	DUNLOP 185 / 65 R15	8 mm

*The above is an estimate of the remaining life of the tyre thread in millimeters

The information contained in these documents may be privileged and confidential, and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you

APPRAISEMENT SCHEDULE

S/N	Qty	Descriptions	Conditions	Repairer's Estimate	Revised Amount
LIST ITEMS:-					
1	1 pc	rear bumper	deformed	\$ De 1,064.20	\$ 1,064.20
2	1 pc	tailgate	buckled	\$ DS 1,265.50	\$ 1,265.50
3	1 pc	tailgate " freed " emblem	necessary	\$ nu 64.20	\$ 64.20
4	1 pc	tailgate " hybrid " emblem	necessary	\$ nu 62.10	\$ 62.10
5	1 pc	tailgate inner lock	shifted	\$ nu 181.00	Realign
6	1 pc	tailgate inner trim board <i>use back</i>	deformed	\$ NH 331.90	\$ 331.90
7	1 pc	rear windscreen moulding	necessary	\$ nu 91.10	\$ 91.10
8	1 pc	rear end panel	dented	\$ R 717.25	Repair
9	1 pc	rear end panel top garnish <i>use back</i>	deformed	\$ NH 178.95	\$ 178.95
10	1 pc	tailgate weatherstrip <i>use back</i>	deformed	\$ NH 194.00	\$ 194.00
11	1 pc	rear bumper l/h side retainer	necessary	\$ nu 47.00	\$ 47.00
12	1 pc	rear bumper r/h side retainer	necessary	\$ nu 47.00	\$ 47.00
				\$ 4,244.20	\$ 3,345.95
Less 20%					\$ 669.19
				\$ 4,244.20	\$ 2,676.76
SPECIAL NETT ITEMS:-					
13	1 tube	rear windscreen silicon sealant	Necessary	\$ nu 100.00	\$ 60.00
14	1 set	reverse sensor	broken	\$ Should 300.00	\$ 250.00
				\$ 400.00	\$ 310.00
Sub - Total				\$ 4,644.20	\$ 2,986.76



KAAS
kelvin automotive appraising services
6 tampines st 73, #01-03, singapore 528825
tel: 6746 2118 fax: 6746 1148
reg no: 53058468m

Our Reference : KAAS/6201/3564/TP/04.21
Vehicle Number : SMK3564H

APPRAISEMENT SCHEDULE



S/N	Qty	Descriptions	Conditions	Repairer's Estimate	Revised Amount
		B/F		\$ 4,644.20	\$ 2,986.76
		LABOUR & OTHER CHARGES:-			
1		To panel beat and renewal of all necessary damaged body parts		\$ 1,200.00	\$ 550 1,000.00
2		To check rear wiring and rewire		\$ 60.00	\$ 20 50.00
3		To remove and reinstall tailgate components		\$ 80.00	\$ 60.00
4		To remove and reinstall rear windscreen		\$ 150.00	\$ 120.00
5		To remove and reinstall reverse sensor		\$ 140.00	\$ 50 100.00
6		To apply anti-rust		\$ 160.00	\$ 30 140.00
7		To putty and spray-paint of affected areas		\$ 1,000.00	\$ 600 850.00
				\$ 2,790.00	\$ 2,320.00
					2641.1 2112.88 3781
Sub - Total				\$ 7,434.20	\$ 5,306.76

ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact was delivered

Squarely to the Rear

portion of the vehicle.

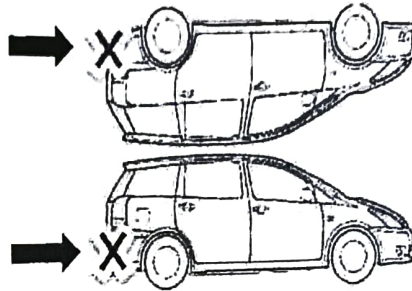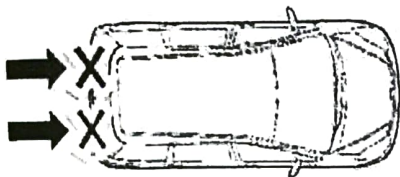

The general area of damages is at the
(Please refer to the parts list and photographs as attached for more information)

Rear portion

ASSESSOR'S RECOMMENDATIONS

The estimated repair costs submitted by Messrs

Apex Motoring

is \$ 7,434.20

We have adjusted the cost to \$ 5,306.76 and the repairer has agreed to undertake the repairs at a

Contract Lump Sum of \$ 4,250.00 to a acceptable quality and standards.

However, we have not given authorization and instruction to the repairer to proceed with the repairs.

The repairs should be completed within a reasonable period of 6 working days.

38 photographs were taken at the time of static inspection.

This report is strictly done in a **Without Prejudice Basis**.

We are reverting the matter to you a decision.

We enclose herewith our Invoice No.
we thank you for engaging our services.

6201

for our services rendered and

Approved By :

KELVIN TEO

Licensed Automotive Appraiser

Nitec in Automotive Technology

Cert. Crash Investigation & Reconstruction

Dip MS

MSAAA, AM SAE-A

NOTE : This revised estimate was from a visual inspection. Should there be any discrepancy or unseen items not listed in this survey, kindly notify
Otherwise this revised amount shall be treated as valid.