

SINCERE
APPRAISAL SERVICES PTE LTD

VEHICLE DAMAGE INSPECTION REPORT

Our Ref: 92/TP/2021

Date: 5/4/2021

REFERENCE

Date of loss: 16/3/2021
Claimant: Kriss Lee Theng Kao

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMU6843E	Make &	Renault
Reg date:	25/8/2020	Model	Grand Scenic IV 1.5
Colour:	Blue	Engine No:	K9KF649D060143
Type:	Motor Car	Chassis No:	VF1RFA00X63926181
Type of Claims:	Third Party	Odometer No:	32916km
		Engine Cap:	1461cc

CONDITION OF VEHICLE AT THE TIME OF SURVEY (STATIC ONLY)

General Condition: Good	Steering: Good	Engine Modification: Nil
Paint work: Good	Handbrake: Good	Pre-accident
	Footbrake: Good	Damage: Nil

CONDITION OF TYRES

Front Left Size:	Michelin 195/55R20 70%	Front Right Size:	Michelin 195/55R20 70%
Rear Left Size:	Michelin 195/55R20 70%	Rear Right Size:	Michelin 195/55R20 70%

The above percentages represent the remaining life of the tyre threads

COST OF REPAIRS

Parts
Labour

Calculated Cost (S\$) :

Repairer S\$	Adjuster S\$
\$ 18,203.90	\$ 16,148.70
\$ 4,120.00	\$ 3,480.00
<u>\$ 22,323.90</u>	<u>\$ 19,628.70</u>

Recommended Lump Sum Repair Cost (S\$) : \$ 15,700.00

Date of Assignment: 18/3/2021
Date Inspected: 18/3/2021
Est. repair Period: 09 days

Inspected At: Auto City Pte Ltd
No. 32 Kaki Bukit Crescent,
Singapore 416262


SINCERE APPRAISAL SERVICES PTE LTD Co.Reg no: 201800639R

420 North Bridge Road, #02-05 North Bridge Centre, Singapore 188727

Tel : 6636 4628 E-mail : office@sincereappraisal.com.sg

POINT OF IMPACT

Damaged at the right hand front and front right undercarriage.

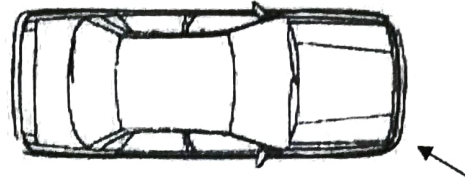

BRIEF CIRCUMSTANCES OF ACCIDENT

The Insured's vehicle collided onto the Third Party's vehicle at the junction of Tampines Central 1 and Tampines Avenue 4.

GENERAL DESCRIPTION OF DAMAGES

Our visual inspection of the vehicle revealed that the damages noted are at the right hand front and front right undercarriage.

SPECIAL REMARKS

We have inspected the actual damages found on the vehicle and recommend the replacement of parts and repairs accordingly. The estimated repair cost is \$22,323.90. The repairer has agreed to undertake the repairs at our adjusted lump sum amount of \$15,700.00.

We have not authorised the repair. Under normal circumstances, estimated 09 working days are required to repair the vehicle.

We are pleased to advise that the inspection work was carried out accordingly, and hereby submit our Inspection Report and photographs.



Dave Chang
Automotive Appraiser
AUTO. ENG, CAE, CGI
MIRTE, MSAAA, MTM

Automotive Appraiser: Dave Chang

Please note that this report is solely based on our findings at the time and place of inspection. This inspection has been carried out to our best knowledge and ability. Any other liability is hereby excluded.

REPAIR DETAILS

Recommended Parts

No	Qty	Description	Condition	Repairer's Amount	Adjuster's Amount
1	1	Front bumper assy ✓	warped/dented	\$ 1,289.00	\$ 1,289.00 ✓
2	1	Front bumper right bracket ✓	bent/necessary	\$ 64.00	\$ 64.00 ✓
3	1	Front bumper right side retainer ✓	bent/necessary	\$ 69.00	\$ 69.00 ✓
4	1	Front bumper lower grille	reuse	\$ 187.00	\$ -
5	1	Front bumper beam X	bent/dented	\$ 366.00	\$ 366.00 ✓
6	1	Front bumper reinforcement X <i>SVC</i>	warped/dented	\$ 443.00	\$ 443.00 ✓
7	1	Front bonnet lock ✓	bent	\$ 288.00	\$ 288.00 ✓
8	1	Front bonnet assy	repair	\$ 1,475.00	\$ -
9	1	Front bonnet right damper X <i>SVC</i>	malfunction	\$ 125.00	\$ 125.00 ✓
10	1	Front grille assy ✓	cracked	\$ 487.00	\$ 487.00 ✓
11	1	Front grille centre logo ✓	necessary	\$ 108.00	\$ 108.00 ✓
12	1	Front support panel assy ✓	cracked	\$ 1,262.00	\$ 1,262.00 ✓
13	1	Front support panel top garnish (upper) ✓	cracked	\$ 265.00	\$ 265.00 ✓
14	1	Front support panel top garnish (lower) ✓	cracked	\$ 268.00	\$ 268.00 ✓
15	1	Front support panel inner garnish ✓	cracked	\$ 335.00	\$ 335.00 ✓
16	1	Front left headlamp ✓	cracked	\$ 1,486.00	\$ 1,486.00 ✓
17	1	Front left headlamp support panel	repair	\$ 166.00	\$ -
18	1	Front right headlamp ✓	bent/cut	\$ 1,486.00	\$ 1,486.00 ✓
19	1	Front right headlamp support panel ✓	bent/necessary	\$ 166.00	\$ 166.00 ✓
20	1	Front right fog lamp X <i>SVC</i>	bent/cut	\$ 280.00	\$ 280.00 X
21	1	Front right fog lamp garnish ✓	bent/necessary	\$ 148.00	\$ 148.00 ✓
22	1	Front right suspension assy ✓	bent	\$ 1,285.00	\$ 1,285.00 ✓
23	1	Front right aluminium knuckle arm ✓	bent	\$ 1,195.00	\$ 1,195.00 ✓
24	1	Front right lower arm ✓	bent	\$ 498.00	\$ 498.00 ✓
25	1	Front right wheel hub bearing ✓	necessary	\$ 351.00	\$ 351.00 ✓
26	1	Front wiper tank ✓	warped	\$ 120.00	\$ 120.00 ✓
27	1	Front horn ✓	malfunction	\$ 141.00	\$ 141.00 ✓
28	1	Front right brake disc X <i>SVC</i>	bent/necessary	\$ 350.00	\$ 350.00 X
29	1	Front right brake disc plate X <i>SVC</i>	bent/necessary	\$ 98.00	\$ 98.00 X
30	1	Front right fender ✓	buckled	\$ 1,681.00	\$ 1,681.00 ✓
31	1	Front right chassis member X <i>repair</i>	bent/necessary	\$ 989.00	\$ 989.00 X
Less 10%				\$ 17,471.00	\$ 15,643.00
				\$ 1,747.10	\$ 1,564.30
				\$ 15,723.90	\$ 14,078.70

8229.6

ANNEX A

REPAIR DETAILS

Recommended Parts

No	Qty	Description	Condition	Repairer's Amount	Adjuster's Amount
<u>Special Nett Items</u>					
1	10	Front bumper clips	necessary	\$ 60.00	\$ 50.00 30
2	6	Front grille clips	necessary	\$ 40.00	\$ 30.00 20
3	1	Front no plate with garnish X GVC	necessary	\$ 100.00	\$ 80.00 X
4	6	Front support panel top garnish clips (upper)	necessary	\$ 40.00	\$ 30.00 20
5	6	Front support panel top garnish clips (lower)	necessary	\$ 40.00	\$ 30.00 20
6	1 set	Front parking sensor	malfunction	\$ 1,200.00	\$ 1,000.00 200
7	1	Front right sport rim	grazed/cut	\$ 1,000.00	\$ 850.00 380
				<u>\$ 2,480.00</u>	<u>\$ 2,070.00</u>
Total parts				\$ 18,203.90	\$ 16,148.70

G70

ANNEX B

REPAIR DETAILS

Recommended Labour

No	Description	Repairer's Amount	Adjuster's Amount	
1	Labour for panel beating, cut, weld, straighten front and front right affected area and replace front and front right damaged parts.	\$ 1,400.00	\$ 1,200.00	600
2	To putty and spray painting front and front right portion.	\$ 1,400.00	\$ 1,200.00	800
3	To check wiring and focus front headlamp.	\$ 50.00	\$ 30.00	/
4	To remove and install front bonnet lock mechanism.	\$ 80.00	\$ 60.00	/
5	To apply anti rust proofing to front and front right affected area.	\$ 140.00	\$ 120.00	60
6	To remove and install front right undercarriage parts.	\$ 350.00	\$ 300.00	200
7	To balance front right wheel.	\$ 50.00	\$ 30.00	/
8	To conduct wheel alignment.	\$ 120.00	\$ 100.00	60
9	To synchronise the front parking sensor and check for function.	\$ 80.00	\$ 60.00	40
10	Towing service.	\$ 100.00	\$ 80.00	50
11	To conduct chassis alignment.	\$ 350.00	\$ 300.00	200
Total labour :		\$ 4,120.00	\$ 3,480.00	2130

ANNEX C

REPAIR DETAILS

Adjusted Repair Cost

	Repairer's Amount	Adjuster's Amount
Total parts :	\$ 18,203.90	\$ 16,148.70
Total labour :	\$ 4,120.00	\$ 3,480.00
Total repair cost :	\$ 22,323.90	\$ 19,628.70

Adjusted Repair Cost (Lump Sum Repair)

\$ 15,700.00

11028.6

20%: 8800

7 Days.