

REF: C72/ 21006043/KV

Kenneth

From: _____ Date: _____

Estimated Cost: _____

QD / TP / WS / TP RES / QD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____ *Purdy*

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S		

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 02 days Res.: Yes or No

Lum Sum: 1. B. 1 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT _____

Veh No: JKW 88X Yr Regn: 01, 17
Type: (M) Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or
Make: M. S400 C.C. 2996
Colour: M. Brown A/C: Insured / Std / NI / NA
Sp. Reading: 47262 T/Radio: Insured / Std / NI / NA
Eng/No:
C/No: WDD 2 221652A 296648
Gen. Cond: Good / Fair / Poor / Burnt
Steering: (In) order / Jammed / Leaked / Burnt or
Brake: (In) order / Jammed / Leaked / Burnt or
Modl: NII / S/Rlm / STD (A) Rlm or
Tyre Size: F: 245/45R19
R: _____
BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU (PIR) SUMI /
TOYO / YOKO or
Front
R/Bal. S mm
L/Bal. S mm
D.O.A. 10/5/21
Survey held at
Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
The U/C / Chassis frame / Body Structure affected due to collision.

[illegible]

Date/Time, File Pass to? ☐ : Prel. Report
1) ☐ : Final Report

Date/Time, File Return to?

27

Days Of Repair:

Resurvey No. of Trip:

Add Fee: ☐ : Site Insp (\$
☐ : Interview (\$
☐ : Tech Invs (\$
☐ : Weekend (\$

Survey Fee:

Transportation:

1) S • RS. SI

1. Explain

Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$

Ready Auto Care Pte Ltd - We Care For All Your Car Needs

Blk 10 # 03-06 AMK Auto Point, Ang Mo Kio Ind Park 2A, Ang Mo Kio Ave 5. Singapore 568047
Tel : 64810304 Fax : 64815587 Reg No : 200600989K GST No : 200600989k

China Taiping Insurance (Singapore) Pte Ltd
Motorcar Claim Department

Estimate Repair

Date : 24/5/2021

Accident Involving SLG1779B & SKW88X On 10/05/2021 At Filter Lane Of Yishun Ave 2

Item	Descriptions	Amount
1	Rear Bumper	\$ 2,245.00 ✓
2	Rear Bumper Reinforcement - To Check	?

Total For Parts (Less 10%) \$ 2,245.00

S/N Item (s)

1	Rear Bumper Clips - 1 Set	\$ 35.00 ✓
---	---------------------------	------------

Total For S/N \$ 35.00

Labour & Misc

1	To Remove All Damaged Parts, Knock Out Dents, Jack Out Damaged Panel	\$ 380.00
2	Panel, Adjust, Replace, Reshape, Cut, Weld, Refix & Realign Body Structure	\$ 350.00
3	Spray Painting For New And Repair Parts Including Supply Of Paints Materials	\$ 150.00
4	Computer Diagnose To Reset Parking Sensor False Memory	\$ 80.00
5	Check Wiring, Lighting System For Proper Function	\$ 50.00
7	Cavity Preservation On All Affected Areas	\$ 60.00

\$ 1,070.00

Total For Parts & Labour \$ 3,350.00

Ready Auto Care Pte Ltd
Sulynn - 96606551

No Of Days For Repair 2 Days

Not with the
Repairing Bumper

2 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature: _____
Date: _____