

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/MSG20013262/GTF3E2-1

Date: 08/06/2021

REFERENCE

Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd.	Policy No:	29145468MKC		
Claimant Vehicle No :	SLZ8831L	Insured Vehicle No :	GBC7059X		
Date of Loss:	30/11/2020	Nature of Claim:	TP	Claim No:	631507

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLZ8831L	Engine No:	P520495238
Make & Model:	MAZDA 3, 1.5 HATCHBACK DELUXE EU6 (A)	Chassis No:	JM6BN24A8J0204693
Reg. Date:	22/05/2018 (Man. Year: 2017)	Odometer:	45835 km
Colour:	Grey		
Engine Capacity:	1496 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/45 R17	Rear Tyre Size:	225/45 R17
Front Left Side:	Continental 6 mm	Rear Left Side:	Continental 6 mm
Front Right Side:	Continental 6 mm	Rear Right Side:	Continental 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	14,751.60	7,533.80	7,217.80	48.93
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,660.00	1,890.00	2,770.00	59.44
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	19,411.60	9,423.80	9,987.80	51.45
Approved Total (Overridden) (S\$)		7,550.00		
(S\$)	19,411.60	7,550.00	11,861.60	61.11
+ GST 7.00/7.00% (S\$)	1,358.81	528.50	830.31	61.11
Nett Amount (S\$)	20,770.41	8,078.50	12,691.91	61.11

INSPECTION

Date of Assignment:	01/12/2020		
Date Inspected:	02/12/2020	Inspected At:	Precise Auto Service (HQ) No 1 Kaki Bukit Ave 6, #02-34/36 Singapore 417883
Estimated Period of Repair:	6.0 days		

Adjuster: XING GUO QIANG

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 08 Jun 2021)

Parts: 144 MAZDA 3 1.5 HATCHBACK DELUXE EU6 (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SLZ8831L)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*TAIL GATE	Dented	1,333.00 FL	*1,333.00 FL
2	2		*TAIL GATE HINGE	Serviceable	66.00 FL	*- FL
3	1		*TAIL GATE LOCK	Dented	284.00 FL	*284.00 FL
4	1		*TAIL GATE LOCK STRIKER	Serviceable	61.00 FL	*- FL
5	2		*TAIL GATE STOPPER	Serviceable	32.00 FL	*- FL
6	1		*TAIL GATE WEATHERSTRIPE	Kinded	147.00 FL	*147.00 FL
7	1		*TAIL GATE OUTER GARNISH	Cracked	449.00 FL	*449.00 FL
8	4		*TAIL GATE OUTER GARNISH CLIPS	Necessary	20.00 FL	*20.00 FL
9	1		*TAIL GATE BADGE	Necessary	79.00 FL	*79.00 FL
10	1		*TAIL GATE EMBLEM SKY ACTIVE	Necessary	67.00 FL	*67.00 FL
11	1		*TAIL GATE EMBLEM MAZDA 3	Necessary	57.00 FL	*57.00 FL
12	2		*TAIL GATE REFLECTOR	Base Cracked	466.00 FL	*466.00 FL
13	4		*TAIL GATE REFLECTOR CLIPS	Necessary	20.00 FL	*20.00 FL
14	1		*TAIL GATE OUTER KEYLESS ANTENNA	Cracked	142.00 FL	*142.00 FL
15	1		*TAIL GATE OPENER SWITCH	Serviceable	188.00 FL	*- FL
16	1		*TAIL GATE OUTER HANDLE SWITCH	Deformed	125.00 FL	*125.00 FL
17	1		*TAIL GATE INNER TRIM BOARD	Deep Cut	414.00 FL	*414.00 FL
18	8		*TAIL GATE INNER TRIM BOARD CLIPS	Necessary	40.00 FL	*40.00 FL
19	1		*TAIL GATE TOP SPOILER	Serviceable	1,215.00 FL	*- FL
20	8		*TAIL GATE TOP SPOILER CLIPS	Necessary	40.00 FL	*40.00 FL
21	2		*TAIL GATE ABSORBER	Bent	256.00 FL	*256.00 FL
22	1		*REAR WIPER ARM	Not Necessary	62.00 FL	*- FL
23	1		*REAR WIPER ARM COVER	Not Necessary	13.00 FL	*- FL
24	1		*REAR WIPER BLADE	Torn	24.00 FL	*24.00 FL
25	1		*REAR WIPER MOTOR	Serviceable	383.00 FL	*- FL
26	1		*REAR WINDSCREEN GLASS	Shattered	1,010.00 FL	*1,010.00 FL
27	1		*REAR WINDSCREEN GLASS INNER SEAL	Necessary	50.00 FL	*50.00 FL
28	2		*REAR WINDSCREEN GLASS INNER SIDE TRIM	Serviceable	278.00 FL	*- FL
29	1		*REAR WINDSCREEN GLASS INNER TRIM (TOP)	Serviceable	84.00 FL	*- FL
30	2		*REAR NUMBER PLATE LAMP	Holder Torn	92.00 FL	*92.00 FL
31	1		*REAR NUMBER PLATE LAMP GARNISH	Serviceable	166.00 FL	*- FL
32	1		*REAR BUMPER FASCIA	Dented	998.00 FL	*998.00 FL
33	2		*REAR BUMPER TOW COVER	Serviceable	32.00 FL	*- FL
34	1		*REAR BUMPER SIDE RETAINER RH	Torn	38.00 FL	*38.00 FL
35	10		*REAR BUMPER CLIPS	Necessary	50.00 FL	*50.00 FL
36	1		*REAR BUMPER LOWER GARNISH	Deformed	78.00 FL	*78.00 FL
37	4		*REAR BUMPER LOWER GARNISH RIVETS	Necessary	20.00 FL	*20.00 FL
38	1		*REAR BUMPER REINFORCEMENT	Dented	565.00 FL	*565.00 FL
39	1		*REAR BUMPER PARKING SENSOR (4PCS)	Shorted (2Pcs only)	816.00 FN	*200.00 F
40	1		*REAR BUMPER PARKING SENSOR WIRE HARNESS	Serviceable	158.00 FL	*- FL
41	2		*REAR BUMPER REFLECTOR	Holder Torn	106.00 FL	*106.00 FL
42	2		*TAIL LAMP	Base Cracked	1,944.00 FL	*1,340.00 FL
43	4		*TAIL LAMP CLIPS	Serviceable	64.00 FL	*- FL
44	2		*TAIL LAMP SEALANT	Not Necessary	84.00 FL	*- FL
45	1		*REAR END PANEL	Repair	656.00 FL	*- FL

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
46	1		*REAR END PANEL TOP TRIM	Deformed	101.00 FL	*101.00 FL
47	4		*REAR END PANEL TOP TRIM CLIPS	Necessary	20.00 FL	*20.00 FL
48	2		*REAR FENDER INNER TRIM RH & LH	Not Necessary	964.00 FL	*- FL
49	6		*REAR FENDER INNER TRIM LIPS	Necessary	30.00 FL	*30.00 FL
50	1		*EXHAUST SILENCER	Serviceable	1,075.00 FL	*- FL
51	4		*EXHAUST SILENCER HOOK	Not Necessary	140.00 FL	*- FL
52	1		*REAR WINDSCREEN GLASS SEALANT	Necessary	60.00 FS	*50.00 FS
53	1		*REAR WINDSCREEN GLASS SOLAR FILM	Necessary	180.00 FS	*120.00 FS
54	1		*REAR NUMBER PLATE }	Dented	45.00 FS	*45.00 FS
55	1		*REAR NUMBER PLATE CASING }	Dented	29.00 FS	*- FS
56	1		*REVERSE CAMERA	Serviceable	756.00 FS	*- FS
57	1		*SET REAR VIDEO RECORDER	Dislodged	1,200.00 FS	*350.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc. N=NettItemDisc.

Sub Total (S\$)	17,872.00	9,226.00
- List Item Discount on L Items 20.00/20.00% (S\$)	2,957.20	1,692.20
- Nett Item Discount on N Items 20.00/0.00% (S\$)	163.20	0.00
Total Parts (S\$)	14,751.60	7,533.80

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TOWING	New	80.00	60.00
2	TO CHECK WIRING SYSTEM	New	80.00	30.00
3	TO TUFF COAT AFFECTED AREAS	New	200.00	60.00
4	TO REMOVE & REFIX REAR WINDSCREEN GLASS	New	180.00	120.00
5	TO REMOVE & REFIX REAR VIDEO RECORDE	New	180.00	80.00
6	TO REMOVE & REFIX EXHAUST SILENCER & STRAIGHTEN EXHAUST CENTER PIPE	New	280.00	0.00
7	TO REMOVE & REFIX INTERIOR UPHOLSTERY	New	180.00	60.00
8	TO CLEANING INTERIOR UPHOLSTERY	New	180.00	30.00
9	TO RESET ECU SYSTEM AFTER REPAIR	New	300.00	50.00
10	TO RENEW DAMAGED PARTS, STRAIGHTEN & REPAIR, REAR FENDER, REAR FLOOR PANEL AND ALIGNED ALL PARTS	New	1,500.00	700.00
11	TO RESPRAY AFFECTED AREAS	New	1,500.00	700.00
Gross Labour Cost (\$\$)			4,660.00	1,890.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >