

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #07-16
Singapore 079120

Our File No: CS/AIG21006071/ETF3E2

Date: 01/07/2021

REFERENCE

Insured/Claimant:	TAY HEE HUAT	Policy No:	1800042163		
Date of Loss:	22/05/2021	Nature of Claim:	OD	Claim No:	8636666000SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJX9133X		
Make & Model:	MITSUBISHI OUTLANDER, 2.0 (A)	Engine No:	4J11XS6664
Reg. Date:	24/04/2018 (Man. Year: 2018)	Chassis No:	GF7W0401404
Colour:	Blue	Odometer:	89210 km
Engine Capacity:	1998 cc		
Market Value/New Car Price:	S\$86,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/55 R18	Rear Tyre Size:	225/55 R18
Front Left Side:	Yokohama 5 mm	Rear Left Side:	Yokohama 5 mm
Front Right Side:	Yokohama 5 mm	Rear Right Side:	Yokohama 5 mm

The above values represent the remaining tyre tread depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	19,409.00	9,275.22	10,133.78	52.21
Miscellaneous Items	0.00	0.00	0.00	
Labour	8,060.00	5,685.00	2,375.00	29.47
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	27,469.00	14,960.22	12,508.78	45.54
- Excess (S\$)	300.00	300.00	0.00	0.00
(S\$)	27,169.00	14,660.22	12,508.78	46.04
+ GST 7.00/7.00% (S\$)	1,901.83	1,026.22	875.61	46.04
Nett Amount (S\$)	29,070.83	15,686.44	13,384.39	46.04

INSPECTION

Date of Assignment:	24/05/2021	
Date Inspected:	24/05/2021 Inspected At:	Cycle & Carriage Automotive Pte Ltd (Pandan Gardens) 209 Pandan Gardens Singapore 609339
Estimated Period of Repair:	11.0 days	

Adjuster: CHEN TSUE YEE

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*SUNDRY	Necessary	20.00 FS	*20.00 FS
2	1		*REFLECTOR, TAIL LAMP, LH	Not Necessary	100.00 F	*- FL
3	1		*GARNISH, FR BUMPER, RH	Missing	75.00 F	*75.00 FL
4	1		*EXTENSION, FR BUMPER	Cut	428.00 F	*428.00 FL
5	1		*BRACKET, FR BUMPER SIDE, RH	Missing	18.00 F	*18.00 FL
6	1		*GARNISH, FR BUMPER SIDE	Missing	48.00 F	*48.00 FL
7	1		*GARNISH, FR BUMPER SIDE	Broken	220.00 F	*220.00 FL
8	1		*GARNISH, FR BUMPER SIDE	Missing	112.00 F	*112.00 FL
9	1		*COVER, FR BUMPER	Cut	295.00 F	*295.00 FL
10	1		*BRKT, FR BUMPER SIDE, LWR RH	Missing	6.00 F	*6.00 FL
11	1		*MOULDING, FR BUMPER, RH	Missing	116.00 F	*116.00 FL
12	1		*MOULDING, FR WHEEL ARCH, RH	Missing	199.00 F	*199.00 FL
13	1		*COVER, HEADLAMP SUPT PANEL	Not Necessary	50.00 F	*- FL
14	1		*GRILLE ASSY, RADIATOR	Broken	572.00 F	*572.00 FL
15	1		*BRACKET, RADIATOR GRILLE, RH	Not Necessary	17.00 F	*- FL
16	1		*HOOD	Dented	980.00 F	*980.00 FL
17	1		*HINGE, HOOD, RH	Bent	68.00 F	*68.00 FL
18	1		*WEATHERSTRIP, HOOD	Not Necessary	40.00 F	*- FL
19	1		*WEATHERSTRIP, HOOD	Not Necessary	41.00 F	*- FL
20	1		*LATCH, HOOD	Not Necessary	76.00 F	*- FL
21	1		*FENDER, FR RH	Dented	622.00 F	*622.00 FL
22	1		*INSULATOR, FR FENDER, RH	Crushed	60.00 F	*60.00 FL
23	1		*SHIELD, FR WHEELHOUSE, RH	Missing	164.00 F	*164.00 FL
24	1		*PNL, HEADLAMP SUPT, UPR RH	Bent	58.00 F	*58.00 FL
25	1		*PANEL, HEADLAMP SUPPORT, LWR	Not Necessary	156.00 F	*- FL
26	1		*PLATE, FR SIDEMEMBER, RH	Not Necessary	60.00 F	*- FL
27	1		*FENDER SHIELD, FR LWR RH	Not Necessary	113.00 F	*- FL
28	1		*FRAME, FR DECK, FR UPR RH	Not Necessary	104.00 F	*- FL
29	1		*GLASS, WINDSHIELD	Broken	1,530.00 F	*1,530.00 FL
30	2		*MOULDING, WINDSHIELD SIDE	Necessary	184.00 F	*184.00 FL
31	2		*STOPPER, WINDSHIELD GLASS	Necessary	6.00 F	*6.00 FL
32	1		*MOULDING, WINDSHIELD	Necessary	78.00 F	*78.00 FL
33	3		*SPACER, QTR WINDOW	Necessary	24.00 F	*24.00 FL
34	1		*COVER, ENG ROOM SIDE, RH	Not Necessary	92.00 F	*- FL
35	1		*PANEL, FR END SIDE, RH	Not Necessary	289.00 F	*- FL
36	1		*COVER, ENG ROOM UNDER, FR	Broken	349.00 F	*349.00 FL
37	1		*GARNISH, FR DECK	Broken	173.00 F	*173.00 FL
38	1		*COVER, FR DECK, RH	Not Necessary	19.00 F	*- FL
39	1		*AIR DAM, SIDE, RH	Not Necessary	544.00 F	*- FL
40	1		*GARNISH, FR DOOR, RH	Not Necessary	190.00 F	*- FL
41	1		*HEADLAMP ASSY, RH	Broken	2,135.00 F	*2,135.00 FL
42	1		*LAMP ASSY, FOG, FR RH	Cut	348.00 F	*348.00 FL
43	1		*TANK, WINDSHIELD WASHER	Crushed	87.00 F	*87.00 FL
44	1		*GROMMET, WINDSHIELD WASHER	Necessary	5.00 F	*5.00 FL
45	1		*HOSE, W/SHLD WSHR TANK FLR	Not Necessary	23.00 F	*- FL
46	1		*MOTOR, WINDSHIELD WASHER (*)	Not Necessary	156.00 F	*- FL
47	1		*SENSOR, W/SHLD WASHR TANK	Not Necessary	114.00 F	*- FL
48	1		*CONDENSER ASSY, A/C REFRIGE	Not Necessary	861.00 F	*- FL
49	1		*HOSE, A/C COMPR DISCHARGE	Not Necessary	191.00 F	*- FL
50	1		*PIPE, A/C CONDENSER OUTLET	Not Necessary	262.00 F	*- FL
51	1		*HOSE, A/C COMPR SUCTION	Not Necessary	235.00 F	*- FL
52	1		*SHAFT AS, FR AXLE DRIVE, RH	Not Necessary	1,291.00 F	*- FL
53	1		*CROSSMEMBER, FR AXLE, NO.1	Not Necessary	1,067.00 F	*- FL
54	1		*ARM ASSY, FR SUSP, LWR RH	Bent	325.00 F	*325.00 FL
55	1		*STRUT, FR SUSP, RH	Bent	469.00 F	*469.00 FL

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
56	1		*BEARING, FR SUSP STRUT	Necessary	32.00 F	*32.00 FL
57	1		*GEAR & LINK ASSY, STEERING	Not Necessary	1,223.00 F	*- FL
58	1		*END ASSY, TIE ROD	Not Necessary	63.00 F	*- FL
59	1		*FACE, FR BUMPER	Broken	863.00 F	*863.00 FL
60	1		*BRACKET, IU ADHESIVE	Necessary	26.00 FS	*26.00 FS
61	1		*PAD, FR FENDER	Necessary	54.00 F	*54.00 FL
62	1		*TUBA, WINDSHIELD WASHER (Supplementary)	Broken	35.00 F	*35.00 FL
63	1		*HINGER, HOOD LH (Supplementary)	Bent	68.00 F	*68.00 FL
64	1		*CLIPS (X15) (Supplementary)	Necessary	30.00 F	*30.00 FL
65	1		*CLIPS (X15) (Supplementary)	Necessary	45.00 F	*45.00 FL
66	1		*CLIPS (Supplementary)	Necessary	3.00 F	*3.00 FL
67	1		*WHEEL, SPARE TIRE DISC (Supplementary)	Cut	1,102.00 F	*1,102.00 FL
F=Franchise part. S=SpcNett. L=ListItemDisc.						
					Sub Total (\$\$)	19,409.00
					- List Item Discount on L Items 0.00/23.00% (\$\$)	0.00
					Total Parts (\$\$)	19,409.00
						9,275.22

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	SUPPLY FRT RIGHT TYRE	New	480.00	480.00
2	RENEW FRT BUMPER, BONNET, FRT FENDER RH, FRT SUPPORT PANEL RH, FRT WHEEL HOUSING RH, REPAIR FRT DOOR RH, A-PILLAR RH	New	3,150.00	1,125.00
3	RENEW FRT WINDSCREEN	New	240.00	240.00
4	SPRAY PAINT FOR FRT BUMPER, FRT FENDER RH, BONNET, FRT SUPPORT RH FRT DOOR RH, A-PILLAR, RH	New	2,100.00	1,750.00
5	APPLY SEALANT FOR FRT WINDSCREEN	New	80.00	80.00
6	TO CONDUCT COMPUTERIZE FULL WHEEL ALIGNMENT	New	120.00	120.00
7	TRANSFER FRT RIGHT RIM	New	30.00	30.00
8	CHECK WIRING & ELECTRICAL SYSTEM	New	30.00	30.00
9	TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST USING HI-SCAN PRO TEST	New	120.00	120.00
10	RENEW FRT UNDER CARRIAGE	New	300.00	300.00
11	APPLY SEALANT FOR ACCIDENT PORTION	New	40.00	40.00
12	SUPPLY & REPLACE FRONT WINDSCREEN GLASS SOLAR FILM - RIKECOOL (Supplementary)	New	220.00	220.00
13	REPAIR RH FRONT WHEEL HOUSING (Supplementary)	New	450.00	450.00
14	RESPRAY RH FRONT WHEEL HOUSING & LH FRONT FENDER (Supplementary)	New	700.00	700.00
Gross Labour Cost (\$\$)			8,060.00	5,685.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >