

LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

PRE-REPAIR INSPECTION REPORT CS3/ASM21006161/T1tce2 AXA INSURANCE PTE LTD Ref: 8 SHENTON WAY #24-01 AXA TOWER Date: 28/07/2021 SINGAPORE 068811 ATTN: TAN WANCONG Code: ASM 1. Policy Particulars :- (THIRD PARTY CLAIM) GQ 8172L Insured Veh. **GBF 7887G** Veh. Inspected Policy No. GA450377 Coverage (\$) 0.00 Claim No. S1M039IF Excess (\$) 0.00 TAN WANCONG **Assign Date** 27/05/2021 Assign From **Vehicle Particulars & Condition** 2. TOYOTA DYNA Make & Model 2982 C.C HIDDEN 2017 Engine No. Year of Reg. JTFAT35Y60K207242 WHITE Chassis No. Colour 98700 KM Odometer Steering **IN ORDER IN ORDER** NIL **Brakes** Modification GOOD General 3. **Conditions of Tyres** Size Make **Balance** R/H Front Tyre 195/80 R15 TOURADOR 6 mm **TOURADOR** L/H Front Tyre 195/80 R15 6 mm 155 R12 (D) **TOURADOR** R/H Rear Tyre 6/6 mm **TOURADOR** L/H Rear Tyre 155 R12 (D) 6/6 mm 4. **Description of Damages** THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. 5. **General Information** 04/05/2021 21/07/2021 (02:05 PM) Inspect Date / Time Accident Date HALLAND MOTOR SERVICE Survey held at NO.1 KAKI BUKIT AVE 6 #02-24 SINGAPORE 417883 5a. Remarks A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE. C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS. D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000-\$6,000

Report Ref No. CS3/ASM21006161/T1tce2

Estimate Days of Repair

Inspected By

5b.

MOHAMAD TAUFIKH

ESTIMATED NORMAL PERIOD FOR REPAIR:

K.K.LAU CPT(RET)

7 Working Days

M.MATAI, AMSAE-A BEng(Hons),B.Bus,MBA,PEng,PE, MInstAEA,MASME,MIRTE

Automotive Assessor REGD Auto Consultant-SAE, Licensed Appraiser