

AUTOMOBILE ASSESSMENT REPORT

TO: AGNES JAEI CHAN
C/O: ECLIPSE AUTO PTE LTD
155 KAKI BUKIT AVE 1 #01-00,
SHUNLI INDUSTRIAL PARK
SINGAPORE 416012

Our Reference: 0221/EA844

Date: 05-Mar-2021

ASSESSMENT OF VEHICLE NO. SLM 9011 Z

DATE OF LOSS: 16-Feb-2021

We have carried out a physical assessment at ECLIPSE AUTO PTE LTD,
155 Kaki Bukit Ave 1 #01-00 Shunli Industrial Park, Singapore 416012, according to your instruction
on 18-Feb-2021 and are pleased to submit our report herewith.

1. VEHICLE PARTICULARS

Registration No.: SLM 9011 Z
Make & Model: VOLKSWAGEN JETTA 1.4 TSI A/T ABS D/AIRBAG 2WD
Year of Registration: 2015
Engine Capacity: 1390
Chassis No.: WVWZZZ16ZEM059053
Engine No.: CAXE85038
Colour: RED
Mileage (km): 175783

2. VEHICLE CONDITION

Body Paint: GOOD
Steering: SERVICEABLE
Foot Brake: SERVICEABLE
Parking Brake: SERVICEABLE
Modification: NIL

3. TYRE PARTICULARS & CONDITION

Front
RH Make/Size/Thread: DUNLOP 215/60 R16 - 70%
LH Make/Size/Thread: DUNLOP 215/60 R16 - 70%
Rear
RH Make/Size/Thread: DUNLOP 215/60 R16 - 70%
LH Make/Size/Thread: DUNLOP 215/60 R16 - 70%

ASSESSMENT REPORT FOR VEHICLE NO. SLM 9011 Z

PARTS (LIST ITEMS)

Qty	Description	Condition	Workshop's Estimate	Our Assessment
1	FRONT GRILLE	Repair	688.78	-
1	FRONT GRILLE 'LOGO' EMBLEM	Reuse	80.50	-
4	FRONT GRILLE CLIPS	Necessary	26.00	26.00
1	FRONT LH HEADLAMP	Cracked	1,001.73	1,001.73
1	FRONT LH HEADLAMP TOP PANEL	Bent	108.78	108.78 XSLC
1	FRONT LH HEADLAMP NOZZLE	Cracked	288.70	288.70 XSLC
1	FRONT RH HEADLAMP NOZZLE	Reuse	288.70	-
1	FRONT BRACE PANEL	Bent	157.31	157.31 XMM
1	FRONT BUMPER	Cracked	1,673.70	1,673.70
1	FRONT BUMPER CENTER TOP RETAINER	Bent	157.30	157.30 XMM
2	FRONT BUMPER HEADLAMP NOZZLE COVER L/R	Necessary	160.34	160.34 XMM
2	FRONT BUMPER FOG LAMP GARNISH L/R	Bent	377.86	377.86
2	FRONT BUMPER FOG LAMP L/R	Reuse	461.50	-
2	FRONT BUMPER SIDE RETAINER L/R	Bent	178.34	178.34
1	FRONT BUMPER INNER SPONGE	Reuse	261.42	-
1	FRONT BUMPER LOWER CENTER GRILLE	Bent	400.17	400.17 XMM
1	FRONT BUMPER LOWER CENTER GRILLE CHROME MOULDING	Necessary	300.71	300.71 XMM
1	FRONT BUMPER REINFORCEMENT	Bent	588.78	588.78 XMM
1	FRONT BUMPER NUMBER PLATE GARNISH	Reuse	169.70	-
1	FRONT BUMPER LOWER UNDER COVER	Cracked	233.70	233.70 XMM
1	FRONT SUPPORT PANEL	Repair	1,200.71	-
1	FRONT LH FENDER	Bent	431.25	431.25
1	FRONT LH FENDER BRACKET	Bent	49.00	49.00
1	FRONT LH FENDER INNER PANEL	Bent	215.00	215.00 X
1	FRONT LH FENDER INNER SHIELD	Cracked	153.25	153.25
1	FRONT LH FENDER INNER SPONGE 'TOP'	Reuse	45.50	-
1	FRONT LH ABS SENSOR	Faulty	171.18	171.18 X
1	FRONT LH SHOCK ABSORBER TOP MOUNTING	Bent	123.66	123.66
1	FRONT LH SHOCK ABSORBER	Bent	363.15	363.15 X
1	FRONT LH BALL JOINT	Bent	129.33	129.33
1	FRONT LH KNUCKLE ARM	Bent	621.00	621.00
1	FRONT LH KNUCKLE ARM BEARING	Jammed	460.35	460.35
1	FRONT LH LOWER ARM	Bent	356.40	356.40
1	FRONT LH STABILIZER BAR LINK	Bent	94.77	94.77 X

Less 0% discount
Parts Total: 12,018.57 8,821.76

ASSESSMENT REPORT FOR VEHICLE NO. SLM 9011 Z

SPECIAL NETT ITEMS

- 1 FRONT BUMPER CLIPS - SET
- 1 FRONT LH FENDER INNER SHIELD CLIPS - SET
- 1 FRONT RH 16" SPORT RIM
- 1 FRONT RH 16" TYRE

Necessary	30.00	30.00
Necessary	30.00	30.00
Bent Cut	600.00	600.00
Cut	180.00	180.00
Special Nett Total :	840.00	840.00

LABOUR

S/N Description


- 1 To provide towing charge.
- 2 To remove, reinstall electrical wiring harness, check lighting, resetting headlamp focussing and rewire.
- 3 To remove, change front suspension parts, absorber, lower arm, knuckle arm, wheel bearing, bearing hub, drive shaft, anti-roll bar, top-arm and steering rack and pinion.
- 4 To road test driving, check and resetting wheel alignments system.
- 5 To reset system after repair works.
- 6 To re-spray painting on the change bodyparts, repair portion, and where consistent to the accident.
- 7 To provide labour, workmanship to change the above damaged bodyparts, repair, re-construct and re-align body structure, body alignments and damaged consistent to the accident.
- 8 To apply anti-rust chemical on repaired and replaced panel.

Workshop's Estimate	Our Assessment
50.00	50.00
120.00	100.00
400.00	350.00
160.00	140.00
450.00	400.00
1,000.00	800.00
1,400.00	1,200.00
100.00	80.00
Labour Total :	3,680.00
TOTAL (PARTS & LABOUR) \$	16,538.57
	12,781.76

The workshop has agreed to undertake the repair on a Lump Sum basis.
 The final adjusted Lump Sum contract amount is

\$9,200.00

(SINGAPORE DOLLARS NINE THOUSAND TWO HUNDRED ONLY)

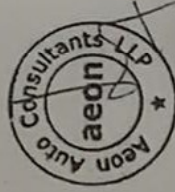

Amas Ong
 Automobile Assessor

6 days