

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/MSG21006375/DQF3E2

Date: 11/05/2022

REFERENCE

Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd.	Policy No:	30001622558		
Claimant Vehicle No :	SH6716L	Insured Vehicle No :	SLP5671D		
Date of Loss:	01/06/2021	Nature of Claim:	TP	Claim No:	258093

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SH6716L	Engine No:	G4LEJU194300
Make & Model:	HYUNDAI AE IONIQ HEV DCT, 1.6 (A)	Chassis No:	KMHC851CVKU141857
Reg. Date:	03/05/2019 (Man. Year: 2019)	Odometer:	0 km
Colour:	Blue		
Engine Capacity:	1580 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195/65 R15
Front Left Side:	Kumho 5 mm	Rear Left Side:	Kumho 5 mm
Front Right Side:	Kumho 5 mm	Rear Right Side:	Kumho 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	52,456.36	30,319.10	22,137.26	42.20
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,880.00	2,560.00	3,320.00	56.46
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	58,336.36	32,879.10	25,457.26	43.64
Approved Total (Overridden) (S\$)		26,000.00		
(S\$)	58,336.36	26,000.00	32,336.36	55.43
+ GST 7.00/7.00% (S\$)	4,083.55	1,820.00	2,263.55	55.43
Nett Amount (S\$)	62,419.91	27,820.00	34,599.91	55.43

INSPECTION

Date of Assignment:	03/06/2021	
Date Inspected:	03/06/2021	Inspected At: Bifrost Auto Pte Ltd (sin Ming) (HQ) Blk 9 Sector C, #01-42 Sin Ming Industrial Estate Singapore 575644
Estimated Period of Repair:	12.0 days	

Adjuster: BRYAN TANI

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 11 May 2022)	
Parts:	N/A	HYUNDAI AE IONIQ HEV DCT 1.6 (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SH6716L)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BONNET	Bent	2,253.80 FL	*2,253.80 FL
2	1		*BONNET LOCK	Bent	127.30 FL	*127.30 FL
3	1		*BONNET INSULATOR CLIPS	Not Necessary	15.00 FL	*- FL
4	1		*RADIATOR GRILLE	Broken	1,409.10 FL	*1,409.10 FL
5	2		*FLAP ASSY ACTIVE AIR UPPER (LH/RH)	Broken	1,649.20 FL	*886.42 FL
6	1		*FRONT NUMBER PLATE GARNISH	Deformed / Cut	188.00 FL	*188.00 FL
7	1		*FRONT BUMPER COVER	Torn	418.30 FL	*418.30 FL
8	1		*FRONT BUMPER TOP COVER	Not Necessary	476.30 FL	*- FL
9	1		*FRONT BUMPER SPONGE	Torn	186.90 FL	*186.90 FL
10	1		*FRONT BUMPER REINFORCEMENT	Dented / Broken	1,075.10 FL	*1,075.10 FL
11	2		*FRONT BUMPER REINFORCEMENT ABSORBER (LH/RH)	Bent	373.00 FL	*373.00 FL
12	1		*FRONT BUMPER TOWING COVER	Dislodged	29.00 FL	*29.00 FL
13	1		*FRONT BUMPER MOULDING CENTRE UPPER	Cut	368.50 FL	*368.50 FL
14	1		*FRONT BUMPER MOULDING	Not Necessary	93.60 FL	*- FL
15	1		*FRONT BUMPER LOWER STIFFNER	Bent	285.10 FL	*285.10 FL
16	1		*FRONT BUMPER LOWER GRILLE	Cracked / Broken	365.30 FL	*365.30 FL
17	1		*FRONT BUMPER LOWER GRILLE MOULDING	Cracked / Cut	127.60 FL	*127.60 FL
18	1		*FRONT BUMPER LIP	Not Necessary	35.10 FL	*- FL
19	2		*FRONT BUMPER BRACKET TOP (LH/RH)	Not Necessary	70.00 FL	*- FL
20	2		*FRONT BUMPER BRACKET (LH/RH)	Not Necessary	56.00 FL	*- FL
21	2		*FRONT BUMPER RETAINER MOUNTING (LH/RH)	Not Necessary	130.60 FL	*- FL
22	10		*FRONT BUMPER CLIPS	Necessary	25.00 FL	*25.00 FL
23	1		*FRONT BUMPER GRILLE (LH/RH) (O/S NOT NECESSARY)	N/S Cut/Deformed	373.80 FL	*186.90 FL
24	2		*FRONT BUMPER AIR DUCT (LH/RH)	Not Necessary	307.60 FL	*- FL
25	1		*DAY LIGHT, LH	Not Necessary	642.50 FL	*- FL
26	1		*DAY LIGHT, RH	Not Necessary	642.50 FL	*- FL
27	1		*DAY LIGHT WIRE	Not Necessary	585.50 FL	*- FL
28	1		*BUZZER ASSY - PIEZO (LH)	Not Necessary	388.00 FL	*- FL
29	1		*HEADLAMP SUPPORT PANEL ASSY	Broken	949.30 FL	*949.30 FL
30	2		*HEADLAMP (LH/RH)	Cracked / Cut	7,974.60 FL	*3,867.30 FL
31	2		*HORN UNIT (LH/RH)	Serviceable	145.60 FL	*- FL
32	1		*HORN WIRE	Not Necessary	386.70 FL	*- FL
33	1		*RADIATOR INVERTER	Punctured / Bent	884.80 FL	*884.80 FL
34	1		*RADIATOR	Punctured / Bent	710.50 FL	*710.50 FL
35	1		*RADIATOR FAN BLOWER MOTOR ASSY	Broken	1,226.60 FL	*1,226.60 FL
36	2		*RADIATOR AIR GUARD (LH/RH)	Serviceable	152.80 FL	*- FL
37	2		*RADIATOR AIR GUARD, UPR (LH/RH)	Serviceable	255.00 FL	*- FL
38	1		*RADIATOR HOSE UPPER	Not Necessary	166.20 FL	*- FL
39	1		*FRONT FENDER (LH/RH) (O/S NOT NECESSARY)	N/S Dented / Bent	981.40 FL	*490.70 FL
40	2		*FRONT FENDER SHIELD (LH/RH)	Serviceable	329.40 FL	*- FL
41	1		*AIRCON CONDENSER	Bent / Punctured	663.60 FL	*663.60 FL
42	1		*DASHBOARD COMPLETE	Broken	4,724.00 FL	*1,474.00 FL
43	1		*STEERING AIRBAG COMPLETE	Activated	1,090.90 FL	*1,090.90 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
44	1		*AIRBAG CONTROL MODULE	Activated	1,243.70 FL	*1,243.70 FL
45	1		*KNEE CONTROL AIRBAG ASSY	Repeated	578.60 FL	*- FL
46	1		*STEERING ANGLE ASSY	Damaged	786.90 FL	*786.90 FL
47	1		*SENSOR ASSY IMPACT - FRT INPACT	Not Necessary	643.90 FL	*- FL
48	2		*AIRBAG SENSOR (LH/RH)	Activated	696.20 FL	*696.20 FL
49	1		*AIRBAG FRT SEAT	Not Necessary	1,344.50 FL	*- FL
50	1		*FRONT CUSHION SEAT (RH)	Not Necessary	5,183.20 FL	*- FL
51	2		*REAR SAFETY BELT (ASSY) (LH/RH)	Activated	1,297.80 FL	*626.40 FL
52	2		*FRONT SAFETY BELT (ASSY) (LH/RH)	Activated	1,026.40 FL	*897.80 FL
53	1		*SPEAKER ASSY-VESS	Mtg Broken	554.40 FL	*354.40 FL
54	1		*UNIT ASSY-SMART CRU (RADAR SENSOR)	Mtg Broken	2,910.90 FL	*2,910.90 FL
55	1		*FLAP ASSY ACTIVE WIRE	Not Necessary	765.30 FL	*- FL
56	1		*FRONT NUMBER PLATE }	Dislodged / Broken	25.00 FS	*45.00 FS
57	1		*FRONT NO PLATE TRIM COVER }	Broken	30.00 FS	*- FS
58	1		*COOLANT	Not Necessary	45.00 FS	*- FS
59	1		*EMBLEM - BLUE DRIVE (LH/RH)	N/S	53.20 F	*26.60 FN
				Necessary/O/SNotNecessary		
60	1		*INVERTER COOLANT	Not Necessary	65.00 FS	*- FS
61	2		*BONNET HINGE (LH/RH)	Bent	237.40 FL	*237.40 FL
62	1		*FRONT WINDSCREEN GLASS	Cracked	1,558.10 FL	*1,558.10 FL
63	1		*FRONT WINDSCREEN MOULDING	Necessary	157.30 FL	*157.30 FL
64	2		*CLUTCH FLUID	Not Necessary	170.00 FL	*- FL
65	1		*ELECTRONIC CLUTCH ACTUATOR ASSY	Mtg Broken	6,345.80 FL	*4,130.20 FL
66	1		*PASSENGER AIR BAG	Activated	2,633.50 FL	*1,951.20 FL
67	1		*KNEE CONTROL AIRBAG ASSY	Activated	1,735.80 FL	*578.60 FL
68	2		*REAR SEAT SIDE INNER GARNISH (LH/RH)	Cracked / Bent	963.00 FL	*963.00 FL
69	2		*REAR FENDER CORNER INNER UPPER GARNISH (LH/RH)	Broken	973.40 FL	*973.40 FL
70	2		*FRONT WINDSCREEN SEALANT	Necessary	92.00 FS	*40.00 FS
71	1		*FRONT ERP STICKER	Necessary	30.00 FS	*30.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc. N=NettItemDisc.

Sub Total (\$\$)	65,485.40	37,870.12
- List Item Discount on L Items 20.00/20.00% (\$\$)	13,029.04	7,545.70
- Nett Item Discount on N Items 0.00/20.00% (\$\$)	0.00	5.32
Total Parts (\$\$)	52,456.36	30,319.10

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING	New	1,600.00	1,000.00
2	SPRAY PAINTING CHARGE	New	1,400.00	800.00
3	WIRING CHARGE	New	100.00	30.00
4	TUFF KOTE	New	100.00	40.00
5	TOWING CHARGE	New	80.00	0.00
6	REMOVE / REFIX RADIATOR	New	90.00	50.00
7	REMOVE / REFIX AIRCON & REFILL GAS	New	130.00	80.00
8	REMOVE / REFIX FUSE BOX	New	120.00	0.00
9	REMOVE / REFIX DASHBOARD	New	350.00	180.00
10	REMOVE / REFIX CUSHION & UPHOLSTERY FRONT	New	90.00	0.00
11	RE-PROGRAMME AIR BAG & SAFETY BELT SYSTEM	New	550.00	150.00
12	DIAGNOSTIC & RESETTING TO ERASE FAULT CODE	New	550.00	150.00
13	REMOVE / REFIX FRONT WINDSCREEN GLASS	New	120.00	80.00
14	REMOVE / REFIX GEARBOX	New	600.00	0.00
Gross Labour Cost (\$\$)			5,880.00	2,560.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >