

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/AIG21006548/NPA3Q2**Date:** 27/10/2022REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2100325942
Claimant Vehicle No :	SGP2714T	Insured Vehicle No :	SJH3535T
Date of Loss:	07/06/2021	Nature of Claim:	TP
		Claim No:	2537323681SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SGP2714T	Engine No:	Z6502882
Make & Model:	MAZDA 3, 1.6 SP Lux (A)	Chassis No:	JM6BK106270320501
Reg. Date:	12/12/2006 (Man. Year: 2006)	Odometer:	378522 km
Colour:	White		
Engine Capacity:	1598 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55 R16	Rear Tyre Size:	205/55 R16
Front Left Side:	West Lake 5 mm	Rear Left Side:	Michelin 5 mm
Front Right Side:	West Lake 5 mm	Rear Right Side:	Michelin 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	16,875.56	4,446.80	12,428.76	73.65
Miscellaneous Items	0.00	0.00	0.00	
Labour	7,300.00	1,580.00	5,720.00	78.36
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	24,175.56	6,026.80	18,148.76	75.07
Approved Total (Overridden) (S\$)		3,000.00		
(S\$)	24,175.56	3,000.00	21,175.56	87.59
+ GST 7.00/7.00% (S\$)	1,692.29	210.00	1,482.29	87.59
Nett Amount (S\$)	25,867.85	3,210.00	22,657.85	87.59
+ Car Rental (5.0 x S\$100.00/day + 7.00% GST) (S\$)		535.00		
+ Doc/Search Fee (S\$)		7.45		
Nett Liability (S\$)		3,752.45		

INSPECTION

Date of Assignment:	09/06/2021		
Date Inspected:	09/06/2021	Inspected At:	AP Automotive Services Pte Ltd (HQ) Blk 9006 Tampines Street 93, #01-202 Singapore 528840
Estimated Period of Repair:	4.0 days		

Adjuster: Muhammad Nazril Bin Abdullah

Manager: CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BOOTLID	Dented	958.00 FL	*958.00 FL
2	1		*BOOTLID LOGO -MAZDA	Necessary	79.50 FL	*79.50 FL
3	1		*BOOTLID EMBLEM -MAZDA 3	Necessary	58.70 FL	*58.70 FL
4	2		*BOOTLID LAMP L+R	Cracked	499.00 FL	*499.00 FL
5	1		*BOOTLID LOCK CYLINDER	Serviceable	496.00 FL	*- FL
6	1		*BOOTLID LOCK	Deformed	291.80 FL	*291.80 FL
7	1		*BOOTLID LOCK CATCH	Deformed	74.00 FL	*74.00 FL
8	1		*BOOTLID INNER TRIM	Torn	147.70 FL	*147.70 FL
9	2		*SET BOOTLID HINGE	Serviceable	162.70 FL	*- FL
10	2		*SET BOOTLID STOPPER	Serviceable	44.50 FL	*- FL
11	1		*BOOTLID WEATHERSTRIP	Deformed	131.00 FL	*131.00 FL
12	2		*TAIL LAMP L+R	Cracked	808.00 FL	*808.00 FL
13	2		*TAIL LAMP PANEL L+R	Serviceable	878.00 FL	*- FL
14	1		*REAR BUMPER	Cracked	976.00 FL	*976.00 FL
15	1		*REAR BUMPER NUMBER PLATE L+R	N/SServiceable/O/S Not Working	131.80 FL	*65.90 FL
16	2		*REAR BUMPER REFLECTOR L+R	Cracked	135.00 FL	*135.00 FL
17	2		*REAR BUMPER RETAINER L+R	Cracked	157.60 FL	*157.60 FL
18	1		*REAR BUMPER REINFORCEMENT BAR	Serviceable	476.00 FL	*- FL
19	1		*REAR BUMPER SPONGE	Not Necessary	137.80 FL	*- FL
20	1		*REAR BUMPER UNDERCOVER	Serviceable	293.65 FL	*- FL
21	1		*REAR WINDSCREEN MOULDING	Necessary	319.00 FL	*319.00 FL
22	2		*REAR FENDER L+R	Serviceable	3,578.00 FL	*- FL
23	2		*REAR FENDER INNER TRIM L+R	Serviceable	543.10 FL	*- FL
24	1		*END PANEL	Repair	459.00 FL	*- FL
25	1		*END PANEL TOP GARNISH	Cracked	219.80 FL	*219.80 FL
26	1		*REAR SMART LOCK ANTENNA	Serviceable	197.30 FL	*- FL
27	1		*SPAREWHEEL PANEL	Repair	970.00 FL	*- FL
28	1		*SPAREWHEEL PANEL TOP BOARD	Serviceable	411.00 FL	*- FL
29	1		*SPAREWHEEL PANEL ACCESSORIES SPONGE	Serviceable	102.70 FL	*- FL
30	1		*EXHAUST PIPE	Repair	831.00 FL	*- FL
31	1		*EXHAUST MOUNTING	Serviceable	45.00 FL	*- FL
32	1		*EXHAUST HEAT SHIELD	Serviceable	126.00 FL	*- FL
33	1		*BOOTLID SPOILER	Serviceable	800.00 FS	*- FS
34	1		*BOOTLID SPOILER SEALANT	Not Necessary	100.00 FS	*- FS
35	1		*BOOTLID INNER TRIM CLIPS	Necessary	100.00 FS	*30.00 FS
36	1		*BOOTLID EMBLEM BATMAN	Not Necessary	300.00 FS	*- FS
37	1		*REAR NUMBER PLATE	Cracked	100.00 FS	*50.00 FS
38	1		*TAIL LAMP CLIPS	Necessary	50.00 FS	*30.00 FS
39	1		*TAIL LAMP PANEL SEALANT	Not Necessary	120.00 FS	*- FS
40	1		*REAR BUMPER CLIPS	Necessary	100.00 FS	*50.00 FS
41	1		*SET REAR BUMPER REVERSE SENSOR	Not Working	300.00 FS	*200.00 FS
42	1		*SET REAR BUMPER LOWER DIFFUSOR	Serviceable	1,600.00 FS	*- FS
43	1		*REAR WINDSCREEN SEALANT	Necessary	120.00 FS	*120.00 FS
44	1		*REAR FENDER SEALANT	Not Necessary	200.00 FS	*- FS
45	2		*REAR FENDER INNER TRIM CLIPS	Not Necessary	200.00 FS	*- FS
46	2		*REAR FENDER COWLING CLIPS	Not Necessary	200.00 FS	*- FS
47	1		*END PANEL SEALANT	Not Necessary	200.00 FS	*- FS
48	1		*END PANEL TOP GARNISH CLIPS	Necessary	100.00 FS	*30.00 FS
49	1		*SPAREWHEEL SEALANT	Not Necessary	250.00 FS	*- FS
50	2		*REAR FENDER COWLING L+R	Serviceable	305.80 FL	*- FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
					Sub Total (S\$)	19,884.45
					- List Item Discount on L Items 20.00/20.00% (S\$)	3,008.89
					Total Parts (S\$)	16,875.56

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING ON AFFECTED AREAS	New	2,400.00	600.00
2	SPRAY PAINT ON AFFECTED AREAS	New	1,800.00	600.00
3	TO RNR REAR WINDSCREEN	New	400.00	120.00
4	TO RNR REAR EXHAUST	New	350.00	50.00
5	TO CHECK WIRING AND TAIL LAMP FUNCTION }	New	150.00	50.00
6	TO RNR REAR INNER TRIM AND UPHOLSTERY }	New	400.00	0.00
7	TO CHECK WATER LEAK	New	150.00	0.00
8	TO RNR FUEL TANK	New	250.00	0.00
9	TO PERFORM DIAGNOSTIC AND CLEAR FAULTS	New	600.00	0.00
10	TO RNR REAR BOOT MECHANISM	New	350.00	50.00
11	TO RNR REAR REVERSE SENSOR AND CHECK FUNCTION	New	150.00	30.00
12	TO PERFORM RUST PROOFING	New	300.00	80.00
Gross Labour Cost (\$\$)			7,300.00	1,580.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >