

ASS. REC. BY:

REF:

ASM / 21008564 KB

C

Kenneth

ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: \_\_\_\_\_

at Workshop m/s Cuan

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: \$ 65k

IDAC Accident Rpt: \_\_\_\_\_ Consistent?: Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent?: Yes or No

Est. Repairs: 04 days Res.: Yes or No

Lum Sum: 1-B.1 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_ Vehicle: IN / OUT

Veh No: SM 4287H Yr Regn: 09, 18

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Hyundai Elantra c.c. 1591

Colour: M. Grey A/C: Insured / Std / NI / NA

Sp. Reading: 51525 T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: KM1H0841CAJU740017

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD / RIM or

Tyre Size: F: 195/65R15

R: \_\_\_\_\_

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. 9 mm

R/Bal. 9 mm

L/Bal. 9 mm

L/Bal. 9 mm

D.O.A. 4/6/21

D.O.I. 9/6/2021

Survey held at \_\_\_\_\_

Des. of Damages: o/s body / Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

14/6 8 2546.24 Cuan

Date/Time, File Pass to?

Prell. Report

1)

Final Report

Date/Time, File Return to?

2)

Days Of Repair: \_\_\_\_\_

Resurvey No. of Trip: \_\_\_\_\_

Survey Fee:

Transportation: \_\_\_\_\_ \$ - RS. \_\_\_\_\_ SI

Add Fee:  : Site Insp (\$ \_\_\_\_\_)

: Interview (\$ \_\_\_\_\_)

: Tech Invs (\$ \_\_\_\_\_)

: Weekend (\$ \_\_\_\_\_)

Fuel

Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$) \_\_\_\_\_

# 源摩哆廠

# GUAN MOTOR WORKS

Business Regn. No. 081026001

176 Sin Ming Drive #02-03 Sin Ming Autocare Singapore 575721 Tel: 6453 6111 Fax: 6453 8292 H/P: 9742 6003

## REPAIR ESTIMATE FOR SME4287H

No.	Qty	List Items	
1	1	Rear RH door <i>1782.30</i>	\$ <i>R</i> 1,878.30 <i>R</i>
2	1 set	Rear RH door black sticker	\$ <i>na</i> 38.00 <i>R</i>
3	1 set	Rear RH door inner trim board clips	\$ <i>na</i> 50.00 <i>X</i>
4	1	Rear RH fender	\$ <i>R</i> 1,892.00 <i>X</i>
5	1	Rear RH fender 1/4 glass moulding	\$ <i>na</i> 53.00 <i>X</i>
6	1	RH rocker panel	\$ <i>R</i> 1,799.60 <i>X</i>
			\$ 5,710.90
Less 20%			\$ 1,142.18
Total :			\$ 4,568.72

### Special Nett Items

7	1 set	Rear windscreen sealant	\$ <i>na</i> 50.00 <i>X</i>
---	-------	-------------------------	-----------------------------

### Labour

1	Labour Charges for remove/refit, panel beat and replacement of damages.		\$ 800.00 <i>400</i>
2	To putty and spray Spray Paintings charges.		\$ 800.00 <i>600</i>
3	To remove. Refit rear windscreen glass.		\$ <i>na</i> 140.00 <i>X</i>
4	To remove, refit rear RH fender 1/4 glass.		\$ <i>na</i> 80.00 <i>X</i>
5	To supply and apply anti rust treatment		\$ 80.00 <i>30</i>
Total :			\$ 1,900.00

*Amac to refix door nylon \$100-60*

Total Parts and Labour : \$ 6,518.72

*Not Authorized  
Resurvey B4 paint & 4 days  
@ 2546.24*

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary items must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: