

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT**

AIG Asia Pacific Insurance Pte. Ltd.  
AIG Building, 78 Shenton Way, #09-16  
Singapore 079120

**Our File No:** CS/AIG21006573/KVF3N2**Date:** 02/09/2021**REFERENCE**

Insured/Claimant: DAIMLER FLEET MANAGEMENT SINGAPORE PTE. LTD Policy No: 0999993650

Date of Loss: 22/05/2021

Nature of Claim: OD

Claim No: 9088061807SG

**DESCRIPTION & IDENTIFICATION OF VEHICLE**

Reg No:	<b>GBK6268Z</b>	Engine No:	65195035287754
Make & Model:	MERCEDES-BENZ VITO 109, 1.6 CDI LONG (M)	Chassis No:	W1V44760323744788
Reg. Date:	30/09/2020 (Man. Year: 2020)	Odometer:	13174 km
Colour:	White		
Engine Capacity:	2143 cc		
Market Value/New Car Price:	S\$94,000.00		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

**CONDITION OF TYRES**

Front Tyre Size:	205/65R16	Rear Tyre Size:	205/65R16
Front Left Side:	Michelin 9 mm	Rear Left Side:	Michelin 9 mm
Front Right Side:	Michelin 9 mm	Rear Right Side:	Michelin 9 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	15,129.35	9,997.80	5,131.55	33.92
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,380.00	1,770.00	2,610.00	59.59
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (S\$)</b>	<b>19,509.35</b>	<b>11,767.80</b>	<b>7,741.55</b>	<b>39.68</b>
<b>- Excess (S\$)</b>	<b>1,900.00</b>	<b>1,900.00</b>	<b>0.00</b>	<b>0.00</b>
<b>(S\$)</b>	<b>17,609.35</b>	<b>9,867.80</b>	<b>7,741.55</b>	<b>43.96</b>
<b>+ GST 7.00/7.00% (S\$)</b>	<b>1,232.65</b>	<b>690.75</b>	<b>541.90</b>	<b>43.96</b>
<b>Nett Amount (S\$)</b>	<b>18,842.00</b>	<b>10,558.55</b>	<b>8,283.45</b>	<b>43.96</b>

**INSPECTION**

Date of Assignment: 10/06/2021

Date Inspected: 10/06/2021 Inspected At:

Tong Luck Auto Pte Ltd (HQ)  
160 Sin Ming Drive, #07-01 Sin Ming AutoCity  
Singapore 575722

Estimated Period of Repair: 9.0 days

**Adjuster:** KENNETH KONG**Manager:** VERON CHEN

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BONNET (WCP)	Bent	950.00 F	*950.00 F
2	1		*BONNET LOWER LOCK (WCP)	Distorted	120.00 F	*120.00 F
3	1		*BONNET LOCK SWITCH (WCP)	Dented	130.00 F	*130.00 F
4	1		*BONNET UPPER LOCK (WCP)	Distorted	48.00 F	*48.00 F
5	1		*BONNET CABLE (WCP)	Serviceable	48.00 F	*- F
6	1		*SUPPORT PANEL (WCP)	Cracked	325.00 F	*325.00 F
7	1		*SUPPORT PANEL TOP GARNISH (WCP)	Dented	68.00 F	*68.00 F
8	2		*SUPPORT PANEL BRACKET-RH/LH (WCP)	Cracked	36.00 F	*36.00 F
9	1		*BRACE PANEL (WCP)	Bent	85.00 F	*85.00 F
10	1		*HEADLAMP-RH/LH (WCP)	N/s Mtg Cracked	1,100.00 F	*550.00 F
11	1		*FRONT BUMPER (WCP)	Bent	580.00 F	*580.00 F
12	1		*FRONT BUMPER CENTRE LOGO (WCP)	Cracked	98.00 F	*98.00 F
13	1		*FRONT BUMPER REINFORCEMENT (WCP)	Repair	590.00 F	*- F
14	1		*FRONT BUMPER CARRIER-RH/LH (WCP)	N/s Bent	170.00 F	*85.00 F
15	2		*FRONT BUMPER SIDE RETAINER-RH/LH (WCP)	Serviceable	116.00 F	*- F
16	2		*FRONT BUMPER BRACKET-RH/LH (WCP)	Repair	1,120.00 F	*- F
17	1		*FRONT BUMPER SIDE STRUT-RH/LH (WCP)	N/s Bent	116.00 F	*58.00 F
18	1		*FRONT BUMPER TOWING COVER (WCP)	Serviceable	20.00 F	*- F
19	1		*FRONT BUMPER CLIPS (WCP) (15 Pcs)	Necessary	90.75 FS	*50.00 FS
20	1		*FRONT BUMPER UNDER COVER (WCP)	Bent	110.00 F	*110.00 F
21	1		*HORN (WCP)	Cracked	98.00 F	*98.00 F
22	1		*AIR-CON CONDENSER (WCP)	Bent	465.00 F	*465.00 F
23	1		*AIR-CON CONDENSER MOUNTING FRAME (WCP)	Cracked	105.00 F	*105.00 F
24	1		*AIR-CON SUCTION PIPE (WCP)	Serviceable	260.00 F	*- F
25	1		*AIR-CON DISCHARGE PIPE (WCP)	Serviceable	325.00 F	*- F
26	1		*RADIATOR ASSY (WCP)	Bent/Punctured	420.00 F	*420.00 F
27	1		*RADIATOR AUTO FAN ASSY (WCP)	Cracked	750.00 F	*750.00 F
28	2		*RADIATOR GUIDE-RH/LH (WCP)	Cracked	116.00 F	*116.00 F
29	1		*RADIATOR LOWER COVER (WCP)	Cracked	98.00 F	*98.00 F
30	2		*RADIATOR TOP CLIPS-RH/LH (WCP)	Necessary	24.00 F	*24.00 F
31	2		*RADIATOR TOP BEARING-RH/LH (WCP)	Distorted/Dented	56.00 F	*56.00 F
32	2		*RADIATOR LOWER SUPPORT-RH/LH (WCP)	Missing	70.00 F	*70.00 F
33	1		*RADIATOR LOWER CROSS MEMBER (WCP)	Bent	260.00 F	*260.00 F
34	1		*INTER-COOLER ASSY (WCP)	Punctured	580.00 F	*580.00 F
35	1		*INTER-COOLER HOSE-RH/LH (WCP)	N/s Punctured	390.00 F	*195.00 F
36	1		*OIL COOLER (WCP)	Punctured	455.00 F	*455.00 F
37	1		*OIL COOLER PIPE (WCP)	Serviceable	158.00 F	*- F
38	1		*ENGINE UNDER COVER (WCP)	Cracked	220.00 F	*220.00 F
39	1		*WATER PUMP ASSY (WCP)	Serviceable	560.00 F	*- F
40	1		*WATER PUMP PULLEY (WCP)	Serviceable	220.00 F	*- F
41	1		*BELT TENSIONER (WCP)	Serviceable	268.00 F	*- F
42	1		*FAN BELT (WCP)	Serviceable	55.00 F	*- F
43	2		*RADIATOR COOLANT (TIN)	Necessary	60.00 FS	*60.00 FS
44	2		*AUTO TRANSMISSION FLUID	Necessary	120.00 FS	*120.00 FS
45	1		*FRONT NUMBER PLATE	Bent	40.00 FS	*40.00 FS
46	1		*RADIATOR SPARE TANK (WCP) (Supplementary)	Mtg Broken	98.00 F	*98.00 F
47	1		*RADIATOR COOLANT PIPE (WCP) (Supplementary)	Dented	102.00 F	*102.00 F
48	1		*OIL SUM (WCP) (Supplementary)	Dented/Warped	395.00 F	*395.00 F
49	1		*OIL PAN (WCP) (Supplementary)	Cracked	750.00 F	*750.00 F
50	1		*ENGINE MOUNTING-LH (WCP) (Supplementary)	Cracked	220.00 F	*220.00 F
51	1		*ENGINE MOUNTING SCREW (WCP) (Supplementary)	Bent	8.00 F	*8.00 F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
52	1		*OIL SUM GASKET SEALANT (Supplementary)	Necessary	25.00 FS	*25.00 FS
53	4		*ENGINE OIL (LITRES) (Supplementary)	Necessary	102.00 FS	*102.00 FS
F=Franchise part. S=SpcNett.						
Sub Total (\$)					13,793.75	9,125.00
+ Margin on L,N Items 10.00/10.00% (\$)					1,335.60	872.80
Total Parts (\$)					15,129.35	9,997.80

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
<u>Miscellaneous Items</u>				
1	1	*OD/TP Case (Insurer)	-	0.00
Sub Total (\$\$)			0.00	0.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO REMOVE AND REFIT AIR-CON CONDENSER,RADIATOR,INTER-COOLER ASSY AND REFILL AIR-CON GAS	New	150.00	100.00
2	TO CHECK AND RECTIFY WIRING SYSTEMS	New	80.00	20.00
3	TO PANEL BEAT AND STRAIGHTEN FRONT CHASSIS FRAME,FRONT CROSS MEMBER,INCLUDING REPLACEMENT OF PARTS AND ALIGN WHERE NECESSARY,TO REFIT AND ADJUST THE SAME	New	1,800.00	700.00
4	TO LIFT-UP ENGINE AND GEAR BOX TO FACILITATE THE REPAIRS	New	1,200.00	750.00
5	TO PUTTY AND SPRAY PAINT ON AFFECTED AREAS	New	800.00	200.00
6	TO RESET HEADLAMP FAULT CODE	New	350.00	0.00
Gross Labour Cost (\$\$)			4,380.00	1,770.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >