

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:**

CC3/AIG21006585/ERA3Q2

Date:

18/08/2021

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd.

Policy No:

2100351369

Claimant Vehicle No : SLE4128X**Insured Vehicle No :**

SKL8109A

Date of Loss: 08/06/2021

Nature of Claim:

TP

Claim No:

0346054696SG

DESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **SLE4128X**

Make & Model: VOLKSWAGEN JETTA GP, 1.4 TSI 90 A/T (A)

Engine No:

CAXF84871

Reg. Date: 30/06/2016 (Man. Year: 2016)

Chassis No:

WVWZZZ16ZGM035022

Colour: White

Odometer:

70528 km

Engine Capacity: 1390 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price****CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:

Steering (Serviceable):

Yes

Footbrake (Serviceable):

Yes

Handbrake (Serviceable):

Yes

Engine Modification:

No

Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/55 R16

Rear Tyre Size:

205/55 R16

Front Left Side: Pirelli 5 mm

Rear Left Side:

Pirelli 5 mm

Front Right Side: Pirelli 5 mm

Rear Right Side:

Pirelli 5 mm

*The above values represent the remaining tyre treads depth***COST OF CLAIMS**

	Repairer's	Adjuster's	Difference	Diff %
Parts	2,169.37	80.00	2,089.37	96.31
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,680.00	2,120.00	3,560.00	62.68
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	7,849.37	2,200.00	5,649.37	71.97
+ GST 7.00/7.00% (S\$)	549.46	154.00	395.46	71.97

Nett Amount (S\$)	8,398.83	2,354.00	6,044.83	71.97
		+ Loss of Use (3.0 x S\$60.00/day) (S\$)	180.00	
		+ Doc/Search Fee (S\$)	2.00	
		Nett Liability (S\$)	2,536.00	

INSPECTION

Date of Assignment: 11/06/2021

Date Inspected: 11/06/2021

Estimated Period of Repair: 3.0 days

Inspected At:

Volkswagen Group Singapore Pte Ltd
 247 ALEXANDRA ROAD
 Singapore 159934

Adjuster: CHEN TSUE YEE**Manager:** Jaslin Kok Chin Yi

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*COVER FOR BUMPER PRIMED	Repair	1,358.83 FS	*- FS
2	1		*FRONT SPOILER SATIN BLACK	Not Necessary	516.29 FS	*- FS
3	1		*COOLING AIR GRILL SATIN B	Not Necessary	214.25 FS	*- FS
4	1		*FRT NUMBER PLATE	Bent	80.00 FS	*80.00 FS

F=Franchise part. S=SpcNett.

Total Parts (\$\$)**2,169.37****80.00**

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	DIAGNOSTIC AND PROGRAMMING	New	480.00	480.00
2	CHECK SHORT CIRCUIT /HARNESS REPAIR	New	280.00	0.00
3	LABOUR	New	2,520.00	840.00
4	SPRAY PAINTING	New	2,400.00	800.00
Gross Labour Cost (S\$)			5,680.00	2,120.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >