

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/AIG21006586/URA3Q2**Date:** 17/11/2021REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	7210018392
Claimant Vehicle No :	SMD2431B	Insured Vehicle No :	SMY3138G
Date of Loss:	09/06/2021	Nature of Claim:	TP
		Claim No:	3247991760SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMD2431B	Engine No:	HIDDEN
Make & Model:	BLUECAR BLUECAR, (A)	Chassis No:	VL4BCEB4RJT003280
Reg. Date:	08/08/2018 (Man. Year: 2017)	Odometer:	71628 km
Colour:	White		
Engine Capacity:	0 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	175/65 R15	Rear Tyre Size:	175/65 R15
Front Left Side:	Dunlop 6 mm	Rear Left Side:	Michelin 6 mm
Front Right Side:	Dunlop 6 mm	Rear Right Side:	Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	11,121.60	6,499.40	4,622.20	41.56
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,670.00	1,680.00	990.00	37.08
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	13,791.60	8,179.40	5,612.20	40.69
+ GST 7.00/7.00% (S\$)	965.41	572.56	392.85	40.69
Nett Amount (S\$)	14,757.01	8,751.96	6,005.05	40.69
+ Loss of Use (6.0 x S\$80.00/day) (S\$)		480.00		
+ Doc/Search Fee (S\$)		7.45		
+ Other Costs (S\$)		50.00		
Nett Liability (S\$)		9,289.41		

INSPECTION

Date of Assignment:	10/06/2021		
Date Inspected:	10/06/2021	Inspected At:	Indeco Engineers Pte Ltd (Defu) No. 39 Defu Lane 12 Singapore 539315
Estimated Period of Repair:	6.0 days		

Adjuster: MARCUS CHUA**Manager:** Jaslin Kok Chin Yi

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT FENDER LH (WCP)	Distorted	1,037.00 F	*1,037.00 F
2	1		*FRONT FENDER INNER SHIELD LH (WCP)	Distorted	154.00 F	*154.00 F
3	10		*FRONT FENDER INNER SHIELD CLIPS (WCP)	Necessary	10.00 F	*10.00 F
4	1		*FRONT FENDER COVER LH (WCP)	Distorted	194.00 F	*194.00 F
5	6		*FRONT FENDER COVER NUTS (WCP)	Necessary	6.00 F	*6.00 F
6	1		*FRONT BUMPER (WCP)	Distorted	1,493.00 F	*1,493.00 F
7	10		*FRONT BUMPER CLIPS (WCP)	Necessary	10.00 F	*10.00 F
8	1		*LH SIDE SKIRT (WCP)	Distorted	284.00 F	*284.00 F
9	1		*SET FRONT STEEL RIM	Bent	304.80 FS	*40.00 FS
10	1		*FRONT TYRE	Serviceable	206.00 FS	*- FS
11	1		*FRONT TYRE PRESSURE SENSOR (WCP)	Not Necessary	163.00 F	*- F
12	1		*FRONT LEFT ABSORBER WITH MOUNTING (WCP)	Bent / Buckled	293.00 F	*293.00 F
13	1		*ANTI ROLL TIE ROD LH (WCP)	Twisted	105.00 F	*105.00 F
14	1		*STABILIZER BAR (WCP)	Not Necessary	240.00 F	*- F
15	1		*FRONT LH KNUCKLE ARM (WCP)	Bent	400.00 F	*400.00 F
16	1		*FRONT LH LOWER ARM (WCP)	Bent	395.00 F	*395.00 F
17	1		*DRIVE SHAFT LH (WCP)	Bent	421.00 F	*421.00 F
18	1		*STEERING RACK END (WCP)	Not Necessary	125.00 F	*- F
19	1		*LH DOOR (WCP)	Repair	2,700.00 F	*- F
20	1		*LH DOOR STICKER	Necessary	70.00 FS	*70.00 FS
21	1		*FRONT SUPPORT PANEL (WCP)	Bent / Twisted	420.00 F	*420.00 F
22	1		*FRONT LH FENDER BEAM (WCP)	Bent	197.00 F	*197.00 F
23	1		*FRONT LH HEADLAMP FRAME (WCP)	Cracked	137.00 F	*137.00 F
					Sub Total (\$\$)	9,364.80 5,666.00
					+ Margin on L,N Items 20.00/15.00% (\$\$)	1,756.80 833.40
					Total Parts (\$\$)	11,121.60 6,499.40

F=Franchise part. S=SpcNett.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR TO REMOVE ACCIDENT DAMAGED PARTS IN ORDER TO REPAIRS INCLUDING PANEL BEAT ,STRAIGHTEN PANEL WHERE NECESSARY & REPLACE ABOVE PARTS	New	1,000.00	800.00
2	TO PUTTY & RESPRAY FRONT BUMPER ,LHF FENDER ,LH DOOR PILLAR AND LH DOOR	New	800.00	600.00
3	TO APPLY TUFF COATING	New	120.00	40.00
4	TO TRANSFER DOOR MECHANISM	New	120.00	0.00
5	TO REMOVE AND REPLACE FRONT LH UNDERCARRIAGE SPARES	New	450.00	180.00
6	TO CONDUCT WHEEL ALIGNMENT	New	180.00	60.00
Gross Labour Cost (\$\$)			2,670.00	1,680.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >