



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2200329

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV Date 14/01/2022
Reference CC4/LPC21006633/Aps3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SKM 5766S
Insured Veh. YP 3293X
Claim No. 20/21/21/VC05/024640
Policy No. Z20VC05005703
Accident Date 09/06/2021
Inspection Date 17/06/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CC4/LPC21006633/Aps3q2 Date: 14/01/2022 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YP 3293X	Veh. Inspected	SKM 5766S	
Policy No.	Z20VC05005703	Coverage (\$)	0.00	
Claim No.	20/21/21/VC05/024640	Excess (\$)	0.00	
Assign From	KENNY	Assign Date	11/06/2021	
2. Vehicle Particulars & Condition				
Make & Model	AUDI A4	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2014	
Chassis No.	WAUZZZ8K3EA103354	Colour	WHITE	
Odometer	152800 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	225/50 R17	PIRELLI	6 mm	
L/H Front Tyre	225/50 R17	PIRELLI	6 mm	
R/H Rear Tyre	225/50 R17	PIRELLI	6 mm	
L/H Rear Tyre	225/50 R17	PIRELLI	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	09/06/2021	Inspection Date	17/06/2021	
Survey held at	PREMIUM AUTOMOBILES PTE LTD 55 UBI ROAD 1 . SINGAPORE 408699			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKM 5766S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER (SN)	DEFORMED	2,560.00	2,560.00
1	FRONT BUMPER FIXING PARTS (SN)	NOT NECESSARY	259.00	-
1	FRONT BUMPER CLOSING ELEMENT -LOWER CENTRE (SN)	NOT NECESSARY	228.00	-
1	FRONT BUMPER AIR GUIDE GRILLE LH (SN)	NOT NECESSARY	135.00	-
1	FRONT WHEEL SPOILER LH (SN)	NOT NECESSARY	51.00	-
1	FRONT BUMPER GUIDE SECTION LH (SN)	CRACKED	36.00	35.90
1	FRONT FENDER LH (SN)	DISTORTED	990.00	990.00
1	FRONT FENDER ATTACHMENT PARTS LH (SN)	NOT NECESSARY	57.00	-
1	FRONT FENDER BRACKET LH FRONT (SN)	BENT	53.00	52.30
1	FRONT FENDER BRACKET LH REAR (SN)	NOT NECESSARY	49.00	-
1	FRONT FENDER BRACE LH (SN)	BENT	118.00	118.00
1	FRONT FENDER CLOSING ELEMENT LH (SN)	NOT NECESSARY	128.00	-
1	FRONT WHEEL HOUSING LINER LH (SN)	NOT NECESSARY	240.00	-
1	FRONT WHEEL HOUSING LINER ATTACHMENT PARTS LH (SN)	NOT NECESSARY	45.00	-
1	FRONT STONE CHIP GUARD LH (SN)	NECESSARY	73.00	72.50
1	FRONT STONE CHIP GUARD ADHESIVE TAPE LH (SN)	NECESSARY	55.00	54.40
1	HEADLIGHT MOUNTING LH (SN)	NOT NECESSARY	118.00	-
1	HEADLIGHT BRACKET LH (SN)	NOT NECESSARY	106.00	-
1	HEADLIGHT LH (SN)	CRACKED	2,343.00	2,343.00
1	HEADLIGHT GAS DISCHARGE LH (SN)	NOT NECESSARY	416.00	-
1	HEADLIGHT POWER MODULE (SN)	NOT NECESSARY	553.00	-
1	HEADLIGHT CONTROL UNIT (SN)	NOT NECESSARY	1,116.00	-
1	HEADLIGHT RETAINING PLATE (SN)	NOT NECESSARY	24.00	-
1	HEADLIGHT LIFT CYLINDER LH (SN)	NOT NECESSARY	210.00	-
1	WING MIRROR MOUNTING LH (SN)	DAMAGED	1,340.00	1,340.00
1	TURN SIGNAL INDICATOR (SN)	CUT	100.00	99.60
1	WING MIRROR CAP LH (SN)	DEFORMED	588.00	588.00
1	WINDOW SLOT SEAL (SN)	NOT NECESSARY	307.00	-
1	ROOF MOULDING LH (SN)	NOT NECESSARY	629.00	-

Report Ref No. CC4/LPC21006633/Aps3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SUNDRIES (SN)	NECESSARY	1,116.00	30.60
			14,043.00	8,284.30
	LABOUR			
	TO REMOVE ,CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS ,HORNS AND TEMPERATURE SENSOR .		360.00	360.00
	TO REMOVE AND REINSTALL LHS FRONT DOOR PANEL TRIM TO FACILITATE RENEWAL OF LHS WING MIRROR ASSY .		280.00	280.00
	TO REMOVE AND TRANSFER LHS HEADLIGHT'S CONTROL UNIT AND POWER MODULE.		350.00	350.00
	TO DISMANTLE AND RENEW FRONT BUMPER ,LHS FRONT FENDER AND LHS HEADLIGHT .RE-ORGANIZE CRASH MANAGEMENT COMPONENTS .REINSTALL ALL PARTS.		2,100.00	1,400.00
	TO RESPRAY FRONT BUMPER ,LHS FRONT FENDER ,LHS FRONT DOOR ,LHS UPPER A-PILLAR ,BONNET AND LHS WING MIRROR COVER.		4,500.00	3,000.00
	TO CARRY OUT DIAGNOSTIC CHECK .		192.00	192.00
			7,782.00	5,582.00
GRAND TOTAL			21,825.00	13,866.30
RECOMMENDED COST OF REPAIRS				13,866.30

Report Ref No. CC4/LPC21006633/Aps3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKM 5766S

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

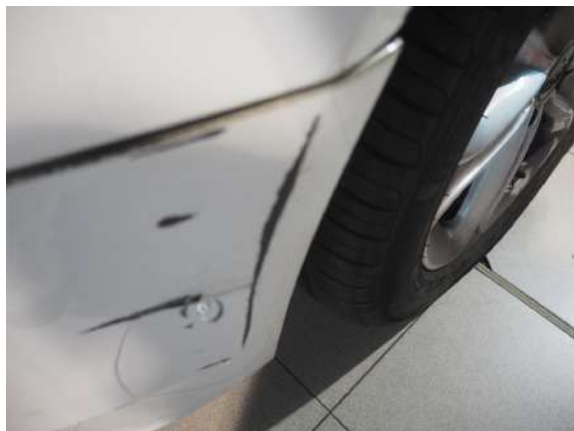



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKM 5766S

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SKM 5766S

RE-INSPECTION

