6/28/2021 Adjuster Report

#### LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

#### VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/AIG21006796/R1TF3E2

28/06/2021 Date:

**REFERENCE** 

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 2070149506 **Claimant Vehicle** SMB8004Y Insured Vehicle No: SMV7627B

No:

Date of Loss: 21/05/2021 Nature of Claim: TP Claim No: 9597216436SG

**DESCRIPTION & IDENTIFICATION OF VEHICLE** 

Reg No: **SMB8004Y** 

MAN NG363F (A24), 10.5 D (A) Make & Model: 50338140893815 Engine No: Reg. Date: 17/04/2015 (Man. Year: 2014) Chassis No: WMAA24ZZ5E7002223

Colour: Odometer: 338417 km Green

**Engine Capacity:** 10518 cc Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price** 

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Engine Modification: Pre-accident Condition: Yes No

CONDITION OF TYRES

Front Tyre Size: 275/70R22.5 Rear Tyre Size: 275/70R22.5(D) Front Left Side: Bridgestone 8 mm Rear Left Side: Bridgestone 8/8 mm Front Right Side: Bridgestone 8 mm Rear Right Side: Bridgestone 8/8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	542.05	350.00	192.05	35.43
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	542.05	350.00	192.05	35.43
+ GST 7.00/7.00% (S\$)	37.94	24.50	13.44	35.42
Nett Amount (S\$)	579.99	374.50	205.49	35.43

**INSPECTION** 

Date of Assignment: 17/06/2021

SBS Transit Ltd (YCK)

Date Inspected: 18/06/2021 Inspected At: 3 Yio Chu Kang Crescent

Singapore 786010

Estimated Period of Repair: 1.0 days

Adjuster: MOHD RASUL Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

(REPAIR COST NOT CONCLUDE)

## **REPAIR DETAILS**

## **Recommended Parts**

There are no new parts selected.

Report was unsubmitted during this print-out.

# Recommended Miscellaneous Items

There are no new miscellaneous items selected.

# Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Lab	our Items			
1	SPRAY PAINT - GREEN;600ML;SG BUS	New	0.05	0.00
2	CONTRATOR LABOUR COST	New	350.00	350.00
3	WORKSHOP ADMIN COST	New	192.00	0.00
4	LIVERY / ADVERTISEMENT COST (NPA)	New	0.00	0.00
5	TOWING COST (NPA)	New	0.00	0.00
		Gross Labour Cost (S\$)	542.05	350.00
	Report was u	Insubmitted during this print-out.		

< END OF ESTIMATES >