



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBF 6542H

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	LH HEADLAMP ASSY	FACE SCRATCHED	366.40	366.40
1	FRONT BUMPER	SCRAPED / CUT / DEFORMED	524.70	385.00
1	FRONT BUMPER SIDE RETAINER LH	BROKEN	157.20	104.50
1	LH FOG LAMP ASSY	NOT NECESSARY	321.80	-
1	LH FOG LAMP GARNISH	LEG FRACTURED	115.80	115.80
1	LH FRONT DOOR ASSY	TO REPAIR SEE LABOUR	1,115.00	-
1	LH FRONT STOP GARNISH	SCRAPED / BENT / DEFORMED	84.30	84.30
1	LH FRONT STEERING KNUCKLE	NOT NECESSARY	357.20	-
1	LH FRONT WHEEL BEARING C/W HUB ASSY	RATTLED / NOISY	250.50	220.00
1	LH FRONT UPPER SUSPENSION ARM	NOT NECESSARY	351.00	-
1	LH FRONT LOWER SUSPENSION ARM	NOT NECESSARY	250.50	-
1	LH FRONT STABILISER LINK	NOT NECESSARY	83.40	-
1	LH FRONT STEERING ROD END	NOT NECESSARY	154.80	-
1	LH FRONT SHOCK ABSORBER	NOT NECESSARY	185.30	-
1	LH FRONT WHEEL COVER	DISLODGE / MISSING	181.20	181.20
	LESS 10% DISCOUNT		-449.91	-145.72
			4,049.19	1,311.48
<u>SPECIAL NETT ITEMS</u>				
10	FRONT BUMPER CLIP (SN)	NECESSARY	50.00	30.00
1	FRONT DOOR COMPANY REGISTRATION STICKER (SN)	NECESSARY	40.00	40.00
1	LH FRONT TYRE (SN)	SIDEWALL GRAZED / DEFORMED	215.00	150.00
			305.00	220.00
<u>LABOUR</u>				
	TO CHECK WIRING.		40.00	30.00
	TO ALIGN HEADLAMPS AND REFOCUS HEADLAMP BEAMS TO SPECIFICATIONS.		80.00	30.00
	TO APPLY ANTI-RUST UNDERCOAT.		120.00	30.00

Report Ref No. CS1/AGI21006845/T1tf3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR CHARGES TO REMOVE AND REPLACE, TO CUT AND WELD, TO PANEL BEATING AFFECTED AND DAMAGED PARTS. INCLUSIVE OF THE REPAIR OF LH FRONT DOOR ASSY.		750.00	400.00
	SPRAY PAINTING CHARGES TO PAINT THE FRONT BUMPER, FRONT STEP GARNISH, FRONT DOOR AND NECESSARY AREAS.		1,000.00	650.00
	TO CONDUCT 4-WHEEL COMPUTERISED ALIGNMENT TO REALIGN WHEELS.		90.00	80.00
	TO REMOVE AND REPLACE DAMAGED FRONT LEFT HAND SUSPENSION PARTS.		450.00	200.00
			2,530.00	1,420.00
GRAND TOTAL			6,884.19	2,951.48
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,350.00

Report Ref No. CS1/AGI21006845/T1tf3e2

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

ANG BRYAN TANI

Automotive Assessor / Investigator

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.