

# LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CS3/AIG21006934/GUF3E2

**Date:** 03/11/2021

### REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 2100504168  
Claimant Vehicle No : FBD7891D Insured Vehicle No : SKM2893C  
Date of Loss: 24/05/2021 Nature of Claim: TP Claim No: 8307722422SG

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **FBD7891D**  
Make & Model: YAMAHA T135, 135cc Engine No: 5YP301334  
Reg. Date: 29/07/2009 (Man. Year: 2009) Chassis No: 5YP301334  
Colour: Blue Odometer: 53076 km  
Engine Capacity: 135 cc  
Market Value/New Car Price: N/A  
Sum Insured (S\$): **Market Value/New Car Price**

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes  
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size: 80/90-17 Rear Tyre Size: 90/80-17  
Front Left Side: Maxxis 4 mm Rear Left Side: Maxxis 4 mm  
Front Right Side: 0 mm Rear Right Side: 0 mm

*The above values represent the remaining tyre treads depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (S\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	

### INSPECTION

Date of Assignment: 23/06/2021  
Date Inspected: 23/06/2021 Inspected At: Glen Enterprise Pte Ltd (HQ)  
1100 / 1102 Serangoon Road  
Singapore 328196  
Estimated Period of Repair: 4.0 days

**Adjuster:** XING GUO QIANG

**Manager:** Tan Hui Zhen

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

MARKET VALUE: \$2,600.00 (EST)

# REPAIR DETAILS

## Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT TYRE (50%)	* Check	0.00 F	*- F
2	1		*FRONT RIM	* Check	0.00 F	*- F
3	1		*FRONT TYRE RIM SPOKE	Bent	0.00 F	*- F
4	1		*FRONT FENDER WHEEL GUARD	Missing	0.00 F	*- F
5	1		*FRONT FORK ASSY	Bent	0.00 F	*- F
6	1		*FRONT HEADLAMP	* Check	0.00 F	*- F
7	1		*FRONT HEADLAMP FAIRING	Cracked	0.00 F	*- F
8	1		*FRONT WING MIRROR	Cut	0.00 F	*- F
9	1		*HANDLE BAR	Bent	0.00 F	*- F
10	1		*HANDLE BAR GRIP	Necessary	0.00 F	*- F
11	1		*CLUTCH LEVER	Cut	0.00 F	*- F
12	2		*SIDE FAIRING LH & RH	Cracked	0.00 F	*- F
13	1		*SIDE FAIRING TOP GARNISH	Cracked	0.00 F	*- F
14	1		*CLUTCH ENGINE COVER	Dented	0.00 F	*- F
15	1		*FOOT GEAR SHIFTER	Distorted	0.00 F	*- F
16	1		*EXHAUST MUFFLER HEAT SHIELD	Dented	0.00 F	*- F
17	1		*EXHAUST MUFFLER ASSY	* Check	0.00 F	*- F
18	1		*REAR BOX	Cut	0.00 F	*- F
19	1		*REAR BOX BRACKET	Repair	0.00 F	*- F
20	1		*STICKER	Necessary	0.00 F	*- F
21	1		*RADIATOR	Dented	0.00 F	*- F

F=Franchise part.

**Total Parts (S\$)                      0.00                      0.00**

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

**< END OF ESTIMATES >**