

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI21007073/EQCN2**Date:** 04/10/2021**REFERENCE**Handling Insurer: China Taiping Insurance
(Singapore) Pte. Ltd.

Policy No: DMB1SNW00006562001

**Claimant Vehicle
No :** SFS735S**Insured
Vehicle No :** PC1393D

Date of Loss: 25/06/2021

Nature of Claim: TP

Claim
No: SNM21D203581/C02/LEWLC**DESCRIPTION & IDENTIFICATION OF VEHICLE**Reg No: **SFS735S**

Make & Model: MERCEDES-BENZ 220E, 2.2 (A)

Engine No: 10296322033755

Reg. Date: 05/09/1991 (Man. Year: 1991)

Chassis No: WDB1240212B563974

Colour: Blue

Odometer: 227447 km

Engine Capacity: 1996 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price****CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/55 R15	Rear Tyre Size:	195/55 R15
Front Left Side:	Dunlop 4 mm	Rear Left Side:	Dunlop 4 mm
Front Right Side:	Dunlop 4 mm	Rear Right Side:	Dunlop 4 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	4,585.00	3,040.20	1,544.80	33.69
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,200.00	650.00	550.00	45.83
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	5,785.00	3,690.20	2,094.80	36.21
+ GST 7.00/7.00% (S\$)	404.95	258.31	146.64	36.21
Nett Amount (S\$)	6,189.95	3,948.51	2,241.44	36.21

INSPECTION

Date of Assignment: 28/06/2021

Date Inspected: 29/06/2021

Inspected At:

Connect3 (HQ)
566 Woodlands Road
Singapore 728697

Estimated Period of Repair: 3.0 days

Adjuster: CHEN TSUE YEE**Manager:** SHIAU CHAN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 04 Oct 2021)
Parts:	143	MERCEDES-BENZ 220E 2.2 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SFS735S)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Broken	2,980.00 F	*2,100.00 FL
2	1		*REAR BUMPER PAD	Cut	605.00 F	*480.00 FL
3	1		*REAR BUMPER CENTER CHROME	Cut	540.00 F	*338.00 FL
4	1		*REAR BUMPER SIDE CHROME	Necessary	460.00 F	*460.00 FL

F=Franchise part. L=ListItemDisc.

Sub Total (S\$)	4,585.00	3,378.00
- List Item Discount on L Items 0.00/10.00% (S\$)	0.00	337.80
Total Parts (S\$)	4,585.00	3,040.20

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR CHARGES	New	600.00	250.00
2	SPRAY PAINTING	New	600.00	400.00
Gross Labour Cost (S\$)			1,200.00	650.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >