

# LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CS3/AIG21007192/BQF3E2

**Date:** 10/09/2021

### REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 2100343581  
**Claimant Vehicle No :** SMR2695H **Insured Vehicle No :** SKK2209P  
Date of Loss: 24/06/2021 Nature of Claim: TP Claim No: 5749905406SG

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SMR2695H**  
Make & Model: TOYOTA COROLLA ALTIS, 1.6 Elegance 2WD (A) Engine No: 1ZR0E87890  
Reg. Date: 27/12/2019 (Man. Year: 2019) Chassis No: MR2BE3BE600005460  
Colour: Silver Odometer: 25597 km  
Engine Capacity: 1598 cc  
Market Value/New Car Price: N/A  
Sum Insured (S\$): **Market Value/New Car Price**

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes  
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size: 225/45 R17 Rear Tyre Size: 225/45 R17  
Front Left Side: Dunlop 6 mm Rear Left Side: Dunlop 6 mm  
Front Right Side: Dunlop 6 mm Rear Right Side: Dunlop 6 mm

*The above values represent the remaining tyre treads depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (S\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	

### INSPECTION

Date of Assignment: 30/06/2021  
Date Inspected: 01/07/2021 Inspected At: Sze Kang Automobile Spraying Services (HQ)  
BLK 10 ANG MO KIO INDUSTRIAL PARK 2A,  
#03-17  
Singapore 568047  
Estimated Period of Repair: 6.0 days

**Adjuster:** Lim Teow Guan

**Manager:** SHIAU CHAN

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

MARKET VALUE: \$88,000.00 (EST)

# REPAIR DETAILS

## Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Dented	0.00 F	*- F
2	1		*REAR BUMPER CLIPS	Necessary	0.00 F	*- F
3	2		*REAR BUMPER SIDE RETAINER	Necessary	0.00 F	*- F
4	1		*REAR BUMPER REINFORCEMENT	Bent	0.00 F	*- F
5	2		*REAR BUMPER REFLECTOR	Broken	0.00 F	*- F
6	2		*REVERSE SENSOR	Short Circuit	0.00 F	*- F
7	1		*REAR END PANEL	Dented	0.00 F	*- F
8	1		*REAR END PANEL TOP GARNISH	Broken	0.00 F	*- F
9	1		*BOOTLID	Dented	0.00 F	*- F
10	3		*BOOTLID EMBLEM	Necessary	0.00 F	*- F
11	1		*BOOTLID RUBBER WEATHERSTRIP	Distorted	0.00 F	*- F
					<b>Total Parts (\$\$)</b>	<b>0.00 0.00</b>

F=Franchise part.

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.
---

< END OF ESTIMATES >