



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SU 6000A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b><u>REPLACEMENT OF PARTS</u></b>			
1	FRONT BONNET	BUCKLED	1,480.00	1,480.00
2	FRONT BONNET HINGE	O/S BENT	140.00	70.00
1	FRONT BONNET LOCK INNER	DISTORTED	185.00	185.00
1	FRONT SUPPORT PANEL RUBBER	NECESSARY / CUT	198.00	198.00
1	FRONT RH FENDER	BUCKLED	850.00	850.00
1	FRONT RH FENDER SHIELD	TORN	185.00	185.00
1	FRONT RH FENDER INNER PANEL	DENTED	385.00	385.00
1	FRONT BUMPER TOWING COVER	MISSING	45.00	45.00
1	FRONT BUMPER	DISTORTED	1,280.00	1,280.00
2	FRONT BUMPER SIDE RETAINER	NECESSARY	90.00	90.00
1	FRONT BUMPER REINFORCEMENT	BENT	685.00	685.00
1	SET FRONT BUMPER GRILLE WITH GARNISH	CRACKED	980.00	980.00
1	FRONT BUMPER LOGO	NECESSARY	105.00	105.00
1	FRONT RH FOG LAMP	CRACKED	315.00	315.00
1	FRONT RH FOG LAMP GARNISH	DISTORTED	118.00	118.00
2	FRONT BUMPER REINFORCEMENT BRACKET	BENT	370.00	370.00
1	FRONT RH HEAD LAMP	BROKEN	780.00	780.00
1	FRONT SUPPORT PANEL	BUCKLED / CRACKED	850.00	850.00
1	FRONT RH WHEEL HOUSING	REPAIRABLE	880.00	-
1	FRONT RH CHASSIS MEMBER	TO REPAIR SEE LABOUR	1,180.00	-
1	AIR CON CONDENSER	CUT	750.00	750.00
1	AIR CON FILTER	CRACKED	184.00	184.00
1	AIR CON PIPE	BENT	1,080.00	1,080.00
1	ENGINE LOWER COVER	CRACKED	540.00	540.00
1	SET HORN	CRACKED	185.00	185.00
1	AIR CLEANER ASSY	CRACKED	580.00	580.00
1	SET AIR CLEANER HOSE	CRACKED	240.00	240.00
1	FRONT RH LOWER ARM	BENT	520.00	520.00
1	FRONT RH ROD LINK	CRACKED	480.00	480.00

Report Ref No. CS1/LAW21007283/Uvf3e2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	STAY BAR FRONT	SERVICEABLE	280.00	-
1	FRONT CROSS MEMBER	SERVICEABLE	1,850.00	-
1	FRONT ENGINE MOUNTING BRACKET	CRACKED	240.00	240.00
1	FRONT RH SHOCK ABSORBER (NO PHOTO SHOW DAMAGED)	NOT NECESSARY	350.00	-
1	FRONT RH KNUCKLE (NO PHOTO SHOW DAMAGED)	NOT NECESSARY	880.00	-
1	FRONT RH WHEEL BEARING (NO PHOTO SHOW DAMAGED)	NOT NECESSARY	865.00	-
1	FRONT RH SPORT RIM (NO REPAIR)	NOT NECESSARY	1,160.00	-
1	FRONT NUMBER PLATE (NO PHOTO SHOW DAMAGED)	NOT NECESSARY	50.00	-
2	FRONT SEAT BELT	JAMMED	1,500.00	1,500.00
2	FRONT SEAT BELT PRE-TENSIONER	ACTIVATED	640.00	640.00
1	FRONT CRASH SENSOR (NO PROOF SHOW DAMAGED)	NOT NECESSARY	385.00	-
1	FRONT AIRBAG SENSOR (ECU) (NO PROOF SHOW DAMAGED)	NOT NECESSARY	1,200.00	-
1	O2 SENSOR	BENT	580.00	580.00
	LESS 5% DISCOUNT		-1,282.00	-824.50
			24,358.00	15,665.50
1	SET FRONT BUMPER CLIP (SN)	NECESSARY	68.00	35.00
1	SET ENGINE LOWER COVER CLIP (SN)	NECESSARY	58.00	30.00
1	FRONT RH TYRE (SN)	CUT	210.00	147.00
	LESS 5% DISCOUNT		-16.80	-
			319.20	212.00
	<b>LABOUR</b>			
	TO DISMANTLE / RENEW THE FRONT ACCIDENT DAMAGED PORTION. TO PANEL BEATING, RESHAPE, STRAIGHTEN, ORIENTATE & ALIGN REPAIR / REPLACEMENT PARTS. INCLUSIVE OF THE REPAIR OF FRONT RH CHASSIS MEMBER.		1,800.00	1,200.00
	TO DISMANTLE & REFIT FRONT RH KNUCKLE, SHOCK ABSORBER & STAY BAR.		280.00	120.00
	TO CHANGE AIR CON CONDENSER, PIPE & REFILL GAS.		280.00	100.00
	SUPPLY SPRAY PAINT MATERIAL & NECESSARY ITEMS ON THE ACCIDENT DAMAGED PORTION.		1,800.00	1,000.00
	ADJUST WHEEL ALIGNMENT.		150.00	80.00

Report Ref No. CS1/LAW21007283/Uvf3e2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	RESETTING OF FRONT CRASH SENSOR AND AIRBAG SENSOR (REPROGRAMME).	NOT NECESSARY	350.00	-
	TO REMOVE & REFIT FRONT LH & RH SEATBELTS & PRE-TENSIONERS.		200.00	100.00
			4,860.00	2,600.00
<b>GRAND TOTAL</b>			<b>29,537.20</b>	<b>18,477.50</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>13,500.00</b>

Report Ref No. CS1/LAW21007283/Uvf3e2

CHUA KANG SENG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.