

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CC6/AIG21007372/UGA3Q2  
**Date:** 19/10/2021**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1800133647-02
<b>Claimant Vehicle No :</b>	PC8232P	<b>Insured Vehicle No :</b>	SKS3331U
Date of Loss:	06/07/2021	Nature of Claim:	TP
		Claim No:	9958703225SG

**DESCRIPTION & IDENTIFICATION OF VEHICLE**

Reg No:	<b>PC8232P</b>	Engine No:	21833091
Make & Model:	GOLDEN DRAGON XML6103J98, 6.7 D (M)	Chassis No:	LL3BGCDH7AA003374
Reg. Date:	15/12/2010 (Man. Year: 2010)	Odometer:	763141 km
Colour:	White		
Engine Capacity:	6693 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:		Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

**CONDITION OF TYRES**

Front Tyre Size:	11 R22.5	Rear Tyre Size:	11 R22.5 (D)
Front Left Side:	Copartner 6 mm	Rear Left Side:	FRONWAY 6/6 mm
Front Right Side:	A199 6 mm	Rear Right Side:	FRONWAY 6/6 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	14,530.00	2,565.00	11,965.00	82.35
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,600.00	2,070.00	1,530.00	42.50
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (S\$)</b>	<b>18,130.00</b>	<b>4,635.00</b>	<b>13,495.00</b>	<b>74.43</b>
<b>Approved Total (Overridden) (S\$)</b>		<b>3,700.00</b>		

(S\$)	18,130.00	3,700.00	14,430.00	79.59
<b>+ GST 7.00/7.00% (S\$)</b>	1,269.10	259.00	1,010.10	79.59
<b>Nett Amount (S\$)</b>	<b>19,399.10</b>	<b>3,959.00</b>	<b>15,440.10</b>	<b>79.59</b>
<b>Global Sum Settlement (S\$)</b>	<b>0.00</b>			

INSPECTION

Date of Assignment: 06/07/2021

Date Inspected: 06/07/2021

Estimated Period of Repair: 3.0 days

Inspected At:

Fastech Auto Pte Ltd (HQ)  
 1 Kaki Bukit Ave 6, #01-46/48/50 Autobay  
 Singapore 417883

**Adjuster:** MARCUS CHUA**Manager:** Chong Pui Lin

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER ASSY	Deep Cut / Cracked	4,800.00 F	*2,850.00 FL
2	1		*FRONT BODY PANEL O/S	Repair	6,900.00 F	*- FL
3	1		*HEADLAMP O/S	Not Necessary	1,550.00 F	*- FL
4	1		*FRONT SIDE PANEL O/S	Repair	1,280.00 F	*- FL
					Sub Total (S\$)	14,530.00 2,850.00
					- List Item Discount on L Items 0.00/10.00% (S\$)	0.00 285.00
					Total Parts (S\$)	14,530.00 2,565.00

F=Franchise part. L=ListItemDisc.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO CHECK WIRING	New	50.00	20.00
2	LABOUR FOR PANEL BEATING ,REPLACED PARTS	New	1,800.00	1,200.00
3	TO PUTTY & SPRAY PAINTING	New	1,500.00	850.00
4	TO RESET & REPROGRAMME SYSTEM	New	250.00	0.00
Gross Labour Cost (S\$)			3,600.00	2,070.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >