

Practicing Management Consultant (PMC) of SBACC
Approved Training Organisation (ATO) of Workforce Singapore

Our reference:

21-7751

Date:

15/5/2021

c/o Yap Motor Service Pte Ltd Blk 7 Sin Ming Industrial East Sector C #01-82 Singapore 575642

Dear Sirs

RE:

Road Traffic Accident on 18/4/2021

Seah Tian Sze

In accordance with your instructions received in this office or 6/5/2021 , we made arrangements to examine the vehicle on 6/5/2021 at above-mentioned address. The following data was

recorded:

#### Vehicle details

Make	Honda	Registration	SLR430E	
Model	Shuttle	Chassis	GK81007687	
Colour	Black	Gearbox	Auto	
Odometer	67638km	Paintwork	Good	
Steering	In order	Brakes	In order	
Condition	Good			

### **Tyre Depths**

Front left	195/55R15	85% Habilead		
Front right	195/55R15	85% Habilead		
Rear left	195/55R15	80% Bridgestone		
Rear right	195/55R15	80% Bridgestone		

Status	REPAIRABLE		
Magnitude	Medium		
Legal status	Unroadworthy		

### Impact Direction & Area of Damage:

No.25 Kaki Bukit Road 4

#06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171



Following our examination of the accident damage, we have calculated repair times and method, which are detailed on page 2 & 3. We would recommend a sum of \$5,000.00 and 5 working days for repair, which is sufficiently lower than the pre accident value to render the vehicle an economically and physically reliable proposition.

Subsidiaries of Impact Analysis Consultant:

- Impact Analysis Consulting Pte Ltd Impact Analysis Academy Pte Ltd IA Racking Solutions Pte Ltd
- ◆ IA Accounting & Consultancy Pte Ltd
   ◆ Infoknights International Services (Philippines)
   ◆ IABN Pte Ltd
   www.iaconsultingsg.com



Practicing Management Consultant (PMC) of SBACC
Approved Training Organisation (ATO) of Workforce Singapore

Our reference

21-7751

Date

15/5/2021

Page

2

# Section A: Damaged Parts Assessment

No.25 Kaki Bukit Road 4

#06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

Part's Description	Qty	Condition As inspected	Repairer's Estimate	Our Adjustment
List Items:				
Rear door Ih	1	гераіг.respгау	1025.60	0.00
Rear fender Ih	1	crushed	996.80	996.80
Rear fender inner shield Ih	1	torn	145.10	145.10
Rear bumper	1	holder torn	854.10	854.10
Rear bumper side retainer Ih	1	damaged.nec	36.10	36.10
Rear shock absorber Ih	1	bent	265.30	265.30
Rear wheel bearing Ih	1	necessary	165.10	165.10
Rear axle	1	bent	1325.80	1325.80
	Sub- Total	costs	4813.90	3788.30
	Percentage discount :	20%	962.78	757.66
	Sub-Total costs	for parts	3851.12	3030.64
Special Nett Items:				
Rear tyre lh	1	abraded	250.00	200.00
Rear tyre rim lh	1	damaged	566.00	566.00
Rear fender sealant lh	1	necessary	30.00	30.00
	Sub-Total costs	for parts	846.00	796.00
Parts Repair				
坤	*	*	0.00	0.00
	Sub- Total		0.00	0.00
	Total costs fo	or parts	4697.12	3826.64

Subsidiaries of Impact Analysis Consultant:

 <sup>■</sup> Impact Analysis Consulting Pte Ltd
 ■ Impact Analysis Academy Pte Ltd
 ■ IA Racking Solutions Pte Ltd

 <sup>■</sup> IA Accounting & Consultancy Pte Ltd
 ■ Infoknights International Services (Philippines)
 ■ IABN Pte Ltd
 www.iaconsultingsg.com



Practicing Management Consultant (PMC) of SBACC
Approved Training Organisation (ATO) of Workforce Singapore

Our reference

21-7751

Date

15/5/2021

Page

3

# **Section B: Labour Cost Calculation**

No.25 Kaki Bukit Road 4

#06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

	Hourly rate	Manhr. Req.		Total
To dismantle, replace, cut, weld, knock out dents to straighten accident parts as-mentioned on the 'Parts Repair' column inclusive of replacement parts.	\$ 45.00	18	\$	810.00
Putty & Spray painting to adjacent panels. Job allowance. Paint / material (3 panels)	Sub-contract work.		\$	700.00
Apply rust proofing on the adjacent panels.	Sub-contract work.			20.00
Remove and replace rear undercarriage works lh	\$ 45.00	5	\$	225.00
Remove and refix inner trim to facilitate the replacment of rear fender lh	\$ 45.00	1.5	\$	67.50
Remove and refix fuel tank, pipes to facilitate the repair works	\$ 45.00	1.5	\$	67.50
Conduct water leak test for rear portion associated repair works	\$ 45.00	1	\$	45.00
Wiring and bulb checking	\$ 45.00	0.8	\$	36.00
Total labour cost				

Manhour rate and the number of manhours required for each repairing task are formulated based on individual workshop's operating cost and in-house@ IA Research Guidelines respectively.

Subsidiaries of Impact Analysis Consultant:

Impact Analysis Consulting Pte Ltd
 Impact Analysis Academy Pte Ltd
 IA Racking Solutions Pte Ltd

 <sup>■</sup> IA Accounting & Consultancy Pte Ltd
 ■ Infoknights International Services (Philippines)
 ■ IABN Pte Ltd
 www.iaconsultingsg.com


























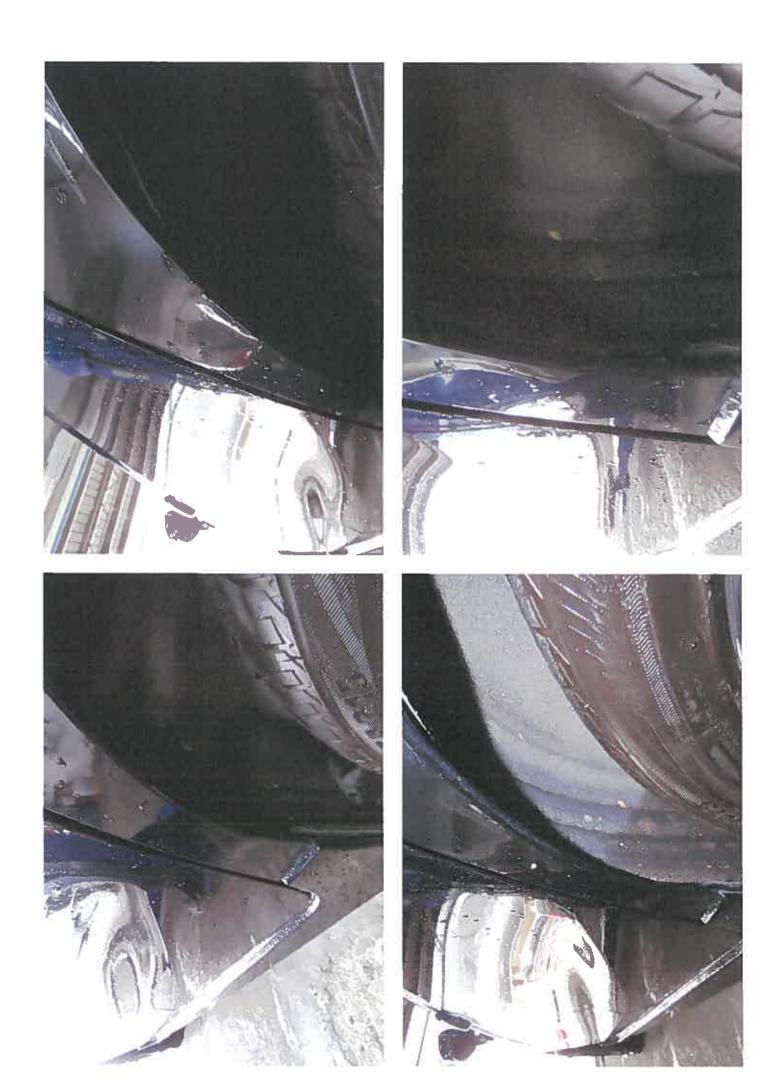































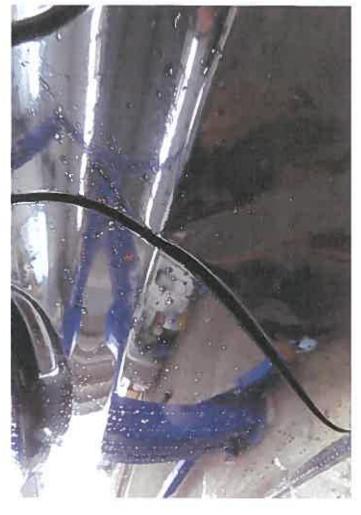







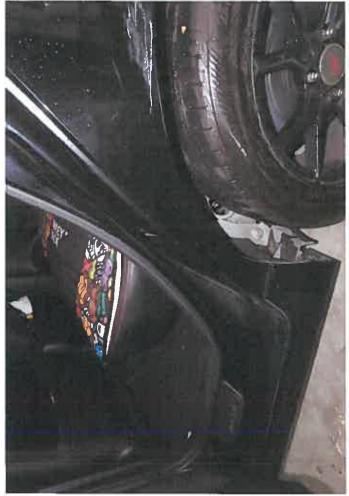




































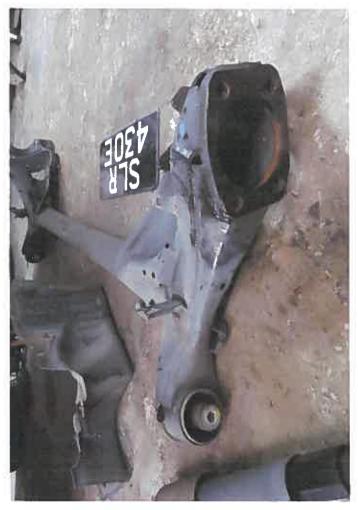




























(

(





(

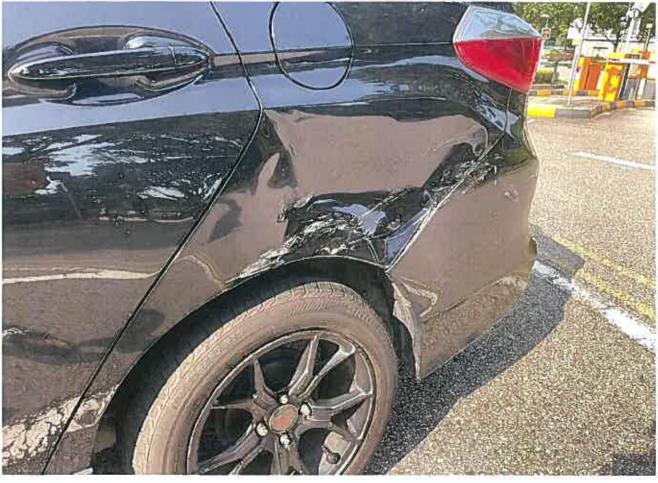

# **Enquire Vehicle-Related Transaction History**

### **Transaction History Details**

Log Date/Time.

05 May 2021 / 15:36:09

Asset Type:

Vehicle

Transaction Amount:

\$7.49

Asset ID:

SLQ7432J

Transaction Type:

18.19 Enquire Veh Owner Info (Others) by

Law Firm

Channel:

**External Agency** 

User ID:

EKURTMLO - TAY MAY LIN LENA

Business Transaction Reference No.:

20210505153609068052

As at Date of Search:

18 Apr 2021

As at Time:

14:00:00

Vehicle No.:

SLQ7432J

Search Reason:

-

Date of Filing:

Suit No.:

-

Law Firm Case No.:

\_

Information displayed is correct as at the log date and time.

**Enquire Related Logs** 

OK