


ASS. REQ. BY: Stere CS/LG121007628/EFV3

ASSIGNMENT

From: _____ Date: _____
Estimated Cost: _____
OD / TP / WS / PRES / OD-RES / EVA / INV / MV
To Inspect Vehicle No: _____
at Workshop m/s _____
of _____
Insured: _____
Policy No. _____
Claims No. _____
Sum Insured: _____ Excess: _____
(Client's Record)
Make of Veh: _____
(Policy Condition)
Remark: The veh had commenced its
repair at the time of inspection.
Bal. or Market Value: _____
IDAC Accident Report: _____ Consistent? : Yes or No
GIA / PR Seen: _____ Consistent? : Yes or No
Est. Repairs: _____ days Res.: Yes or No
Cum Sum: _____ % 3 Val.: Yes or No
CA / REV / REP. / 24 HRS
Date: _____ Person Contacted: _____ Vehicle: IN / OUT

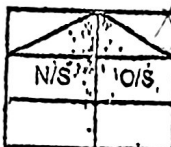

Veh No: STR 10780 Yr Regn: 9/6/29
Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or _____
Make: Honda Fit C.C. 1359
Colour: White A/C: Insured / Std / NI / N
Sp. Reading: 268894 T/Radio: Insured / Std / NI / N
Eng/No: _____
C/No: GE 6150165
Gen. Cond: Good / Fair / Poor / Burnt
Steering: In order / Jammed / Locked / Burnt or
Brakes: In order / Jammed / Locked / Burnt or
Mod: NII / S/Rim / STD A/Rim or
Tyre Size: F: 195/55R15
R: _____
BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or Wet lake.
Front _____ Rear _____
R/Bal. 4 mm R/Bal. 4 mm
L/Bal. 4 mm L/Bal. 4 mm
D.O.A. 10/1/21 D.O.I. 15/7/21
Survey held at Autumn Auto
Des. of Damages: Fnt / Rear / O/S / N/S / U/C / Rooftop or
F4 RM
The U/C / Chassis frame / Body Structure affected due to collision

Date / Time	Action / Instruction
	<u>NIV- JOK</u>

File/Time, File, Post 107. ☐ : Prel. Report
File/Time, File Return 107. ☐ : Final Report

Days Of Repair: _____
Resurvey No. of Trip: _____

Add Fee: ☐ : Site Insp (\$ _____)
☐ : Interview (\$ _____)
☐ : Tech. Invs (\$ _____)
☐ : Weekend (\$ _____)

Survey Fee: _____
Transportation: _____
Fees: _____
Others: _____
TOTAL: _____

AUBURN AUTO PTE LTD

176 Sin Ming Drive #04-18 Sin Ming Autocare, Singapore 575721

Tel : +65 9773 6360

Email: mak.auburnauto@gmail.com

Vehicle No: SJR1078G

Model: Honda Fit

QTY	Description	Repairer's Estimate	
	Spare Parts - List Items		
1	Front bumper ?	\$	800.00
1	Front right fender / 00	\$	800.00
1	Front RH headlight / 00	\$	800.00
1	Top RH panel (p111) / 00	\$	1,000.00
1	Front bonnet X 00	\$	900.00

\$ 4,300.00

c/f: \$

\$ 4,300.00

Special Nett Items**AMT S\$**

\$ -**S/N. Labour Charges**

1	Remove and refit and panel beating	\$	800.00	600
2	Remove, refit and replaced damage and check up rear electrical wiring	\$	150.00	30
3	Remove and refit inner garnishes trim to assist repair	\$	200.00	30
4	To apply undercoating on replaced panel	\$	120.00	30
5	To Respray Painting.	\$	900.00	600

\$ 2,170.00**GRAND TOTAL**

\$ 6,470.00

Steve (LKK)
15/7/21, 10:30am

Wet AL
L/S
My AL by
5 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: