

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7596 Email: absolute.app.svcs@gmail.com

Invoice

Customer: SJ Motor Enterprise

Date:

10.10.2018

C/o:

1 Soon Lee Street #06-40 Pioneer Centre

Singapore 627605

Invoice No: NS-2018-397

Description				Amount
Vehicle No:	SJM2756C			
Make & Model:	Toyota Vios J (A)			
Our reference:	AAS/218/397			
Services rendered	for appraiser / inspection repo	ort		
Survey Fee				
Photographs				
Transport Fees				
Re-inspection Fees				
SGD Dollar : Eight h	undred eighty five dollar only	Total:	SGD	\$ 885.00


Notes:

All cheques payment should be crossed and made payment to "Absolute Appraisal Services Pte Ltd"

Please indicate our "Invoice No." on the reverse side of the cheque.

Please do not hesitate to contact us should you have any enquires.

Absolute Appraisal Services Pte Ltd

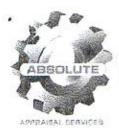

160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722

Mobile: 9688-0413 Fax: 6266-7396 Email: absolute.app.svcs@gmail.com

Vehicle Inspection Report

To: C/o: SJ Motor Enterprise

1 Soon Lee Street #06-40 Pioneer Centre

Singapore 627605

Date of report:

10.10.2018 20.09.2018

Date of request: Date of inspection: 20.09.2018

Date of accident:

07.09.2018

Report No: AAS/2018/397

Claim type: Third Party Claim

Particulars of affected vehicle:

Registration no: Make/Model:

SJM2756C

Toyota Vios J (A)

2008

Year of registration: Colour:

Metallic Black

Odometer:

Engine Capacity:

Not Working 1497 cc

Engine no:

1NZX831353

Chassis no:

MR053HY9305089735

Condition of tires:

Front Left:

Make:

5mm Kapsen

Rear Left: Make:

5mm Kapsen Front Right:

5mm

Make: Rear Right: Kapsen 5mm

Make:

Kapsen

Type of road wheel:

Alloy

(The above represent the remaining life of the tire thread)

Pre-accident condition (Static tests only)

General Bodywork

: Good

Paintwork

: Good : In order

Handbrake Footbrake

: In order

Steering

: In order

Apparent engine modification

: Nil

The Assignment

The inspection was conduct at M/s. Kok Wang Car Grooming

1 Soon Lee Street #06-40 Pioneer Centre

Singapore 627605

(Subsequent inspection was conducted)

Assessment

Repairer's estimate:

\$ 18,447.83

Revised estimate:

\$ 13,115.93

Recommended reserve:

\$ 10,500.00 (Lump sum)

Estimated normal duration of repairs: 20 Working days



160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722 Mobile: 9688-0413 Fax: 6266-7396 Email: absolute.app.svcs@gmail.com

Vehicle No: SJM2756C

Report No: AAS/2018/397

W/O PREJUDICE

Point of impact

At the front & rear portion.

General description of damages

The front bumper, front bumper lower spoiler, headlamps, front support panel, LHF fender, boot lid, tail lamps, tail lamp panels, RHR fender, rear bumper, rear bumper lower spoiler, spare tyre panel, etc.

Other parts were also found damaged. (See schedule for details)

Recommendation

The estimate cost of repair submitted by M/s Kok Wang Car Grooming as per schedule attached have been revise and scrutinize. We list the breakdown of our findings and recommendation as per attached.

Our adjusted amount for the cost of repair is SGD \$13,115.93

Conclusion

The repairer has agreed to undertake the repair at a lumpsum of SGD \$10,500.00

Under normal circumstances, the repair of the damaged vehicle should be completed within a reasonable period of 20 working days.

We have **Not Authorised** and/or instruction to the repairer to proceed with the repairs. This inspection was conducted entirely on a 'Without Prejudice' basis.

We are pleased to advise that the inspection was carried out accordingly and hereby submit our appraisal report which includes $\underline{140}$ photographs.

Your Faithfully Absolute Appraisal Services Pte Ltd

Nicky Sean
Automobile Appraiser
MSAAA / MSMCTA



160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722 Mobile: 9688-0413 Fax: 6266-7896

Email: absolute.app.svcs@gmail.com

Vel	Vehicle No: SJM2756C				R	Report No: AAS/2018/397				
Ap	praisement Schedule						•	•		
S/N	V Parts Description	Qty	Condition		R	epairer's Est	Re	vised Est		
1	Front bumper	1	Dented		4	25 MH19 50	\$	472.60		
2	Front bumper emblem	1	Necessary		\$	44.60	\$	44.60		
3	Front bumper centre grille	1	Cracked		\$	87.60	\$	87.60		
4	Front bumper tow hook cover	1	Missing		\$	12.30	\$	12.30		
5	Front bumper retainer LH/RH	2	Cracked	\$ 71.4	0 \$	142.80	\$	142.80		
6	Front bumper absorber	1	Dented		\$	94.20	\$	94.20		
7	Front bumper reinforcement	1	Dented		\$	398.90	\$	398.90		
8	Front bumper arm LH/RH	2	Serviceable	\$ 248.4	0 \$	496.80		-		
9	Front grille	1	Cracked		\$	283.60	\$	283.60		
10	Front grille moulding	1	Cracked		\$	98.40	\$	98.40		
11	Headlamp LH/RH	2	Grazed/Cracked	\$ 597.6	0 \$	1,195.20	\$	1,195.20		
12	Headlamp panel LH/RH	2	Serviceable	\$ 89.9	0 \$	179.80				
13	LHF fender	1	Dented/Distorted		\$	654.20	\$	654.20		
14	Front fender nameplate 'VVTI'	2	Necessary	\$ 12.4	0 \$	24.80	\$	12.40		
15	Front support panel	1	Dented		\$	957.40	\$	957.40		
16	Front air deflector LH/RH	2	Serviceable	\$ 65.6	0 \$	131.20		4		
17	Boot lid	1	Dented/Distorted		\$	650.90	\$	650.90		
18	Boot lid emblem	1	Necessary		\$	50.20	\$	50.20		
19	Boot lid nameplate 'Vios'	1	Necessary		\$	56.50	\$	56.50		
20	Boot lid nameplate 'J'	1	Necessary		\$	36.20	\$	36.20		
21	Boot lid outer moulding	1	Serviceable		\$	192.20		-		
22	Boot lid lock	1	Distorted		\$	100.80	\$	100.80		
23	Boot lid striker	1	Distorted		\$	20.10	\$	20.10		
24	Boot lid weather-strip	1	Necessary		\$	194.60	\$	194.60		
25	Boot lid hinge LH/RH	2	Serviceable	\$ 76.40	\$	152.80				
26	Boot lid stopper LH/RH	2	Serviceable	\$ 8.30) \$	16.60				
27	Tail lamp LH/RH	2	Cracked/Broken	\$ 282.60) \$	565.20	\$	565.20		
28	Tail lamp panel LH/RH	2	Dented/LH Repair	\$ 150.30) \$	300.60	\$	150.30		
29	Tail lamps clips	4	2pc Necessary	\$ 3.00) \$	12.00	\$	6.00		
30	Rear bumper	1	Dented		\$	467.60	\$	467.60		
31	Rear bumper reflector LH/RH	2	Cracked	\$ 97.20) \$	194.40	\$	194.40		
32	Rear bumper seal LH/RH	2	Serviceable	\$ 57.90	\$	115.80		•		
33	Rear bumper retainer LH/RH	2	Cracked	\$ 97.20	\$	194.40	\$	194.40		
34	Rear bumper support LH/RH	2	Cracked	\$ 42.90	\$	85.80	\$	85.80		
35	Rear bumper bracket LH/RH	2	Cracked	\$ 76.80	\$	153.60	\$	153.60		
36	Rear end panel	1	Dented		\$	610.80	\$	610.80		
37	Rear end panel trim	1	Deformed/Cracked		\$	211.00	\$	211.00		
38	RHR fender	1	Distorted/Repair		\$	890.00				
39	Rear fender side trim LH/RH	2	Serviceable	\$ 254.60	\$	509.20				
40	Rear windscreen moulding	1	Not Necessary		\$	87.10				
41	Spare tyre panel	1	Distorted/Repair		\$	697.30		*		
42	Spare tyre sponge LH	1	Deformed		\$	180.60	\$	180.60		
43	Spare tyre sponge RH	1	Deformed		\$	224.70	\$	224.70		
					0-009	APT 10 0 11 10 10 10 10 10 10 10 10 10 10 1				

Page 3 of S



160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722 Mobile: 9688-0413 Fax: 6266-7896

Mobile: 9688-0413 Fax: 6266-7596 Email: absolute.app.svcs@gmail.com

Veh	icle No: SJM2756C					Re	port No: AAS	/2018	3/397
44	Spare tyre board	1	Serviceable			\$	180.30		
	Spare tyre bolt	1	Serviceable			\$	51.40		-
				Tot	al:	\$	12,477.10	-5	8,607.90
				-25	%	\$	3,119.28	\$	2,151.98
				List to	otal:	\$	9,357.83	\$	
1	Front number plate	1	Dented			\$	50.00	\$	50.00
2	Front bumper lower spoiler	1	Cracked			\$	450.00	\$	450.00
3	Front bumper clips	1set	Necessary			\$	50.00	\$	30.00
4	Rear bumper lower spoiler	1	Cracked			\$	400.00	\$	400.00
5	Rear bumper clips	1set	Necessary			\$	50.00	\$	30.00
6	Reverse sensor	1set	Cracked			\$	300.00	\$	250.00
7	Rear windscreen sealant	1	Not Necessary			\$	60.00		-
8	Joint sealant	4	2 tube Necessary	\$	60.00	\$	240.00	\$	80.00
				Special ne	ett total:	\$	1,600.00	\$	1,290.00
				Parts T	otal:	\$	10,957.83	\$	7,745.93
S/N	Labour Description					Rej	pairer's Est	Re	vised Est
1	Rust proofing on front affected	& replac	ement panels.			\$	50.00	\$	30.00
2	To check front lightings & wirin	igs.				\$	60.00	\$	40.00
3	To remove & reinstall aircon co	ndenser.	Top up aircon gas.			\$	150.00	\$	120.00
4	To remove & reinstall radiator	& cooling	fan assy.			\$	120.00	\$	80.00
5	To supply sealant, renew front l	oumper l	ower spoiler.			\$	120.00	\$	100.00
6	Spray painting on affected & rep	olacemen	t panels.			\$	1,200.00	\$	1,000.00
7	Renew front damaged parts. Re	-align all	affected area.			\$	1,200.00	\$	880.00
8	Rust proofing on rear affected &	replace	ment panels.			\$	150.00	\$	90.00
9	To check rear lightings & wiring	ŗs.				\$	60.00	\$	40.00
10	Remove & transfer boot lid com	ponent.				\$	100.00	\$	60.00
11	To supply sealant, renew rear b	umper lo	wer spoiler.			\$	120.00	\$	100.00

Page 4 of 5



160 Sin Ming Drive #05-16 Sin Ming AutoCity (S) 575722 Mobile: 9688-0413 Fax: 6266-7396 Email: absolute.app.svcs@gmail.com

Veh	/ehicle No: SJM2756C			Report No: AAS/2018/397				
12	Renew reverse sensor.		\$	80.00	\$	50.00		
13	Remove & reinstall rear trimmings & rear seats.		\$	100.00	\$	60.00		
14	Remove & refit rear windscreen glass.		\$	180.00		2		
15	Spray painting on rear affected & replacement panels.		\$	1,600.00	\$	1,400.00		
16	Renew rear damaged parts. Re-align rear affected area.		\$	2,200.00	\$	1,320.00		
		Labour Total:	\$	7,490.00	\$	5,370.00		
		Grand Total:	\$	18,447.83	\$	13,115.93		

The final adjusted lump sum amount is \$10,500.00

Under normal circumstances, the repair should be completed within a reasonable period of 20 working days.

140 Photographs were taken at the time of inspection.

Disclaimer: This report is intended for the exclusive use of the address solely in relation to the loss occurrence in which the assessed vehicle involved. No liability or responsibility whatsoever shall be held by Absolute Appraisal Service Pte Ltd for any reliance on this report by any third party.