



# TY5 CONSULTANCY

( Registration No.: 53429875C )

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

Our Services : Automotive Surveying / Vehicle Valuation  
Motor Claims Investigation / Evaluation & Consultation

Reference : TY5/TA/10001/0233/TP/03.21

Date : 20 March 2021

Vehicle no : SJZ 233P

To: Tan Yian Chir  
c/o 2 Kaki Bukit Ave 2  
#01-36, Kaki Bukit Autohub  
Singapore 417921

## VEHICLE INSPECTION REPORT

Name of Workshop : Sheng Li Lai  
Place of inspection : 2 Kaki Bukit Ave 2 #01-36, Kaki Bukit Autohub, Singapore 417921  
Date of Accident : 04 March 2021  
Date of Inspection : 08 March 2021

### VEHICLE PARTICULAR

Registration No.	: SJZ 233P	Chassis Frame No.	: WDD2050402R159842
Make / Model	: Mercedes Benz C180 Avantgarde	Engine No.	: 27491030584255
Year of Registration	: 2016	Odometer Reading	: 80,380 KM
Class / Type	: Saloon	Colour	: Silver

### VEHICLE CONDITION

General Condition	: Very Good	Steering	: Serviceable
Paintwork	: Very Good	Foot/ Parking Brake	: Serviceable

### TYRE CONDITION

	<u>Size</u>	<u>Thread Balance</u>
Front L/H :	GOODYEAR 225 / 50 R17	8mm
Front R/H :	GOODYEAR 225 / 50 R17	8mm
Rear L/H :	GOODYEAR 225 / 50 R17	8mm
Rear R/H :	GOODYEAR 225 / 50 R17	8mm

\* The above is an estimate of the remaining life of the tyre thread in percentages

### COST OF REPAIR

	Repairer S\$	Adjuster S\$
Parts	\$ 10,470.00	\$ 9,112.00
Labour	\$ 3,420.00	\$ 2,890.00
	<u>\$ 13,890.00</u>	<u>\$ 12,002.00</u>

### TY5 Recommendation

Lump Sum Repair :  
\$ 9,600.00

Estimated Repair Duration :

7

working days (excluding Sat, Sun & Public Holidays)

*The information contained in these documents may be privileged and confidential, and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited.*



# TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

Our Services : Automotive Surveying / Vehicle Valuation  
Motor Claims Investigation / Evaluation & Consultation

Reference : TY5/TA/10001/0233/TP/03.21  
Date : 20 March 2021  
Vehicle no : SJZ 233P

## ASSESSMENT SCHEDULE

SN	Qty	Descriptions	Conditions	Repairer's Estimate	Surveyor's Revised
<b>LIST ITEMS:-</b>					
1	1 pc	rear bumper	broken	\$ 1,660.00	\$ 1,660.00
2	1 pc	rear bumper lower diffuser	deformed	\$ 205.00	\$ 205.00
3	1 pc	rear bumper ctr chrome moulding	cracked	\$ 245.00	\$ 245.00
4	1 pc	rear bumper tow hook cover	deformed	\$ 55.00	\$ 55.00
5	1 pc	rear bumper reinforcement	buckled	\$ 610.00	\$ 610.00
6	1 pc	rear bumper under cover	broken	\$ 175.00	\$ 175.00
7	1 pc	rear bumper ctr retainer	necessary	\$ 130.00	\$ 130.00
8	1 pc	rear bumper l/h side retainer	necessary	\$ 55.00	\$ 55.00
9	1 pc	rear bumper r/h side retainer	necessary	\$ 55.00	\$ 55.00
10	1 set	rear bumper clips	necessary	\$ 35.00	\$ 35.00
11	4 pcs	reverse sensor @\$175.00	not working	\$ 700.00	\$ 700.00
12	1 pc	rear end panel	buckled	\$ 1,330.00	\$ 1,330.00
13	1 pc	rear exhaust muffler	damaged	repair	repair
14	1 pc	bootlid	buckled	\$ 2,200.00	\$ 2,200.00
15	1 pc	bootlid inner lock	jammed	\$ 200.00	\$ 200.00
16	1 pc	bootlid chrome garnish	unconfirmed	\$ 125.00	not affected
17	1 pc	bootlid logo emblem	necessary	\$ 52.00	\$ 52.00
18	1 pc	bootlid "C180" emblem	necessary	\$ 78.00	\$ 78.00
19	1 pc	bootlid "C&C" emblem	necessary	\$ 50.00	\$ 50.00
20	1 pc	bootlid inner trim	dislodged	\$ 220.00	reuse
21	1 set	bootlid inner trim clips	necessary	\$ 35.00	\$ 35.00
22	1 pc	bootlid l/h hinge	bent	\$ 255.00	\$ 255.00
23	1 pc	bootlid r/h hinge	bent	\$ 255.00	\$ 255.00
24	1 pc	bootlid weatherstrip	deformed	\$ 250.00	\$ 250.00
25	1 pc	l/h taillamp	cracked	\$ 700.00	\$ 700.00
26	1 pc	r/h taillamp	cracked	\$ 700.00	\$ 700.00
				\$ 10,375.00	\$ 10,030.00
Less 10%					\$ 1,003.00
				\$ 10,375.00	\$ 9,027.00
<b>SPECIAL NETT ITEMS:-</b>					
27	1 pc	rear no. plate	buckled	\$ 60.00	\$ 50.00
28	1 pc	rear no. plate frame	deformed	\$ 35.00	\$ 35.00
				\$ 95.00	\$ 85.00
<b>Total</b>				\$ 10,470.00	\$ 9,112.00



# TY5 CONSULTANCY

(Registration No.: 53429875C)

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

*Our Services : Automotive Surveying / Vehicle Valuation  
Motor Claims Investigation / Evaluation & Consultation*

Reference : TY5/TA/10001/0233/TP/03.21  
Date : 20 March 2021  
Vehicle no : SJZ 233P

## ASSESSMENT SCHEDULE

<u>SN</u>	<u>Qty</u>	<u>Descriptions</u>	<u>Conditions</u>	<u>Repairer's Estimate</u>	<u>Surveyor's Revised</u>
		B/F		\$ 10,470.00	\$ 9,112.00
29		To panel beat and renewal of all necessary damaged body parts		\$ 1,600.00	\$ 1,400.00
30		To check wiring and rewire		\$ 60.00	\$ 50.00
31		To remove and reinstall bootlid components		\$ 80.00	\$ 60.00
32		To remove and reinstall rear boot upholstery		\$ 120.00	\$ 100.00
33		To remove and reinstall reverse sensor		\$ 140.00	\$ 100.00
34		To remove and reinstall rear exhaust muffler		\$ 120.00	\$ 100.00
35		To apply anti-rust		\$ 100.00	\$ 80.00
36		To putty and spray-paint of affected areas		\$ 1,200.00	\$ 1,000.00
				<b>\$ 3,420.00</b>	<b>\$ 2,890.00</b>

Total	\$ 13,890.00	\$ 12,002.00
-------	--------------	--------------



# TY5 CONSULTANCY

( Registration No.: 53429875C )

Address : 50 Chin Swee Road #09-04, Thong Chai Building, Singapore 169874

Contact : +65 8788 5345 | Email Address : admin@ty5group.com.sg

Our Services : Automotive Surveying / Vehicle Valuation  
Motor Claims Investigation / Evaluation & Consultation


Reference : TY5/TA/10001/0233/TP/03.21

Date : 20 March 2021

Vehicle no : SJZ 233P

## ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact of the collision was delivered **Squarely to the Rear** portion of the vehicle.

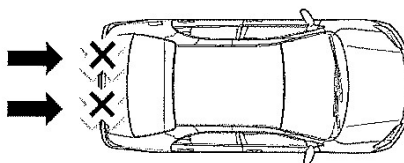

( Please refer to the list and survey photographs as attached for more information )

## ASSESSMENT RECOMMENDATIONS

### COST OF REPAIR

	Repairer S\$	Adjuster S\$
Parts	\$ 10,470.00	\$ 9,112.00
Labour	\$ 3,420.00	\$ 2,890.00
	<u>\$ 13,890.00</u>	<u>\$ 12,002.00</u>

### TY5 Recommendation

Contract Lump Sum of \$ 9,600.00

Estimated Repair Duration : 7 working days  
( excluding Sat, Sun & Public Holidays )

Enclosed No. Of Photograph : 98  
(at the time of static inspection)

Our attached assessment schedule has been checked throughly by us against the actual damages sustained on the vehicle, and we recommend the replacement of parts and repair accordingly. We have adjusted the cost and the repairer has agreed to undertake the repair at the recommended sum to a acceptable quality and standards. We have not given authorization and instruction to the repairer to proceed with the repairs.

The survey was done on a **Without Prejudice Basis** and we are reverting the matter to you for a decision.

We thank you for engaging our services and we enclosed herewith our invoice no. 10001

TY5 CONSULTANCY

TERRENCE HONG

AUTOMOTIVE SURVEYOR

**NOTE :** This revised estimate was from a visual inspection. Should there be any discrepancy or unseen items not listed in this survey, kindly notify the company via email only and follow up with a phone call, within Fourteen ( 14 ) days from the date hereof. Otherwise this revised amount shall be treated as valid.



