



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SFM 8121S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	FRONT BUMPER	SIDES GRAZED / SQUASHED / DEFORMED	627.45	627.45
2	FRONT BUMPER SIDE RETAINER	O/S NOT NECESSARY / N/S NECESSARY	342.50	171.25
2	FRONT BUMPER INNER SIDE FOAM, LH / RH	O/S NOT NECESSARY / N/S DEFORMED	363.80	181.90
1	FRONT BUMPER CENTRE FOAM	CRACKED	191.60	191.60
1	FRONT BUMPER LOWER SPOILER	SCRAPED / DEFORMED	571.70	286.80
1	FRONT BUMPER CENTRE GRILLE	WARPED / LEGS BENT	371.25	279.80
1	LH FRONT KNUCKLE ARM	NOT NECESSARY	571.45	-
1	LH FRONT KNUCKLE ARM BEARING	NOT NECESSARY	371.25	-
1	LH FRONT LOWER ARM	NOT NECESSARY	381.90	-
1	LH FRONT SHOCK ABSORBER	NOT NECESSARY	581.10	-
1	LH FRONT DRIVE SHAFT	NOT NECESSARY	2,721.45	-
1	LH FRONT STABILISER LINK	NOT NECESSARY	271.75	-
1	LH HEADLAMP ASSY	SCRAPED / CASING CRACKED	2,821.10	2,821.10
1	LH HEADLAMP LOWER BRACKET	BENT	171.45	171.45
1	LH FRONT FENDER	TO REPAIR SEE LABOUR	971.25	-
	LESS 25% DISCOUNT		-2,832.75	-1,182.84
			8,498.25	3,548.51
<b><u>SPECIAL NETT ITEMS</u></b>				
1	LH FRONT SPORT RIM (SN)	NOT NECESSARY	750.00	-
1	LH FRONT TYRE (SN)	SERVICEABLE	305.00	-
10	FRONT BUMPER CLIP (SN)	NECESSARY	55.00	30.00
			1,110.00	30.00
<b><u>LABOUR</u></b>				
	TO CHECK WIRING.		40.00	30.00

Report Ref No. CS3/AIG21004802/T1tf3e2-1



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO ALIGN HEADLAMPS AND REFOCUS HEADLAMP BEAMS TO SPECIFICATIONS.		80.00	30.00
	TO APPLY ANTI-RUST UNDERCOAT.		120.00	30.00
	LABOUR CHARGES TO REMOVE AND REPLACE, TO CUT AND WELD, TO PANEL BEATING AFFECTED AND DAMAGED PARTS. INCLUSIVE OF THE REPAIR OF LH FRONT FENDER.		750.00	300.00
	SPRAY PAINTING CHARGES TO PAINT THE FRONT BUMPER, FRONT FENDER AND NECESSARY AREAS.		750.00	400.00
	TO CONDUCT 4-WHEEL COMPUTERISED ALIGNMENT TO REALIGN WHEELS.	NOT NECESSARY	90.00	-
	TO REMOVE AND REPLACE DAMAGED FRONT RIGHT HAND SUSPENSION PARTS.	NOT NECESSARY	600.00	-
			2,430.00	790.00
<b>GRAND TOTAL</b>			<b>12,038.25</b>	<b>4,368.51</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>3,500.00</b>

Report Ref No. CS3/AIG21004802/T1tf3e2-1

MOHAMAD TAUFIKH

M.MATAI, AMSAE-A

Automotive Assessor

ANG BRYAN TANI

Automotive Assessor / Investigator

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.