

PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Mobile: 9061 0543 Email: mirage1195@gmail.com

ACCIDENT VEHICLE INSPECTION REPORT

Report no : 136M0421.PH

Vehicle no : SFM8121S

1 REFERENCE

Date of inspection : 20 April 2021

Requested by : Lim Kim Chai
Blk 289A Bukit Batok St 25
#06-210
Singapore 650289

Type of survey : Independent

Repairer : Paul Hoe Batteries & Motor Services
Blk 1 Kaki Bukit Ave 6, #01-109 AutoBay @ Kaki Bukit, Singapore 417883

Date of accident : 10 April 2021

2 VEHICLE DATA

Make/model : TOYOTA HARRIER PREMIUM 2.0 A

Chassis no : ZSU600063257

Engine no : 3ZRB674142

Date of registration : 12 January 2016 COE Expiry Date: 11 January 2026

Engine capacity : 1986 cc

Odometer reading : 102428 km

Colour : Black

3 STATIC CONDITION CHECK

Steering : Affected

Foot brakes : Serviceable

Hand brakes : Serviceable

Paintwork : Good

General Condition : Good

4 TIRE CONDITION CHECK

	<u>RH/MAKE</u>	<u>LH/MAKE</u>	<u>SIZE</u>
Front tread	: 5 mm/Pirelli	5 mm/Pirelli	235/55R18
Rear tread	: 5 mm/Pirelli	5 mm/Pirelli	235/55R18

5 BRIEF DESCRIPTION OF DAMAGE

Front bumper sides grazed/squashed/deformed, front LH fender bent, LH headlamp scraped/casing cracked, front left hand suspension and undercarriage damaged, etc. Please see para. 8 of this report for more details.

6 REMARKS

This inspection is carried out on a "WITHOUT PREJUDICE" basis and I have not authorized any repairs.

7 RECOMMENDATION

Cost of repairs : **\$8,300.00** (lump sum)

Estimated no of days : **Five (5)**

8 ASSESSMENT OF DAMAGE AND COSTS

Report no: 136M0421.PH
Vehicle no: SFM8121S

A SPARE PARTS

Description	Qty	Assessed Condition	Repairer's Amount	Revised Amount
Front bumper	1	sides grazed/squashed/deformed	627.45	627.45
Front bumper side retainer	2	necessary	Rh Xnn 342.50	Lh nec 342.50 171.25
Front bumper inner side foam, LH/RH	2	mounting knobs broken	Rh Xnn 363.80	Lh de 363.80 181.90
Front bumper centre foam	1	cracked	191.60	191.60
Front bumper lower spoiler	1	scraped/deformed	571.70	571.70 286.80
Front bumper centre grille	1	warped/legs bent	371.25	371.25 279.80
LH front knuckle arm	1	bent/distorted	571.45	571.45 Xnn
LH front knuckle arm bearing	1	cone broken	371.25	371.25 Xnn
LH front lower arm	1	bent	381.90	381.90 Xnn
LH front shock absorber	1	bent	581.10	581.10 Xnn
LH front drive shaft	1	bent/screw tread damaged	2,721.45	2,721.45 Xnn
LH front stabiliser link	1	bent	271.75	271.75 Xnn
LH headlamp assy	1	scraped/casing cracked	2,821.10	2,821.10
LH headlamp lower bracket	1	bent	171.45	171.45
LH front fender	1	to repair	971.25	0.00
		Subtotal of the above	11,331.00	10,359.75 4731.35
		Discount	25% / 25% 2,832.75	2,589.94 3548.51
(Special nett)		Subtotal 1:	8,498.25	7,769.81
LH front sport rim	1	abraded/scraped	750.00	750.00 Xnn
LH front tyre	1	serviceable	305.00	0.00 Xsvc
Front bumper clip	10	necessary	55.00	55.00 30
		Subtotal 2:	1,110.00	805.00 30
		Total cost of parts:	9,608.25	8,574.81

B LABOUR

To check wiring.	40.00	30.00
To align headlamps and refocus headlamp beams to specifications.	80.00	60.00 30
To apply anti-rust undercoat.	120.00	60.00 30
Labour charges to remove and replace, to cut and weld, to panel beating affected and damaged parts.	750.00	500.00 300
Spray painting charges to paint the front bumper, front fender and necessary areas.	750.00	500.00 400
To conduct 4-wheel computerised alignment to realign wheels.	90.00	90.00 Xnn
To remove and replace damaged front right hand suspension parts.	600.00	450.00 Xnn
Total cost of labour:	2,430.00	1,690.00 790
Total cost of repair:	12,038.25	10,264.81

4368.51
I/s\$3500
4 days

Report no: 136M0421.PH

Vehicle no: SFM8121S

9 CONCLUSION

The revised or adjusted cost of repairs to restore the vehicle is

\$10,264.81

(a) However, the recommended cost of repair based on lump sum basis would be

\$8,300.00

(b) The number of days taken to complete the repairs are

Five (5)

(1st re-inspection conducted on 20 April 2021)

(Post Repair Inspection conducted on 23 April 2021)

The above recommendations in my view are fair and reasonable for the restoration of the vehicle to its pre-accident condition.

Note: Lump Sum Repair Basis

This means the repairer is allowed to replace the damaged parts with used, reconditioned or new parts, or repair it to a roadworthy condition.

Yours faithfully



Liaw Leong San

Licensed Automotive Appraiser

Dated: 1 June 2021

PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Mobile: 9061 0543 Email: mirage1195@gmail.com

Lim Kim Chai
Blk 289A Bukit Batok St 25
#06-210
Singapore 650289

Invoice no:	POS0136/21
Date:	1 June 2021
Report no:	136M0421.PH
Vehicle :	SFM8121S

INVOICE

No	Item Description	Qty	Unit Price	Total Amount(\$)
01	Being charges for the inspection of the accident vehicle, transport and photographs.			779.00
SGD(\$): Seven Hundred and Seventy-nine only			Payable Amount:	779.00

"Cheque should be crossed and made payable to "Pro-Option Services"

PRO-OPTION SERVICES



.....
Authorised Signature