

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/AIG21007950/VQF3E2

Date: 17/08/2021

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 2070161202
Claimant Vehicle No : FBC4956B **Insured Vehicle No :** GBF4973K
Date of Loss: 21/07/2021 Nature of Claim: TP Claim No: 7244549488SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **FBC4956B**
Make & Model: YAMAHA T135, 135cc Engine No: 5YP207610
Reg. Date: 01/04/2008 (Man. Year: 2007) Chassis No: 5YP207610
Colour: Blue Odometer: 0 km
Engine Capacity: 135 cc
Market Value/New Car Price: N/A
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 80/80-17 Rear Tyre Size: 80/80-17
Front Left Side: Dunlop 4 mm Rear Left Side: Dunlop 4 mm
Front Right Side: 0 mm Rear Right Side: 0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 27/07/2021
Date Inspected: 27/07/2021 Inspected At: Yp Motorsports Trading (HQ)
Singapore 528836
Estimated Period of Repair: 5.0 days

Adjuster: Thevan Thomas Karthikesavan

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

MARKET VALUE: \$1,500.00 (EST)

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT NUMBER PLATE	Distorted	0.00 F	*- F
2	1		*FRONT TYRE	Scratched	0.00 F	*- F
3	1		*FRONT FENDER WHEEL GUARD	Cut	0.00 F	*- F
4	1		*FRONT FORK ASSY	Bent	0.00 F	*- F
5	1		*FRONT FORK INNER TUBE	Bent	0.00 F	*- F
6	1		*FRONT HEADLAMP RIM	Cut	0.00 F	*- F
7	1		*FRONT HEADLAMP	Cracked	0.00 F	*- F
8	1		*FRONT HEADLAMP BRACKET	Cut	0.00 F	*- F
9	2		*FRONT WING MIRROR	Distorted	0.00 F	*- F
10	1		*HANDLE BAR	Cut	0.00 F	*- F
11	1		*HANDLE BAR GRIP	Cut	0.00 F	*- F
12	1		*HANDLE BAR BALANCER LH	Cut	0.00 F	*- F
13	1		*HANDLE BAR BALANCER RH	Cut	0.00 F	*- F
14	1		*CLUTCH LEVER	Cut	0.00 F	*- F
15	1		*HAND BRAKE LEVER	Cut	0.00 F	*- F
16	1		*SIDE FAIRING	Cut	0.00 F	*- F
17	1		*SIDE FAIRING TOP GARNISH	Cut	0.00 F	*- F
18	1		*SIDE FAIRING INNER GARNISH	Cut	0.00 F	*- F
19	1		*CENTER FAIRING	Distorted	0.00 F	*- F
20	1		*REAR FAIRING	Distorted	0.00 F	*- F

F=Franchise part.

Total Parts (S\$)	0.00	0.00
-------------------	------	------

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >