



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLC 2637S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	CRACKED	1,030.00	697.00
2	FRONT BUMPER RETAINER	SERVICEABLE	140.00	-
1	FRONT BUMPER CHROME MOULDING	CRACKED	267.00	267.00
1	FRONT BUMPER FOG LAMP LH	NOT NECESSARY	310.00	-
1	FRONT BUMPER FOGLAMP COVER	NOT NECESSARY	211.00	-
1	FRONT FENDER LH	DENTED	993.00	653.00
1	FRONT FENDER INNER SHIELD LH	TORN	172.00	127.00
1	FRONT FENDER INNER PROTECTOR LH	SERVICEABLE	55.00	-
1	FRONT HEADLAMP ASSY LH	CRACKED	2,659.00	2,659.00
1	FRONT HEADLAMP BRACKET	NECESSARY	150.00	150.00
1	FRONT SHOCK ABSORBER LH	SERVICEABLE	921.00	-
1	FRONT KNUCKLE ARM LH	BENT	709.00	421.00
1	FRONT KNUCKLE BEARING LH	JAMMED	255.00	255.00
1	FRONT LOWER ARM LH	BENT	591.00	591.00
1	TIE ROD }	BENT	311.00	202.00
1	TIE ROD END }	BENT	293.00	-
1	POWER STEERING RACK AND PINION	SERVICEABLE	3,982.00	-
1	RIM TRIM COVER	GRAZED	110.00	110.00
1	WHEEL HOUSE PANEL LH	DENTED	509.00	509.00
1	SILL PANEL LH	TO REPAIR SEE LABOUR	792.00	-
1	WING MIRROR ASSY LH	NOT NECESSARY	611.00	-
1	BONNET (NPA)	TO REPAIR SEE LABOUR	-	-
1	BONNET ABSORBER LH	SERVICEABLE	121.00	-
1	FRONT DOOR LH (NPA)	TO REPAIR SEE LABOUR	-	-
1	REAR DOOR PANEL LH (NPA)	TO REPAIR SEE LABOUR	-	-
	LESS 20% DISCOUNT		-3,038.40	-1,328.20
			12,153.60	5,312.80

Report Ref No. CS3/ASM20013835/R1qy3e2-1

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	RIM (SN)	GRAZED	800.00	350.00
	LESS 20% DISCOUNT		-160.00	-
			640.00	350.00
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT BUMPER CLIP (SN)	NECESSARY	40.00	30.00
1	SET FRONT FENDER INNER SHIELD CLIP (SN)	NECESSARY	30.00	20.00
1	JOINT SEALANT (SN)	NOT NECESSARY	120.00	-
1	BOT BRAKE FLUID (SN)	NECESSARY	60.00	30.00
			250.00	80.00
	<u>LABOUR</u>			
	CHECK FRONT WIRING AND LIGHTING SYSTEM.		80.00	30.00
	REMOVE, REFIT LINING, TRIM AND GARNISH.	NOT NECESSARY	150.00	-
	COMPUTERISED AND CHECK FRONT WHEEL ALIGNMENT.		150.00	60.00
	REMOVE, RENEW FRONT UNDERCARRIAGE PARTS.		200.00	120.00
	PANEL BEATING AND RENEW DAMAGE PARTS ON AFFECTED AREAS. INCLUSIVE OF THE REPAIR OF SILL PANEL LH, BONNET, FRONT DOOR LH AND REAR DOOR PANEL LH.		1,800.00	600.00
	SPRAY PAINTING ON AFFECTED AREAS.		2,000.00	700.00
	APPLY ANTI RUST ON AFFECTED AREAS.		150.00	40.00
			4,530.00	1,550.00
GRAND TOTAL			17,573.60	7,292.80
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				5,800.00

Report Ref No. CS3/ASM20013835/R1qy3e2-1

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.