

WG APPRAISAL SERVICES

Blk 224B, Compassvale Walk, #07-647.Singapore 542224

Email: Winsongkk@hotmail.com Contact: 9747 0063

Company Register No. 53326249J

Our Ref:	WG/TP/2021-04	Date 06 January 2021
Invoice No:	TP/1ST/2021-04	
Vehicle No:	SLC2637S	
Attn:	ANG TOK SENG	
Company:	1ST MOTOR PRO PTE LTD	
Address:	48 Toh Guan East, #05-139.Enterprise Hub. Singapore 608586	

Invoice

Surveyor Fee:	S\$555
Re-inspection Fee:	S\$80
Transport:	S\$60
Photographs:	S\$80/- (@ \$1 per photo, total 80 photos)
Total:	S\$775

Surveyor:	Winsong Goh
Signature:	
Date:	06 January 2020



WG APPRAISAL SERVICES

Blk 224B, Compassvale Walk, #07-647, Singapore 542224
Email: winsongkk@hotmail.com Contact: 9747 0063
Company Register No. 53326249J

ACCIDENT DAMAGED VEHICLE INSPECTION REPORT

M/S : ANG TOK SENG
C/O 1ST MOTOR PRO PTE LTD
48 Toh Guan East, #05-139
Enterprise Hub, Singapore 608586

Date : 06 January 2021
Our Ref : WG/TP/2021-04

REFERENCE PARTICULARS

Date of Accident : 08 December 2020
Date of Inspection : 10 December 2020

Type of Inspection : Third Party Claim
Date of Re-Inspn : 21 December 2020

VEHICLE PARTICULARS

Registration No : SLC2637S
Make : HYUNDAI
Model : LF SONATA 2.0 GLS A/T
Year : 2016

Engine No : G4NAGA511298
Chassis No : KMHE341CMGA239703
Odometer : 202215km
Colour : Brown

CONDITION OF VEHICLE (STATIC CHECKS AT TIME OF INSPECTION ONLY)

Engine condition : Good
Foot Brake : Serviceable
Hand Brake : Serviceable

General Body Work : Good
Steering : Serviceable
Lightings : Serviceable

TYRE CONDITION (Remaining estimated life of tyre in mm)

	Make	Size
Front Near side	: Yokohama	215/55R17
Front Off Side	: Yokohama	215/55R17
Rear Near Side	: Yokohama	215/55R17
Rear off Side	: Yokohama	215/55R17

Thread Balance
5 mm
5 mm
5 mm
5 mm

GENERAL DESCRIPTION OF DAMAGES

The vehicle sustained damage at the front left portion.
For details, refer to assessment for repairs and photographs attached.

ASSESSMENT SUMMARY

Our assessment of the repair costs to pre-accident condition was **S\$13,300.00** nett at lump sum basis. (Subject to GST if applicable)

Under normal circumstances, estimated period required for repairs : Thirteen (13) working days.

Enclosed Eighty (80) photographs depicting damage to the vehicle.

Inspection conducted at : 1ST MOTOR PRO PTE LTD
48 Toh Guan East, #05-139, Enterprise Hub, Singapore 608586

In accordance to your instruction, we have **not authorise** repairs and inspection was conducted strictly on a "**WITHOUT PREJUDICE BASIS**".

VEHICLE NO :SLC2637S
MODEL NO : LF SONATA 2.0 GLS A/T

Our Ref : WG/TP/2021-04

ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS

DESCRIPTION OF PARTS AND NATURE OF REPAIRS

A)	SPARE PARTS	QTY PC/SET	ASSESSED CONDITION		ORIGINAL QUOTATION	REVISED QUOTATION
01	FRONT BUMPER	1	CRACKED	\$	1,030.00	\$ 1,030.00
02	FRONT BUMPER RETAINER	2	NECESSARY	\$	140.00	\$ 140.00
03	FRONT BUMPER CHROME MOULDING	1	CRACKED	\$	267.00	\$ 267.00
04	FRONT BUMPER FOG LAMP LH	1	NOT NECESSARY	\$	310.00	\$ -
05	FRONT BUMPER FOG LAMP COVER	1	NOT NECESSARY	\$	211.00	\$ -
06	FRONT FENDER LH	1	DENTED	\$	993.00	\$ 993.00
07	FRONT FENDER INNER SHIELD LH	1	TORN	\$	172.00	\$ 172.00
08	FRONT FENDER INNER PROTECTOR LH	1	DEFORMED	\$	55.00	\$ 55.00
09	FRONT HEADLAMP ASSY LH	1	CRACKED	\$	2,659.00	\$ 2,659.00
10	FRONT HEADLAMP BRACKET	1	NECESSARY	\$	150.00	\$ 150.00
11	FRONT SHOCK ABSORBER LH	1	BENT	\$	921.00	\$ 921.00
12	FRONT KNUCKLE ARM LH	1	BENT	\$	709.00	\$ 709.00
13	FRONT KNUCKLE BEARING LH	1	JAMMED	\$	255.00	\$ 255.00
14	FRONT LOWER ARM LH	1	BENT	\$	591.00	\$ 591.00
15	TIE ROD	1	BENT	\$	311.00	\$ 311.00
16	TIE ROD END	1	BENT	\$	293.00	\$ 293.00
17	POWER STEERING RACK AND PINION	1	JAMMED	\$	3,982.00	\$ 3,982.00
18	RIM	1	GRAZED	\$	800.00	\$ 800.00
19	RIM TRIM COVER	1	GRAZED	\$	110.00	\$ 110.00
20	WHEEL HOUSE PANEL LH	1	DENTED	\$	509.00	\$ 509.00
21	SILL PANEL LH	1	DENTED	\$	792.00	\$ 792.00
22	WING MIRROR ASSY LH	1	GRAZED	\$	611.00	\$ 611.00
23	BONNET	1	REPAIR	\$	-	\$ -
24	BONNET ABSORBER LH	1	JAMMED	\$	121.00	\$ 121.00
25	FRONT DOOR LH	1	REPAIR	\$	-	\$ -
26	REAR DOOR PANEL LH	1	REPAIR	\$	-	\$ -
				\$	15,992.00	\$ 15,471.00
				Less 20%	\$ 3,198.40	\$ 3,094.20
				\$	12,793.60	\$ 12,376.80

B)	S/NETT ITEM					
27	FRONT BUMPER CLIP	1 SET	NECESSARY	\$	40.00	\$ 30.00
28	FRONT FENDER INNER SHIELD CLIP	1 SET	NECESSARY	\$	30.00	\$ 20.00
29	JOINT SEALANT	1	NECESSARY	\$	120.00	\$ 100.00
30	BRAKE FULID	1 BOT	NECESSARY	\$	60.00	\$ 50.00
				\$	250.00	\$ 200.00

Parts Total : **\$ 13,043.60** **\$ 12,576.80**

C)	LABOUR CHARGES & MISC					
31	CHECK FRONT WIRING AND LGHTING SYSTEM			\$	80.00	\$ 60.00
32	REMOVE, REFIT LINING, TRIM AND GARNISH			\$	150.00	\$ 120.00
33	COMPUTERISED AND CHECK FRONT WHEEL ALIGNMENT			\$	150.00	\$ 130.00
34	REMOVE, RENEW FRONT UNDERCARRIAGE PARTS			\$	200.00	\$ 180.00
35	PANEL BEATING AND RENEW DAMAGE PARTS ON AFFECTED AREAS			\$	1,800.00	\$ 1,600.00
36	SPRAY PAINTING ON AFFECTED AREAS			\$	2,000.00	\$ 1,800.00
37	APPLY ANTI RUST ON AFFECTED AREAS			\$	150.00	\$ 120.00
				\$	4,530.00	\$ 4,010.00

Labour Total : **\$ 4,530.00** **\$ 4,010.00**

Total Parts and Laboure : **\$ 17,573.60** **\$ 16,586.80**

FINAL LUMP SUM ADJUSTMENT **\$ 13,300.00**

POINT OF IMPACT

The impact was confined to the front left portion of the vehicle.
The damages appeared to be consistent as per the accident report statement.
Please refer the attached schedule and photographs for details.

ADJUSTMENT/RECOMMENDATIONS

We have thoroughly inspected each and every item on the repairer's estimates against the actual damaged found on the vehicle. We have listed the breakdown of our findings and recommendations as per assessment above.

CONCLUSION

The repairer has agreed to undertake repair the vehicle at a lump sum basis of **\$13,300.00 nett** corresponding to replacement of parts, spray painting and labour charges. We now revert for your decision on the above claim.

Yours faithfully
WG APPRAISAL SERVICES

Winson Goh
Automotive Appraiser









































