



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2107499

INV Date 01/11/2021

Reference CC4/LPC21008057/R1gs3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SHB 2293C

Insured Veh. XD 3964T

Claim No. 21/21/21/VC05/024797

Policy No. Z21VC05006982

Accident Date 23/07/2021

Inspection Date 30/07/2021

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC21008057/R1gs3q2 Date: 01/11/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XD 3964T	Veh. Inspected	SHB 2293C	
Policy No.	Z21VC05006982	Coverage (\$)	0.00	
Claim No.	21/21/21/VC05/024797	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	29/07/2021	
2. Vehicle Particulars & Condition				
Make & Model	TOYOTA PRIUS HYBRID 1.8 CVT	c.c	1798	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	JTDKB3FU703534416	Colour	YELLOW	
Odometer	604472 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	195/65 R15	SAILUN	6 mm	
L/H Front Tyre	195/65 R15	SAILUN	6 mm	
R/H Rear Tyre	195/65 R15	SAILUN	6 mm	
L/H Rear Tyre	195/65 R15	SAILUN	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT AND REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	23/07/2021	Inspection Date	30/07/2021	
Survey held at	31 CORPORATION ROAD			
Repairer	DING AUTOMOTIVE PTE LTD			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			14 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 5

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHB 2293C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT LH DOOR PANEL	BENT	1,635.99	1,635.99
1	FRONT LH BLACK OUT TAPE NO.1	NECESSARY	35.96	35.96
1	FRONT LH BLACK OUT TAPE NO.2	NECESSARY	33.86	33.86
1	FRONT LH BLACK OUT TAPE NO.3	NECESSARY	34.52	34.52
1	FRONT LH DOOR GLASS SUB-ASSY	CRACKED	621.70	621.70
1	FRONT LH DOOR WINDOW FRAME REAR MOULDING	NECESSARY	108.67	108.67
1	FRONT LH OUTER DOOR BELT MOULDING ASSY	NECESSARY	163.50	163.50
1	FRONT LH DOOR WINDOW FRAME UPPER MOULDING	NECESSARY	140.60	140.60
1	FRONT LH DOOR WINDOW FRAME FRONT MOULDING	NECESSARY	135.12	135.12
1	FRONT LH DOOR LOCK ASSY	CUT	455.85	455.85
1	FRONT LH OUTER DOOR HANDLE ASSY	SCRATCHED	141.76	141.76
1	FRONT LH OUTER DOOR HANDLE COVER	SCRATCHED	72.47	72.47
1	FRONT LH OUTER DOOR HANDLE FRAME SUB-ASSY	BENT	169.84	169.84
1	SET FRONT LH OUTER DOOR HANDLE PAD	NECESSARY	32.44	32.44
1	FRONT LH DOOR WINDOW REGULATOR SUB-ASSY	SERVICEABLE	285.21	-
1	FRONT LH POWER WINDOW REGULATOR MOTOR ASSY	SERVICEABLE	611.70	-
1	REAR LH DOOR PANEL	BENT	1,635.99	1,635.99
1	REAR LH UPPER DOOR HINGE	BENT	78.34	78.34
1	REAR LH LOWER DOOR HINGE	BENT	78.34	78.34
1	REAR LH DOOR CHECK	SERVICEABLE	171.65	-
1	REAR LH BLACK OUT TAPE NO.1	NECESSARY	35.96	35.96
1	REAR LH BLACK OUT TAPE NO.2	NECESSARY	33.86	33.86
1	REAR LH BLACK OUT TAPE NO.3	NECESSARY	34.52	34.52
1	REAR LH DOOR WINDOW FRAME FRONT MOULDING	NECESSARY	135.12	135.12
1	REAR LH OUTER DOOR BELT MOULDING ASSY	NECESSARY	165.15	165.15
1	REAR LH DOOR WINDOW FRAME UPPER MOULDING	NECESSARY	140.60	140.60
1	REAR LH DOOR WINDOW REGULATOR SUB-ASSY	SERVICEABLE	285.21	-
1	REAR LH POWER WINDOW REGULATOR MOTOR ASSY	SERVICEABLE	623.88	-
1	ROCKER PANEL MOULDING ASSY LH	SERVICEABLE	687.45	-
1	REAR LH QUARTER PANEL SUB-ASSY	TO REPAIR SEE LABOUR	899.43	-

Report Ref No. CC4/LPC21008057/R1gs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT LH SEAT BELT	ACTIVATED	978.80	978.80
1	REAR LH SEAT BELT	ACTIVATED	878.60	878.60
1	ROOF LINNING ASSY	DEFORMED	2,331.20	2,331.20
1	CURTAIN SHIELD AIRBAG LH SUB-ASSY	ACTIVATED	1,456.30	1,456.30
1	FRONT LH DOOR WEATHERSTRIP	NECESSARY	198.85	198.85
1	FRONT LH DOOR REAR LOWER FRAME SUB-ASSY	BENT	98.67	98.67
1	FRONT LH DOOR GLASS RUN	SERVICEABLE	187.30	-
1	LH SIDE DOOR AIR BAG SENSOR	ACTIVATED	379.20	379.20
1	LH SIDE AIR BAG SENSOR ASSY	ACTIVATED	567.80	567.80
1	AIR BAG COMPUTER ASSY	ACTIVATED	1,183.60	1,183.60
1	LH SIDE AIR BAG SENSOR NO.2 ASSY	ACTIVATED	709.30	709.30
1	FRONT LH SEAT AIR BAG ASSY	ACTIVATED	892.20	892.20
1	SET FRONT AIR BAG SENSOR	SERVICEABLE	499.60	-
1	REAR BUMPER COVER	TO REPAIR SEE LABOUR	490.50	-
1	SET REAR AIR BAG SENSOR	SERVICEABLE	567.54	-
1	FRONT RH SEAT BELT	ACTIVATED	978.80	978.80
1	REAR RH SEAT BELT	ACTIVATED	878.60	878.60
1	REAR LH FENDER LINER	SERVICEABLE	163.80	-
1	FRONT LH FENDER QUARTER GARNISH	SERVICEABLE	93.90	-
1	FRONT LH SIDE MIRROR ASSY	SERVICEABLE	1,374.20	-
1	FRONT LH PILLAR GARNISH	SERVICEABLE	283.58	-
1	REAR LH SEAT SIDE GARNISH	CRACKED	279.51	279.51
1	FRONT LH DOOR SCUFF PLATE	SERVICEABLE	113.50	-
1	REAR LH DOOR SCUFF PLATE	CRACKED	113.50	113.50
1	CENTER PILLAR GARNISH LH	SERVICEABLE	167.30	-
1	CENTER PILLAR LOWER GARNISH LH	SERVICEABLE	235.30	-
1	REAR RH DOOR SCUFF PLATE	SERVICEABLE	113.50	-
1	FRONT DRIVER SEAT AIRBAG	SERVICEABLE	890.20	-
1	FRONT LH DOOR TRIM BOARD	SERVICEABLE	877.85	-
1	REAR LH DOOR WEATHERSTRIP	NECESSARY	178.85	178.85
1	FRONT LH DOOR OPENING TRIM WEATHERSTRIP	SERVICEABLE	321.10	-
1	REAR LH DOOR OPENING TRIM WEATHERSTRIP	SERVICEABLE	293.00	-

Report Ref No. CC4/LPC21008057/R1gs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT LH LOWER FRONT DOOR FRAME SUB-ASSY	SERVICEABLE	135.12	-
1	REAR LH DOOR WEATHERSTRIP NO.3	NECESSARY	36.20	36.20
1	REAR RH SEAT SIDE GARNISH	SERVICEABLE	279.51	-
1	FRONT RH SEAT BACK PAD	SERVICEABLE	321.40	-
1	FRONT RH SEAT BACK COVER	SERVICEABLE	1,292.20	-
1	FRONT RH SEAT CUSHION COVER	SERVICEABLE	884.50	-
1	FRONT RH SEAT CUSHION PAD	SERVICEABLE	321.40	-
1	FRONT LH SEAT CUSHION COVER	SERVICEABLE	884.50	-
1	FRONT RH SEAT CUSHION PAD	SERVICEABLE	489.90	-
1	FRONT LH SEAT BACK COVER	TORN	1,292.20	1,292.20
1	FRONT LH SEAT BACK PAD	TORN	321.40	321.40
1	REAR RH SEAT BACK COVER	SERVICEABLE	1,140.10	-
1	REAR RH SEAT BACK PAD	SERVICEABLE	284.00	-
1	REAR LH SEAT BACK COVER	SERVICEABLE	822.30	-
1	REAR LH SEAT BACK PAD	SERVICEABLE	233.70	-
1	REAR SEAT CUSHION PAD (NPA)	SERVICEABLE	-	-
1	REAR SEAT CUSHION COVER (NPA)	SERVICEABLE	-	-
1	OUTER LH BODY CENTER PILLAR	BENT	332.60	332.60
1	CENTER PILLAR REINFORCEMENT LH SUB-ASSY (NPA)	SERVICEABLE	-	-
1	OUTER LH ROCKER REINFORCE SUB-ASSY (NPA)	SERVICEABLE	-	-
1	LOWER LH CENTER BODY PILLAR REINFORCE SUB-ASSY (NPA)	SERVICEABLE	-	-
1	ROCKER PANEL REINFORCEMENT LH SUB-ASSY (NPA)	SERVICEABLE	-	-
1	FRONT SEAT VERTICAL ADJUSTER ASSY (SEAT SLIDE POSITION SENSOR)	SERVICEABLE	315.90	-
	LESS 25% DISCOUNT		-9,461.89	-5,051.59
			28,385.68	15,154.75
1	REAR LH WHEEL RIM (LOCAL REPAIR)	NECESSARY	1,555.60	120.00
	LESS 25% DISCOUNT		-388.90	-
			1,166.70	120.00
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT DOOR 'COMFORT DELGRO' STICKER (SN)	NECESSARY	140.00	80.00

Report Ref No. CC4/LPC21008057/R1gs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR DOOR 'GOOGLE PLAY STORE' 'APP STORE' STICKER (SN)	NECESSARY	140.00	80.00
1	REAR DOOR 'COMFORT DELGRO' STICKER (SN)	NECESSARY	140.00	80.00
1	ROCKER PANEL MOULDING CLIP (SN)	NOT NECESSARY	65.00	-
1	ROCKER PANEL MOULDING ADVERTISEMENT STICKER (SN)	NECESSARY	250.00	80.00
1	FRONT LH DOOR PANEL ADVERTISEMENT STICKER (SN)	NECESSARY	250.00	150.00
1	REAR LH DOOR PANEL ADVERTISEMENT STICKER (SN)	NECESSARY	250.00	150.00
1	REAR LH QUARTER PANEL ADVERTISEMENT STICKER (SN)	NECESSARY	250.00	150.00
1	SET DOOR MOULDING CLIP (SN)	NOT NECESSARY	55.00	-
1	REAR BUMPER ADVERTISEMENT STICKER (SN)	NECESSARY	250.00	150.00
1	SET REAR BUMPER CLIP (SN)	NOT NECESSARY	65.00	-
1	SET REAR FENDER LINER CLIP (SN)	NOT NECESSARY	60.00	-
			1,915.00	920.00
	<u>LABOUR</u>			
	TO STRAIGHTEN AND PANEL BEAT OF ACCIDENT AREA.INCLUSIVE OF THE REPAIR OF REAR LH QUARTER PANEL SUB-ASSY,REAR BUMPER COVER AND REAR LH WHEEL RIM .		1,800.00	1,000.00
	TO RUST PROOFING OF THE AFFECTED AREA.		170.00	100.00
	TO REMOVE AND REFIT OF NECESSARY ITEMS TO FACILITATE REPAIR.		450.00	200.00
	TO TRANSFER FRONT AND REAR DOOR MECHANISM TO NEW DOOR AND PERFORM WATER SEEPAGE TEST .		300.00	120.00
	TO DIAGNOSTIC ,CHECK WIRING AND LIGHTING SYSTEM AND CLEAR FAULT CODE.		400.00	200.00
	TO CHECK AND REPAIR WIRE HARNESS.		250.00	100.00
	TO VACUUM GLASS SHARD AND WASH CARPET ,FRONT SEAT.		200.00	30.00
	TO RESPRAY FRONT DOOR PANEL .		250.00	200.00
	TO RESPRAY REAR DOOR PANEL .		250.00	200.00
	TO RESPRAY ROCKER PANEL MOULDING ASSY .	NOT NECESSARY	250.00	-
	TO RESPRAY QUARTER PANEL .		250.00	200.00
	TO RESPRAY ROCKER PANEL.	NOT NECESSARY	250.00	-
	TO RESPRAY REAR BUMPER .		250.00	200.00

Report Ref No. CC4/LPC21008057/R1gs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 5

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE AND REFIT ROOF LINING,SEAT BELT ,DASHBOARD AND OTHER NECESSARY COMPONENTS TO FACILITATE BODYWORK REPAIR.		350.00	150.00
	TO CONDUCT TYRE BALANCING AND WHEEL ALIGNMENT.		160.00	60.00
	TO REMOVE AND REFIT SEAT CUSHION TO REPLACE SEAT AIRBAG REPLACE TORN COVER AND PAD.		350.00	120.00
	TO RESPRAY CENTER PILLAR .		250.00	200.00
	TO RESPRAY ROCKER PANEL REINFORCEMENT .	NOT NECESSARY	250.00	-
	TO RESPRAY CENTER PILLAR REINFORCEMENT .	NOT NECESSARY	250.00	-
			6,680.00	3,080.00
GRAND TOTAL			38,147.38	19,274.75
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				15,400.00

Report Ref No. CC4/LPC21008057/R1gs3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 2293C

INSPECTION

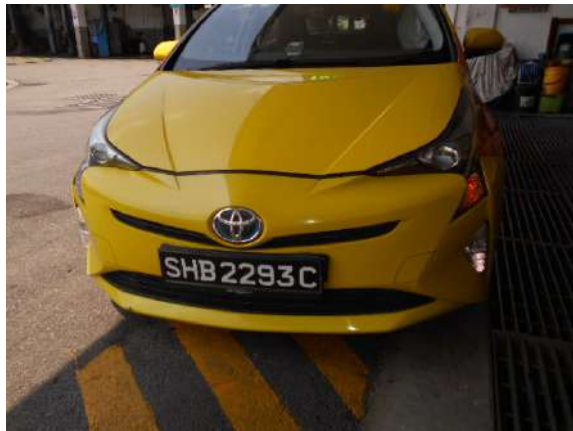




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

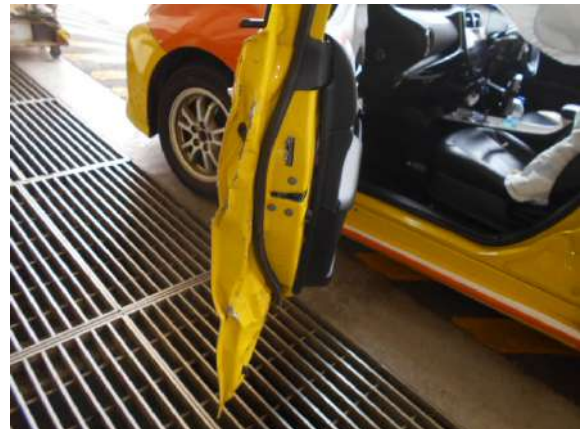




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

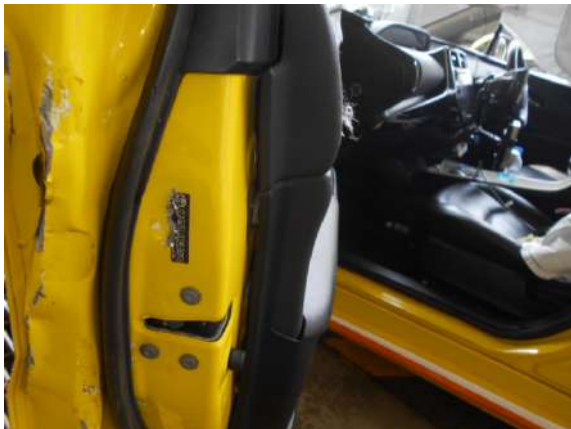



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R








LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

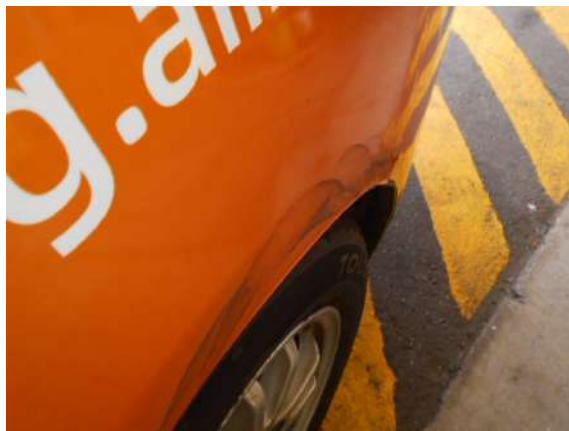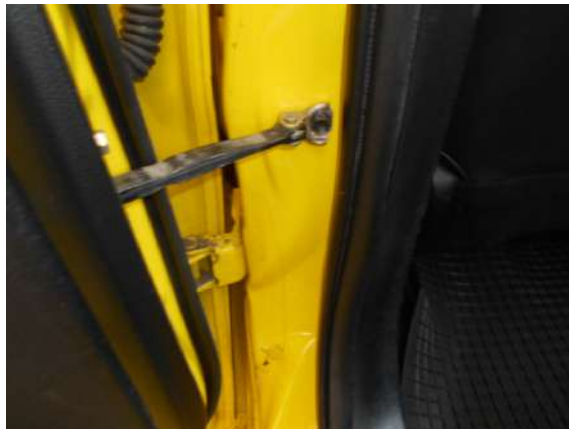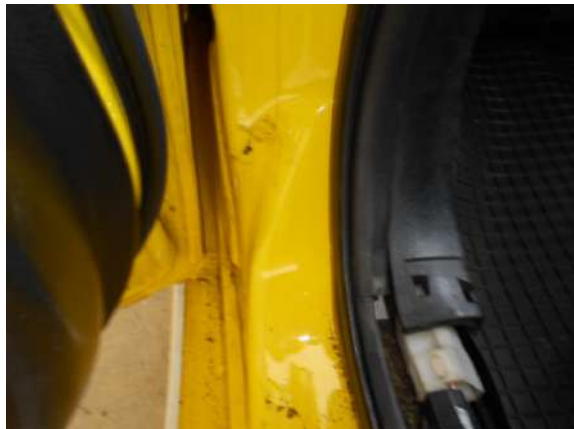



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

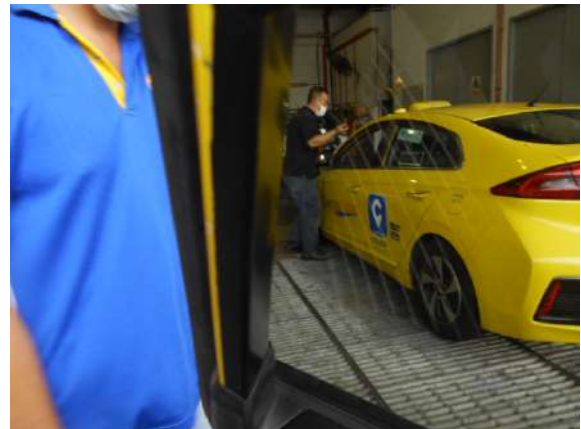




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

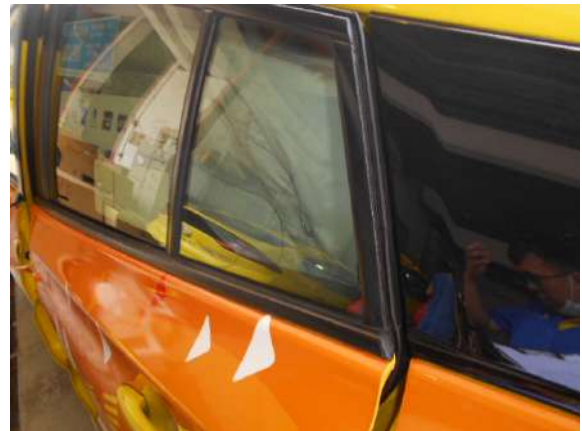



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315


Reg. No: 199607198R GST Reg. No. 19-9607198-R

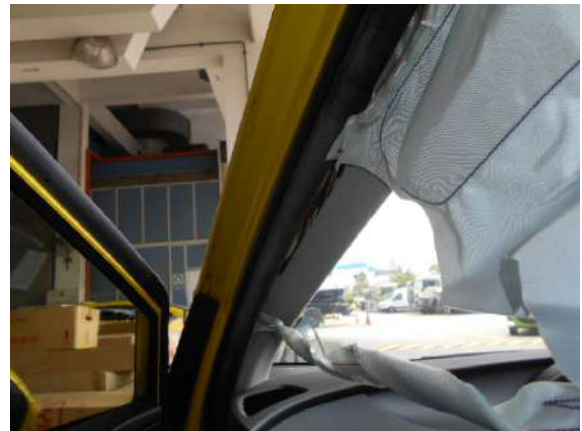



TEL: 6256 3561 FAX: 6256 4315

A close-up photograph showing a person's finger pressing a button on a black plastic control panel. The button is rectangular and has a textured, slightly worn surface. The panel features several horizontal ridges and other buttons, suggesting it is part of a larger control system. The lighting is focused on the finger and the button being pressed.

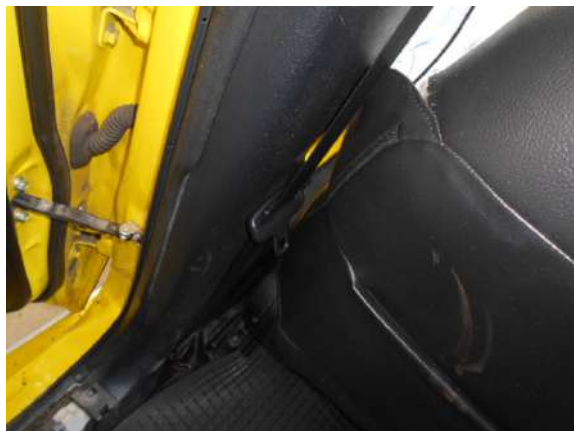



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHB 2293C

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

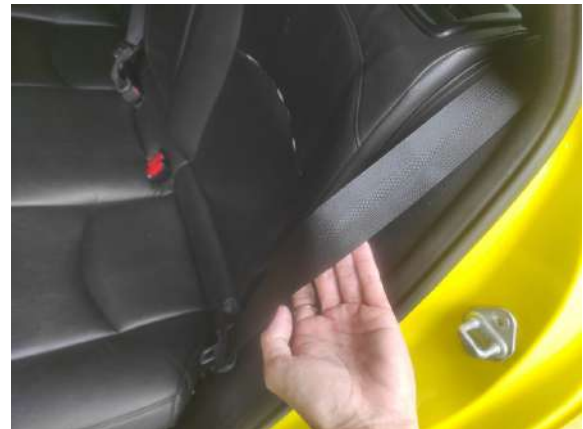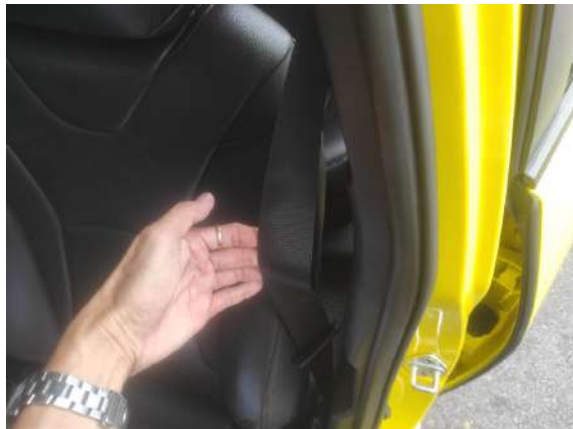



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

