1/17/22, 9:14 AM Adjuster Report

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC4/III21008080/KEA3Q2

Date: 17/01/2022

REFERENCE

Handling Insurer: India International Insurance Pte Ltd Policy No: D20MFL0003256_01

Claimant Vehicle SMJ3841M Insured Vehicle No: PC6179Z

Date of Loss: 29/07/2021 Nature of Claim: TP Claim No: MFL2021D0003313

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SMJ3841M

Make & Model: TOYOTA COROLLA ALTIS, 1.6 Standard (A) Engine No: 1ZR0D08147

Reg. Date: 01/03/2019 (Man. Year: 2019) Chassis No: MR053REH604596015

Colour: Metallic Grey Odometer: 23443 km

Engine Capacity: 1598 cc Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/55 R16 Rear Tyre Size: 205/55 R16
Front Left Side: Yokohama 6 mm
Front Right Side: Yokohama 6 mm
Rear Right Side: Yokohama 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS		Repairer's	Adjuster's	Difference	Diff %
Parts		1,776.13	999.07	777.06	43.75
Miscellaneous Items		11.00	11.00	0.00	0.00
Labour		280.00	240.00	40.00	14.29
Paintwork Labour		0.00	0.00	0.00	
Towing		0.00	0.00	0.00	
	Gross Total (S\$)	2,067.13	1,250.07	817.06	39.53
	+ GST 7.00/7.00% (S\$)	144.70	87.50	57.20	39.53
	Nett Amount (S\$)	2,211.83	1,337.57	874.26	39.53
	+ Loss of Use (3.0 x	S\$60.00/day) (S\$)	180.00		
	+ Do	c/Search Fee (S\$)	7.45		
		Nett Liability (S\$)	1,525.02		
	Global Su	m Settlement (S\$)	1,520.00		

INSPECTION

Date of Assignment: 30/07/2021 Present Location: City Auto Pte Ltd (HQ)

City Auto Pte Ltd (HQ)

Date Inspected: 30/07/2021 Inspected At: 160 Sin Ming Drive #05-01,, Sin Ming AutoCity,

Singapore 575722

Estimated Period of Repair: 2.0 days

Adjuster: KENNETH KONG Manager: Asher Sng Rong Yi

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

	•			
-	\sim \pm	0r	\sim \sim	\sim
~ .	_,,,			
,	_	\sim 1	C I I	ce

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 17 Jan 2022)

Parts: 143 TOYOTA COROLLA ALTIS 1.6 Standard (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SMJ3841M)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with

the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*RH wing mirror	Cracked	1,257.00 F	*1,168.20 FL
2	1		*RH wing mirror cover	Missing	109.20 F	*109.20 FL
3	1		*Indicator lamp RH	Missing	54.70 F	*54.70 FL
F=Fra	anchise	part. L=ListItemD	isc.			
				Sub Total (S\$)	1,420.90	1,332.10
			- List Item Discount	on L Items 0.00/25.00% (S\$)	0.00	333.03
			+ Margin or	n L,N Items 25.00/0.00% (S\$)	355.23	0.00
				Total Parts (S\$)	1,776.13	999.07

Recommended Miscellaneous Items

No Qty Partic	ulars		Repairer's	Amount
Miscellaneous It	<u>ems</u>			
1 1 OD/T	Case (Insurer)		11.00	11.00
		Sub Total (S\$)	11.00	11.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Lab</u>	<u>our Items</u>			
1	- To remove and install side mirror	New	80.00	60.00
2	- To spray painting	New	200.00	180.00
		Gross Labour Cost (S\$)	280.00	240.00
	Report wa	as unsubmitted during this print-out.		

< END OF ESTIMATES >