Jin Auto Services Pte Ltd #01-410/412, 14 Defu Lane 10 539195

Insurer Reference: SJJ6766M Repairer Reference: 042614

Repairer Reference: 042614 Registration: SJJ6766M Date calculated: 02/08/2021 11:08 AM Printed: 02/08/2021 11:09 AM

Summary Information

Claim

Location: Singapore (SG) Work Provider: China Taiping Insurance

(Singapore) Pte Ltd

Full Report

Printed by: JOUIS SEOW Currency: SGD
Claim Reference: SJJ6766M Date of Incident: 30/07/21

Estimated Repair Time: Hire Car Start: Actual Repair Days: Hire Car End:

Vehicle Details

Vehicle

Manufacturer: HYUNDAI Model: AVANTE (HD)

Sub Model: BASIS
Model Sheet Number: 30 22 50
Registration: SJJ6766M

VIN number: KMHDU41BMAU963523

Odometer:

Model Specs

AIR CONDITIONING 1.6 LTR 90 KW 4-SPEED AUTOMATIC


Vehicle Condition

Vehicle Status

Pre-Accident Damage: Date of Inspection:

Damage Areas

All	
Underbody	

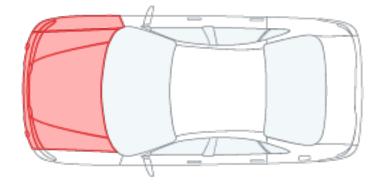

Tyres Condition

Tyre Brand Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Outer),

mm mm mm mm Middle), mm

Spare Tyre Brand

Tread (Spare), mm

Labour

	Time Base 10 WU/h	Price = 42.	Price = 42.00 SGD/h		
Code	Description	WU	Price SGD		
86510R00	RENEW COMPLETE FRONT BUMPER INCLUDES: FRONT BUMPER, FRONT BUMPER REINFORCEMENT AND REQUIRED ATTACHED PARTS R + R AND IF NECESSARY RENEW.	6.0	25.20		
92000R0B	REMOVE/REFIT BOTH HEADLIGHT UNITS INCLUDES: SET HEADLIGHT BEAMS	3.0	12.60		
66300R5A	R + R RIGHT FRONT WING	7.0	29.40		
NO NUMBER	R + R RIGHT FRONT WING BADGE	2.0	8.40		
NO NUMBER	R + R FRONT PANEL	20.0	84.00		
97606R00	R + R AIR CONDITIONING CONDENSER	10.0	42.00		
25300R00)	R + R RADIATOR INCLUDES: R + R COMPLETE RADIATOR SHROUD	7.0	29.40		
25300RA4	ADD/WORK FOR AUTOMATIC GEARBOX	1.0	4.20		
NO NUMBER	DRAIN/REFILL COOLING SYSTEM	3.0	12.60		
09760A00	DRAIN + REFILL AIR CONDITIONING	5.0	21.00		
0471	BONNET REPAIR	30.0*	126.00		

	Total of Labour					394.80
Paint						
Paint Work		SYSTEM AZ	<u> </u>	Tim	ne Basis	10 WU/h
Code	Description				WU	Price SGD
	R/F WING NEW PART PAINT	ING			9.0	
	FRONT BUMPER NEW PART				22.0	
	BONNET REPAIR PAINTING	>50%			35.0	
Paint Material	Per Part					
Code	Description					Price SGD
0742	R/F WING NEW PART PAINT	ING				14.11
0283	FRONT BUMPER NEW PART					72.77
0471	BONNET REPAIR PAINTING					48.79
	Labour Cost - Paint Factor		42.00 SGD/h	Hrs	WU	Price SGD
	Time Paint		42.00 SGD/ II		66.0	
	Preparation Main Work Meta	I		1.70	17.0	71.40
	Preparation Comp. Work Pla			0.60	6.0	25.20
	Total		10 WU/h	8.90	89.0	373.80
	Material Cost - Paint					Price SGD
	New Part Painting					14.11
	New Part Painting - Plastic k	(1G/PUR				72.77
	Repair Painting	,				48.79
	Material-constant Metal					18.10
	Material-constant Plastic					12.70
	Total					166.47
Spare Parts						0015 06 01
Code	Description	Part Number	Part Source	prices	as at 4	2015-06-01 Price SGD
0283	FRONT BUMPER	865112H000	Original			280.00
0315	FRT BUMPER ABSORBER		Original			70.00
0322	R/BUMPER MNTG REINF	865142H000	Original			20.00
0340	FRT BUMPER SUPPORT	865302H010	Original			140.00
0562	RIGHT HEADLAMP ASSY		Original			300.00
0742	R/F WING	663212H022	Original			250.00
0812	R/F WING BADGE	863162H000	Original			30.00
1009	INNER FRT PANEL CPL	641012H000	Original			480.00
f: OEM Parts	Savings					0.00
n: Non-OEM Parts						1,570.00
u: Used parts	Fixed Sundry Parts I	Price				100.00

Fixed Sundry Parts Price

Labour Cost

Panel / Mechanical Labour

100.00

WU

94.0

394.80

Hrs 9.40 Total 1,670.00

Final Calculation

	SGD	SGD
Parts	1,570.00	
Fixed Sundry Parts Price	100.00	
Total Parts		1,670.00
Labour Time Base 10 WU/h		
Total 94.0 WU X 42.00 SGD/h	394.80	
Total of Labour		394.80
Paint Work Time Base 10 WU/h		
Labour Cost 89.0 WU X 42.00 SGD/h	373.80	
Material Cost	166.47	
Total Paint Including Material		540.27
Repair Cost Excludes GST		2,605.07
GST (+7.00%)		182.35
Repair Cost Included GST		2,787.42

Comments

* - USER SUPPLIED DATA NN - NO MANUFACTURERS CODE EXISTS) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.