

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CC3/AIG21008200/AQCE2

Date: 23/05/2022

REFERENCE

Insured/Claimant:	ONG BOON CHONG	Policy No:	7210029521	
Date of Loss:	02/08/2021	Nature of Claim:	OD	Claim No: 0630352254SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMH9997T		
Make & Model:	AUDI A5 SPORTBACK, 2.0 TFSI QUATTRO (A)	Engine No:	DEM031017
Reg. Date:	24/03/2021 (Man. Year: 2021)	Chassis No:	WAUZZZF5XMA033251
Colour:	Black	Odometer:	5169 km
Engine Capacity:	1984 cc		
Market Value/New Car Price:	S\$190,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	255/35 R19	Rear Tyre Size:	255/35 R19
Front Left Side:	Pirelli 6 mm	Rear Left Side:	Pirelli 6 mm
Front Right Side:	Pirelli 6 mm	Rear Right Side:	Pirelli 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	53,697.00	14,053.68	39,643.32	73.83
Miscellaneous Items	0.00	0.00	0.00	
Labour	30,864.00	18,459.00	12,405.00	40.19
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	84,561.00	32,512.68	52,048.32	61.55
- Excess (S\$)	800.00	800.00	0.00	0.00
(S\$)	83,761.00	31,712.68	52,048.32	62.14
+ GST 7.00/7.00% (S\$)	5,863.27	2,219.89	3,643.38	62.14
Nett Amount (S\$)	89,624.27	33,932.57	55,691.70	62.14

INSPECTION

Date of Assignment:	04/08/2021		
Date Inspected:	03/08/2021	Inspected At:	24 Benoi Sector Singapore 629857 Repairer: Premium Automobiles Pte Ltd
Estimated Period of Repair:	14.0 days		

Adjuster: ADRIAN LING

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
1	1	*FRONT BUMPER	Not Necessary	2,342.00 FS	*- FS
2	2	*FRONT BUMPER SECURING STRIP	Not Necessary	71.00 FS	*- FS
3	1	*FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE	Not Necessary	262.00 FS	*- FS
4	1	*FRONT BUMPER AIR GUIDE - RH	Not Necessary	63.00 FS	*- FS
5	1	*FRONT BUMPER AIR GUIDE GRILLE - RH	Not Necessary	135.00 FS	*- FS
6	1	*FRONT BUMPER TRIM - RH	Not Necessary	48.00 FS	*- FS
7	1	*FRONT BUMPER GUIDE SECTION - RH	Not Necessary	36.00 FS	*- FS
8	1	*FRONT FENDER - RH	Dented	1,060.00 FS	*848.00 FS
9	1	*FRONT FENDER ATTACHMENT PARTS - RH	Not Necessary	53.00 FS	*- FS
10	1	*FRONT FENDER CLOSING ELEMENT - RH	Not Necessary	74.00 FS	*- FS
11	1	*FRONT FENDER BRACKET - RH	Not Necessary	35.00 FS	*- FS
12	1	*FRONT FENDER BRACE - RH	Not Necessary	118.00 FS	*- FS
13	1	*FRONT FENDER CLOSING ELEMENT - RH	Not Necessary	33.00 FS	*- FS
14	1	*FRONT FENDER CHROME TRIM - RH	Cut	164.00 FS	*130.80 FS
15	1	*FRONT WHEEL HOUSING LINER - RH	Deformed	275.00 FS	*219.60 FS
16	1	*FRONT WHEEL HOUSING LINER ATTACHMENT PARTS - RH	Not Necessary	169.00 FS	*- FS
17	1	*FRONT FENDER FLEDGE COVER - RH LONG	Not Necessary	36.00 FS	*- FS
18	1	*FRONT FENDER FLEDGE COVER - RH SHORT	Not Necessary	16.00 FS	*- FS
19	1	*LED HEADLIGHT - RH	Not Necessary	7,685.00 FS	*- FS
20	1	*BONNET	Repair	3,312.00 FS	*- FS
21	1	*BONNET ATTACHMENT PARTS	Not Necessary	123.00 FS	*- FS
22	1	*BONNET IMPACT PROTECTION - CENTER	Not Necessary	28.00 FS	*- FS
23	2	*BONNET IMPACT PROTECTION - LH / RH	Not Necessary	56.00 FS	*- FS
24	1	*SECTIONAL PANEL - A/B PILLAR	Dented	2,179.00 FS	*1,743.20 FS
25	1	*CHASSIS DATA TAG	Necessary	462.00 FS	*369.60 FS
26	1	*SILL TRIM STRIP - RH	Necessary	120.00 FS	*96.00 FS
27	1	*FRONT DOOR - RH	Distorted	3,884.00 FS	*3,107.20 FS
28	1	*FRONT DOOR OUTER SEAL - RH	Necessary	222.00 FS	*177.60 FS
29	1	*BONDING AGENT	Not Necessary	49.00 FS	*- FS
30	1	*CLEANING SOLUTION	Not Necessary	68.00 FS	*- FS
31	1	*APPLICATOR	Not Necessary	8.00 FS	*- FS
32	1	*FRONT DOOR CATCH - RH	Not Necessary	120.00 FS	*- FS
33	1	*FRONT DOOR HINGE HALF - UPPER PART, RH UPPER	Bent	44.00 FS	*34.48 FS
34	1	*FRONT DOOR HINGE HALF - LOWER PART, RH UPPER	Bent	45.00 FS	*35.52 FS
35	1	*FRONT DOOR HINGE HALF - UPPER PART, RH LOWER	Bent	47.00 FS	*37.60 FS
36	1	*FRONT DOOR HINGE HALF - LOWER PART, RH LOWER	Bent	45.00 FS	*35.84 FS
37	1	*FRONT DOOR SEAL, INNER - RH	Not Necessary	589.00 FS	*- FS
38	1	*FRONT WING MIRROR MOUNTING - RH	Cracked	1,826.00 FS	*1,460.80 FS
39	1	*FRONT WING MIRROR CAP - RH	Missing	289.00 FS	*231.20 FS
40	1	*FRONT WING MIRROR GLASS - RH	Not Necessary	1,667.00 F	*- F
41	1	*DATA PLATE FOR TYRE PRESSURE	Necessary	37.00 FS	*29.04 FS
42	1	*FRONT DOOR CHROME TRIM - RH	Necessary	164.00 FS	*130.80 FS
43	1	*ROOF MOULDING, CHROME - RH	Not Necessary	629.00 FS	*- FS
44	1	*WATER DEFLECTOR STRIP - RH	Not Necessary	67.00 FS	*- FS
45	1	*FRONT WINDOW SLOT SEAL CHROME TRIM - RH	Not Necessary	399.00 FS	*- FS
46	1	*FRONT WINDOW CORNER TRIM - RH	Cut	46.00 FS	*36.24 FS
47	1	*FRONT DOOR WINDOW - RH	Not Necessary	290.00 FS	*- FS
48	1	*FRONT WINDOW APERTURE SEAL - RH INNER	Not Necessary	407.00 FS	*- FS
49	1	*FRONT WINDOW REGULATOR - RH	Not Necessary	368.00 FS	*- FS
50	1	*FRONT WINDOW REGULATOR MOTOR - RH	Not Necessary	331.00 FS	*- FS
51	1	*FRONT DOOR WIRING SET - RH	Not Necessary	577.00 FS	*- FS
52	1	*SIDE MEMBER TRIM - RH	Deformed	869.00 FS	*695.20 FS
53	1	*SIDE MEMBER TRIM ATTACHMENT PARTS - RH	Necessary	130.00 FS	*104.00 FS
54	1	*SIDE MEMBER TRIM ADHESIVE TAPE - RH	Necessary	212.00 FS	*169.60 FS
55	1	*STONE CHIP GUARD - RH	Deformed	51.00 FS	*40.32 FS

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
56	1	*SILL PANEL TRIM BRACKET - RH	Cracked	24.00 FS	*18.80 FS
57	1	*UNDERBODY TRIM - RH	Not Necessary	323.00 FS	*- FS
58	1	*UNDERBODY TRIM - RH FRONT	Not Necessary	43.00 FS	*- FS
59	1	*FRONT SUBFRAME	Not Necessary	1,891.00 FS	*- FS
60	1	*FRONT LOWER ARM - RH	Bent	539.00 FS	*430.80 FS
61	1	*FRONT SUSPENSION GUIDE - RH	Bent	9,743.00 FS	*754.40 FS
62	1	*FRONT UPPER ARM - RH FRONT	Not Necessary	512.00 FS	*- FS
63	1	*FRONT UPPER ARM - RH REAR	Not Necessary	512.00 FS	*- FS
64	1	*FRONT WHEEL BEARING HOUSING - RH	Damaged	967.00 FS	*774.00 FS
65	1	*FRONT LOWER ARM BALLJOINT - RH	Bent	193.00 FS	*154.40 FS
66	1	*FRONT WHEEL HUB - RH	Damaged	479.00 FS	*383.20 FS
67	1	*FRONT WHEEL BEARING - RH	Damaged	246.00 FS	*196.80 FS
68	1	*FRONT SUSPENSION FORK - RH	Not Necessary	264.00 FS	*- FS
69	1	*FRONT COUPLING ROD - RH	Not Necessary	127.00 FS	*- FS
70	1	*FRONT ANTI ROLL BAR	Not Necessary	433.00 FS	*- FS
71	1	*FRONT DRIVESHAFT - RH	Not Necessary	2,650.00 FS	*- FS
72	1	*FRONT SHOCK ABSORBER - RH	Not Necessary	310.00 FS	*- FS
73	1	*FRONT TIE ROD - RH	Bent	99.00 FS	*78.88 FS
74	1	*FRONT TIE ROD END - RH	Bent	197.00 FS	*157.20 FS
75	1	*ACRYLIC SEALANT	Necessary	180.00 FS	*180.00 FS
76	1	*CAVITY WAX	Necessary	140.00 FS	*140.00 FS
77	1	*STONE CHIP	Necessary	180.00 FS	*180.00 FS
78	1	*METAL FILLER POWDER	Necessary	280.00 FS	*280.00 FS
79	1	*FRONT RHS RIM (NPA)	Not Necessary	0.00 FS	*- FS
80	1	*FRONT RHS TYRE	Deformed	430.00 FS	*430.00 FS
81	1	*SUNDRIES	Necessary	500.00 FS	*162.56 FS

F=Franchise part. S=SpcNett.

Total Parts (S\$) 53,697.00 14,053.68

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE, CHECK AND REINSTALL FRONT WIRE HARNESS FOR HEADLIGHTS HORNS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID	New	480.00	0.00
2	TO REMOVE AND TRANSFER RHS HEADLIGHTS CONTROL UNIT AND POWER MODULE	New	400.00	0.00
3	TO REMOVE AND REINSTALL CENTER CONSOLE AND DASHBOARD ASSY FOR A-PILLAR RENEWAL. INSPECT FOR DAMAGES	New	3,200.00	3,200.00
4	TO REMOVE AND REINSTALL RHS FRONT SEAT ASSY, ABCD PILLAR TRIMS, SILL TRIMS, CARPETS, ELECTRONIC COMPONENTS AND FUSE TRAYS	New	1,800.00	1,800.00
5	TO REMOVE AND TRANSFER RHS FRONT DOORS MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES. INSPECT FOR DAMAGES	New	400.00	280.00
6	TO INSTALL SOLAR FILM FOR RHS FRONT DOOR WINDOW GLASS	New	400.00	0.00
7	TO DISMANTLE AND RENEW FRONT BUMPER, RHS FRONT FENDER, BONNET, RHS FRONT DOOR, RHS SILL PANEL TRIM AND RHS HEADLIGHT. TO CUT OUT AND WELD RHS A-PILLAR AND RHS SILL PANEL. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	8,800.00	3,500.00
8	TO RESPRAY FRONT BUMPER, RHS FRONT FENDER, BONNET, RHS A-PILLAR, RHS SILL PANEL, RHS SILL PANEL TRIM, DOOR ENTRANCE, RHS FRONT DOOR, HINGES, RHS WING MIRROR COVER AND RHS REAR DOOR	New	8,600.00	3,175.00
9	TO TOW BACK THE VEHICLE FROM ACCIDENT SCENE	New	280.00	0.00
10	TO RENEW RHS FRONT WHEEL SUSPENSION ASSY WITH SUBFRAME	New	2,400.00	2,400.00
11	TO CARRY OUT FIRST MEASUREMENT ON CAR-O-LINER	New	800.00	800.00
12	TO PUT ON THE VEHICLE ON CAR-O-LINER TO FACILITATE THE REPAIR	New	2,400.00	2,400.00
13	TO RENEW RHS FRONT RIM WITH TYRE. TO CARRY OUT PRE/POST WHEEL ALIGNMENT	New	520.00	520.00
14	TO CARRY OUT PRE/POST DIAGNOSTIC CHECK	New	384.00	384.00
Gross Labour Cost (\$\$)			30,864.00	18,459.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >