

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/AIG21008219/EQF3E2

Date: 13/08/2021

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd.

Policy No:

Claimant Vehicle No : YM6766U

Insured Vehicle No : YN7672U

Date of Loss: 14/07/2021

Nature of Claim: TP

Claim No: 5680756042SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **YM6766U**

Make & Model: HINO GH8JRKA, 7.7 D (M)

Engine No: J08EUB10360

Reg. Date: 11/07/2007 (Man. Year: 2007)

Chassis No: GH8JRK10126

Colour: White

Odometer: 452235 km

Engine Capacity: 7684 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable):

Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification:

No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 10.00-20

Rear Tyre Size: 10.00-20

Front Left Side: Fleet Master 4 mm

Rear Left Side: Fleet Master 4 mm

Front Right Side: Fleet Master 4 mm

Rear Right Side: Fleet Master 4 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 04/08/2021

Date Inspected: 10/08/2021

Inspected At:

Victor's Garage (HQ)
5 Soon Lee Street
#03-18 Pioneer Point
Singapore 627607

Estimated Period of Repair: 4.0 days

Adjuster: CHEN TSUE YEE

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

MARKET VALUE: \$60,000.00 (EST)

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT BUMPER	Dented	0.00 F	*- F
2	1		*FRT BUMPER BRACKET	Bent	0.00 F	*- F
3	1		*FRT GRILLE	Cut	0.00 F	*- F
4	1		*FRT GRILLE EMBLEM	Necessary	0.00 F	*- F
5	1		*FRT PANEL	Dented	0.00 F	*- F
6	2		*FRT PANEL HINGE	Bent	0.00 F	*- F
7	1		*FRT SIGNAL LAMP RH	* Check	0.00 F	*- F
8	1		*FRT RH HEADLAMP ASSY	Cut	0.00 F	*- F
9	1		*BRAKE FLUID TANK	Crushed	0.00 F	*- F
F=Franchise part.						
Total Parts (S\$)					0.00	0.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >