



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2202328

INV Date 22/04/2022

Reference CS/LPC20011005/Kea3q2-1

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. GBG 4204S
Insured Veh. GBK 2375Z
Claim No. 20/20/20/VC00/023754
Policy No. Z/20/8VC00/106632
Accident Date 08/10/2020
Inspection Date 12/10/2020

Description	Total
Third Party Express Settlement	400.00
Less:AC2105524 DD 05/08/2021	-350.00
Subtotal	50.00
GST (7%)	3.50
Grand Total	53.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSE SINGAPORE 199555			Ref: CS/LPC20011005/Ktd3n2 Date: 05/08/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	GBK 2375Z	Veh. Inspected	GBG 4204S	
Policy No.		Coverage (\$)	0.00	
Claim No.	20/20/20/VC00/023754	Excess (\$)	0.00	
Assign From	ONG LI LI	Assign Date	12/10/2020	
2. Vehicle Particulars & Condition				
Make & Model	FIAT FIORINO (A)	c.c	1248	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	ZFA22500006F47061	Colour	METALLIC GREEN	
Odometer	143803 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	185/65 R15	YOKOHAMA	7 mm	
L/H Front Tyre	185/65 R15	YOKOHAMA	7 mm	
R/H Rear Tyre	185/65 R15	YOKOHAMA	7 mm	
L/H Rear Tyre	185/65 R15	YOKOHAMA	7 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	08/10/2020	Inspection Date	12/10/2020	
Survey held at	THIAM HENG HUAT PTE LTD 176 SIN MING DRIVE #05-14 SINGAPORE 575721			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			24 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBG 4204S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
2	REAR SIDE PANEL @\$1241.00	N/S BUCKLED	2,482.00	1,180.00
2	REAR SIDE PANEL (INNER) @\$1165.00	N/S BENT	2,330.00	980.00
2	REAR WHEEL HOUSE PANEL (INNER) @\$879.00	N/S BENT	1,758.00	879.00
2	REAR WHEEL HOUSE PANEL (OUTER) @\$658.00	N/S BENT	1,316.00	658.00
2	REAR SIDE PANEL INNER TRIM @\$234.00	SERVICEABLE	468.00	-
2	REAR SIDE PANEL AIR VENT (OUTER) @\$78.00	N/S DISTORTED	156.00	78.00
2	REAR SIDE PANEL INNER AIR VENT @\$78.00	SERVICEABLE	156.00	-
2	REAR SIDE PANEL SLIDING DOOR RAILING @\$246.00	N/S BUCKLED	492.00	246.00
2	TAIL LAMP @\$268.00	N/S BROKEN / O/S CRACKED	536.00	536.00
2	TAIL LAMP PANEL @\$158.00	N/S BENT	316.00	158.00
2	TAIL LAMP INNER PANEL @\$245.00	N/S BENT	490.00	245.00
1	REAR BUMPER	BENT	578.00	578.00
1	REAR BUMPER TOW HOOK COVER	MISSING	65.00	65.00
2	REAR BUMPER SIDE RETAINER @\$58.00	DISTORTED	116.00	116.00
1	REAR BUMPER SPONGE	NO SUCH PARTS	156.00	-
1	REAR DOOR N/S	BENT	1,689.00	1,491.31
1	REAR DOOR O/S	BENT	1,442.00	1,442.00
1	REAR DOOR OUTER HANDLE N/S	DENTED	225.00	225.00
1	REAR DOOR LOCK CYLINDER N/S	SERVICEABLE	189.00	-
2	REAR DOOR LICENCE PLATE LAMP N/S @\$95.00	N/S CRACKED	190.00	95.00
1	REAR DOOR "ECOJET" EMBLEM	NECESSARY	55.00	55.00
1	REAR DOOR "FIORINO" EMBLEM	NECESSARY	75.00	75.00
1	REAR DOOR "FIAT" LOGO	NECESSARY	103.00	103.00
1	REAR DOOR "PROFESSIONAL" EMBLEM	NECESSARY	65.00	65.00
1	REAR DOOR GLASS N/S	SHATTERED	1,376.00	980.00
1	REAR DOOR GLASS MOULDING N/S	NECESSARY	98.00	98.00
1	REAR DOOR GLASS O/S	SHATTERED	1,145.00	860.00
1	REAR DOOR GLASS MOULDING O/S	NECESSARY	88.00	88.00
1	REAR DOOR N/S INNER LOCK WITH MOTOR	JAMMED	566.00	425.00

Report Ref No. CS/LPC20011005/Ktd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR DOOR UPPER LOCK @\$196.00	TO REPAIR SEE LABOUR	392.00	-
2	REAR DOOR LOWER LOCK @\$196.00	BENT	392.00	392.00
4	REAR DOOR HINGE @\$170.00	TO REPAIR SEE LABOUR	680.00	-
2	REAR DOOR CHECKER @\$65.00	DISTORTED	130.00	130.00
1	REAR DOOR INNER TRIM N/S	DISTORTED	210.00	210.00
1	REAR DOOR INNER TRIM O/S	DISTORTED	210.00	210.00
1	EXHAUST PIPE	TO REPAIR SEE LABOUR	892.00	-
1	CENTER EXHAUST	TO REPAIR SEE LABOUR	980.00	-
2	CENTER EXHAUST MOUNTING @\$93.00	SERVICEABLE	186.00	-
1	CENTER EXHAUST GASKET	SERVICEABLE	42.00	-
1	REAR END PANEL	BENT	356.00	356.00
1	REAR END PANEL (INNER)	BENT	650.00	650.00
1	REAR END PANEL (EXTEND)	BENT	265.00	265.00
1	REAR FLOOR PANEL	BENT	2,196.00	1,250.00
1	REAR FLOOR CORNER PANEL	BENT	692.00	692.00
1	REAR CHASSIS EXTENSION MEMBER	TO REPAIR SEE LABOUR	1,156.00	-
1	REAR END PANEL TOP GARNISH	BUCKLED / DENTED	178.00	178.00
1	REAR FLOOR PANEL TOP MAT	SERVICEABLE	650.00	-
1	REAR AXLE	BENT	1,890.00	1,600.00
2	REAR SHOCK ABSORBER @\$690.00	N/S BENT	1,380.00	180.00
1	SLIDING DOOR O/S	TO REPAIR SEE LABOUR	756.00	-
1	SLIDING DOOR UPPER ROLLER O/S	SERVICEABLE	113.00	-
1	SLIDING DOOR LOWER ROLLER O/S	SERVICEABLE	145.00	-
1	SLIDING DOOR N/S	TO REPAIR SEE LABOUR	756.00	-
1	SLIDING DOOR UPPER ROLLER N/S	TO REPAIR SEE LABOUR	113.00	-
1	SLIDING DOOR LOWER ROLLER N/S	TO REPAIR SEE LABOUR	145.00	-
1	WING MIRROR ASSY N/S	CRACKED	285.00	285.00

Report Ref No. CS/LPC20011005/Ktd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LESS 10% DISCOUNT		-3,456.10	-1,811.93
			31,104.90	16,307.38
2	REAR DOOR WEATHERSTRIP @\$221.00 (50%)(SN)	DENTED / CUT	442.00	221.00
1	REAR DOOR WEATHERSTRIP CENTER (50%)(SN)	CUT	119.00	59.50
	LESS 10% DISCOUNT		-56.10	-
			504.90	280.50
	<u>SPECIAL NETT ITEMS</u>			
2	REAR WINDSCREEN SEALANT @\$100.00 (SN)	NECESSARY	200.00	80.00
1	TAILGATE "4 PAX" STICKER (SN)	NECESSARY	18.00	12.00
1	TAILGATE "70KM/H" STICKER (SN)	NECESSARY	18.00	12.00
1	REVERSE SENSOR (SN)	TORN	280.00	200.00
1	REAR WHEEL HOUSE PANEL INNER SEALANT (SN)	NECESSARY	200.00	30.00
2	TAILGATE AFTERMARKET EMBLEM @\$80.00 (SN)	NECESSARY	160.00	120.00
1	REAR SIDE PANEL INNER SEALANT (SN)	NECESSARY	200.00	30.00
1	END PANEL SEALANT (SN)	NECESSARY	100.00	30.00
6	END PANEL TOP GARNISH CLIPS @\$5.50 (SN)	NECESSARY	33.00	33.00
10	REAR BUMPER CLIPS @\$5.50 (SN)	NECESSARY	55.00	55.00
1	REAR FLOOR PANEL SEALANT (SN)	NECESSARY	100.00	30.00
1	SUNDRIES (SN)	NOT NECESSARY	50.00	-
			1,414.00	632.00
	<u>LABOUR</u>			
	TO DISMANTLE/RENEW THE ACCIDENT DAMAGED PORTION.TO PANEL BEAT,RESHAPE,STRAIGHTEN, ORIENTATE AND ALIGN REPAIR/REPLACEMENT PARTS.INCLUSIVE OF THE REPAIR OF REAR DOOR UPPER LOCK,REAR DOOR HINGE,EXHAUST PIPE,CENTER EXHAUST,REAR CHASSIS EXTENSION MEMBER,SLIDING DOOR O/S,SLIDING DOOR N/S,SLIDING DOOR UPPER ROLLER N/S AND SLIDING DOOR LOWER ROLLER N/S.		1,600.00	1,500.00
	TO DISCONNECT REAR WIRE HARNESS OF ELECTRICAL COMPONENTS TO FACILITATE REPAIRS,RECONNECT AND CHECK FUNCTIONS INCLUDING TAILLAMP LIGHTINGS.		50.00	20.00

Report Ref No. CS/LPC20011005/Ktd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE,REFIT BOTH TAILGATES COMPONENTS TO REPLACE TAILGATE,CHECK AND RE-ADJUST CLOSE GAP,ALIGNMENT AND WATER SEEPAGE.		100.00	100.00
	TO REMOVE AND REFIT,STRAIGHTEN AND READJUST EXHAUST PIPE AND REPLACE EXHAUST SILENCER.		100.00	60.00
	TO REMOVE AND REFIT INTERIOR UPHOLSTERY TO FACILITATE REPAIR WORK.		100.00	100.00
	TO REMOVE AND REFIT REAR WINDSCREEN TO FACILITATE REPAIR WORK.		300.00	120.00
	SUPPLY SPRAY PAINT MATERIAL AND NECESSARY ITEMS TO RESPRAY AFFECTED AREA/PANEL.		1,600.00	1,400.00
	TO RUST PROOF ALL AFFECTED PORTIONS AFTER REPAIR.		100.00	100.00
			3,950.00	3,400.00
GRAND TOTAL			36,973.80	20,619.88
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				16,000.00

Report Ref No. CS/LPC20011005/Ktd3n2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBG 4204S

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBG 4204S

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

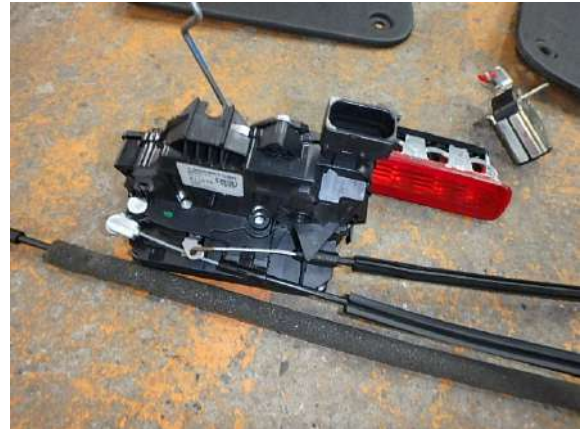



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

