

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG21008392/UGA3Q2**Date:** 18/04/2022REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	1900112090
Claimant Vehicle No :	XE6240Z	Insured Vehicle No :	SMM5193X
Date of Loss:	06/08/2021	Nature of Claim:	TP
		Claim No:	3724996951SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	XE6240Z	Engine No:	CM6D2840060120D04169
Make & Model:	CAMC HN3251X40C3M6, 11.8 D (M)	Chassis No:	LZ5N2DD36LB018590
Reg. Date:	09/03/2021 (Man. Year: 2020)	Odometer:	60253 km
Colour:	White		
Engine Capacity:	11812 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	295/80 R22.5	Rear Tyre Size:	295/80 R22.5 (D/D)
Front Left Side:	ANNAITE 6 mm	Rear Left Side:	Aeolus 6/6/6 mm
Front Right Side:	ANNAITE 6 mm	Rear Right Side:	Aeolus 6/6/6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	68,692.50	16,228.93	52,463.57	76.37
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,830.00	3,070.00	3,760.00	55.05
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	75,522.50	19,298.93	56,223.57	74.45
Approved Total (Overridden) (S\$)		15,400.00		
(S\$)	75,522.50	15,400.00	60,122.50	79.61
+ GST 7.00/7.00% (S\$)	5,286.58	1,078.00	4,208.58	79.61
Nett Amount (S\$)	80,809.08	16,478.00	64,331.08	79.61
+ Loss of Use (11.0 x S\$300.00/day) (S\$)		3,300.00		
+ Doc/Search Fee (S\$)		2.00		
Nett Liability (S\$)		19,780.00		
Global Sum Settlement (S\$)		19,500.00		

INSPECTION

Date of Assignment:	11/08/2021	
Date Inspected:	11/08/2021	Inspected At: Fastech Auto Pte Ltd (HQ) 1 Kaki Bukit Ave 6, #01-46/48/50 Autobay Singapore 417883
Estimated Period of Repair:	10.0 days	

Adjuster: MARCUS CHUA**Manager:** Chong Pui Lin

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
1	1	*REAR MUDFLAP O/S	Serviceable	325.00 F	*- FL
2	1	*REAR CHASSIS MEMBER O/S	Repair	6,800.00 F	*- FL
3	1	*REAR AXLE BEAM	Not Necessary	15,000.00 F	*- FL
4	1	*BONNET CAMC EMBLEM	Necessary	180.00 F	*100.00 FL
5	1	*BONNET CENTRE GRILLE	Cracked	620.00 F	*399.00 FL
6	1	*BONNET CENTRE CHROME	Not Necessary	480.00 F	*- FL
7	1	*BONNET }	Cracked	6,267.50 F	*4,821.00 FL
8	1	*BONNET OUTER CORNER GARNISH O/S }		600.00 F	*- FL
9	1	*BONNET INNER LOCKS	O/S Bent	300.00 F	*145.00 FL
10	1	*BONNET INNER VERTICAL PANEL O/S	Bent	185.00 F	*166.00 FL
11	1	*BONNET INNER LOCK CATCH O/S	Bent	145.00 F	*90.00 FL
12	1	*BONNET INNER SIDE GARNISH O/S	Distorted	130.00 F	*120.00 FL
13	2	*BONNET HINGES	Not Necessary	360.00 F	*- FL
14	1	*FRONT BUMPER	Repair	2,200.00 F	*- FL
15	1	*FRONT BUMPER CORNERS	O/S Distorted	2,400.00 F	*980.00 FL
16	1	*FRONT BUMPER CORNER SIDE TOP BLACK GARNISH O/S	Torn	160.00 F	*90.00 FL
17	1	*FRONT BUMPER CENTRE GRILLE	Not Necessary	420.00 F	*- FL
18	1	*HEADLAMPS	O/S Broken	2,400.00 F	*650.15 FL
19	1	*HEADLAMP OUTER WIRE MESHES	O/S Bent	360.00 F	*100.00 FL
20	1	*HEADLAMP STAY O/S	Bent	350.00 F	*125.00 FL
21	1	*HEADLAMP INNER SOCKET WIRE O/S	Cracked	620.00 F	*380.00 FL
22	1	*HEADLAMP WIRE HARNESS ASSY	Repair	2,800.00 F	*- FL
23	1	*FRONT FOG LAMPS	O/S Broken	600.00 F	*250.00 FL
24	1	*FRONT WIRE HARNESS ADAPTER ASSY	Cracked	580.00 F	*300.00 FL
25	1	*FRONT BUMPER INNER STRUCTURE BAR ASSY	Distorted / Cracked	3,200.00 F	*2,200.00 FL
26	1	*FRONT DOOR O/S	Distorted	3,800.00 F	*2,850.00 FL
27	1	*FRONT DOOR INNER LOCK O/S	Serviceable	290.00 F	*- FL
28	2	*FRONT DOOR HINGES	Not Necessary	200.00 F	*- FL
29	1	*FRONT DOOR INNER RUBBER O/S	Not Necessary	225.00 F	*- FL
30	1	*FRONT DOOR OUTER PILLAR O/S	Bent	1,100.00 F	*900.00 FL
31	1	*FRONT STAND PANEL O/S	Bent	685.00 F	*480.00 FL
32	1	*FRONT STAND PANEL GARNISH O/S	Cracked	1,420.00 F	*680.00 FL
33	1	*FRONT STEP PANEL INNER BRACKET ASSY O/S	Bent	1,220.00 F	*820.00 FL
34	3	*FRONT STEP ALUMINIUM PLATES	Bent	600.00 F	*450.00 FL
35	1	*FRONT ABSORBER O/S	Not Necessary	505.00 F	*- FL
36	1	*FRONT STEP ALUMINIUM LOWER BRACKET O/S	Bent	380.00 F	*305.00 FL
37	1	*FRONT WHEEL MUDGUARD INNER SHIELD TOP O/S	Torn	420.00 F	*311.00 FL
38	1	*SET FRONT WHEEL INNER SHIELD CLIPS O/S	Necessary	60.00 F	*30.00 FL
39	1	*FRONT WHEEL MUDGUARD INNER SHIELD LOWER O/S	Torn	405.00 F	*290.00 FL
40	1	*STEERING BLOCK ASSY	Repair	4,500.00 F	*- FL
41	1	*STEERING SHAFT	Serviceable	820.00 F	*- FL
42	1	*FRONT AIR HOSE TUBE	Serviceable	650.00 F	*- FL
43	1	*FRONT AIR HOSE PIPE	Not Necessary	280.00 F	*- FL
44	1	*FRONT INNER PANEL	Repair	3,650.00 F	*- FL

F=Franchise part. L=ListItemDisc.

Sub Total (\$\$)	68,692.50	18,032.15
- List Item Discount on L Items 0.00/10.00% (\$\$)	0.00	1,803.22
Total Parts (\$\$)	68,692.50	16,228.93

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CHECK WIRING	New	80.00	30.00
2	TO SPRAY RUST PROOFING	New	150.00	60.00
3	TO REFILL AIR CON GAS	New	150.00	0.00
4	TO DISMANTLE & REFIX STEERING BLOCK	New	300.00	200.00
5	TO TRANSFER FRONT DOOR MECHANISM	New	150.00	80.00
6	LABOUR FOR PANEL BEATING & REPLACED PARTS	New	3,800.00	1,500.00
7	TO PUTTY & SPRAY PAINTING	New	2,200.00	1,200.00
Gross Labour Cost (\$\$)			6,830.00	3,070.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >