

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CTI21008417/UUCE2

Date: 01/10/2021

REFERENCE

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMPCSNW00076942100		
Claimant Vehicle No :	SJW1341U	Insured Vehicle No :	SMY9117C		
Date of Loss:	06/08/2021	Nature of Claim:	TP	Claim No:	SNM21D204374/C02/THAMYL

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJW1341U	Engine No:	4A910126388
Make & Model:	MITSUBISHI LANCER, 1.3 (A)	Chassis No:	JMYSRCY2AAU000396
Reg. Date:	04/03/2010 (Man. Year: 2009)	Odometer:	156643 km
Colour:	White		
Engine Capacity:	1499 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/60 R16	Rear Tyre Size:	205/60 R16
Front Left Side:	Linglong 6 mm	Rear Left Side:	Yokohama 6 mm
Front Right Side:	Linglong 6 mm	Rear Right Side:	Yokohama 6 mm

The above values represent the remaining tyre tread depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	9,902.28	8,252.72	1,649.56	16.66
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,860.00	2,500.00	360.00	12.59
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	12,762.28	10,752.72	2,009.56	15.75
Approved Total (Overridden) (S\$)		8,600.00		
(S\$)	12,762.28	8,600.00	4,162.28	32.61
+ GST 7.00/7.00% (S\$)	893.36	602.00	291.36	32.61
Nett Amount (S\$)	13,655.64	9,202.00	4,453.64	32.61

INSPECTION

Date of Assignment:	17/08/2021		
Date Inspected:	11/08/2021	Inspected At:	SME Motor Pte Ltd (HQ) 1 KAKI BUKIT AVE6, #02-15 Singapore 417883
Estimated Period of Repair:	6.0 days		

Adjuster: MARCUS CHUA

Manager: Tan Hui Zhen

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 01 Oct 2021)
Parts:	143	MITSUBISHI LANCER 1.3 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SJW1341U)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BONNET	Buckled	622.00 FL	*622.00 FL
2	2		*FRT BONNET HINGES	Bent	108.00 FL	*108.00 FL
3	1		*FRT BONNET INSULATOR	Torn	100.00 FL	*100.00 FL
4	8		*INSULATOR CLIPS	Necessary	40.00 FL	*40.00 FL
5	1		*FRONT BONNET LOCK	Twisted	65.00 FL	*65.00 FL
6	1		*FRT GRILLE	Cracked	251.00 FL	*251.00 FL
7	1		*GRILLE CENTRE LOGO	Necessary	47.00 FL	*47.00 FL
8	4		*GRILLE CLIPS	Necessary	20.00 FL	*20.00 FL
9	1		*FRT BUMPER	Distorted	810.00 FL	*810.00 FL
10	1		*FRT BUMPER RETAINER	O/S Bent	40.00 FL	*20.00 FL
11	10		*FRT BUMPER CLIPS	Necessary	50.00 FL	*50.00 FL
12	1		*FRT BUMPER CENTRE TOP BEAM	Repair	165.00 FL	*- FL
13	1		*FRT BUMPER REINFORCEMENT	Bent	320.00 FL	*320.00 FL
14	1		*FRT BUMPER TOP RUBBER SEAL	Necessary	40.00 FL	*40.00 FL
15	1		*FRT BUMPER FOG LAMP GARNISH RH	Twisted	55.00 FL	*55.00 FL
16	2		*HEADLAMP	O/S Broken / N/S Cracked	1,342.00 FL	*1,342.00 FL
17	1		*RH HEADLAMP PANEL	Bent	65.00 FL	*65.00 FL
18	1		*CENTER TOP PANEL	Repair	219.00 FL	*- FL
19	1		*HEADLAMP SUPPORT TOP GARNISH	Not Necessary	95.00 FL	*- FL
20	6		*TOP GARNISH CLIPS	Not Necessary	30.00 FL	*- FL
21	1		*WASHER TANK	Deformed	145.00 FL	*145.00 FL
22	1		*WASHER TANK MOTOR	Not Necessary	165.00 FL	*- FL
23	1		*WASHER TANK NECK	Not Necessary	55.00 FL	*- FL
24	1		*RADIATOR SPARE TANK	Not Necessary	125.00 FL	*- FL
25	1		*FRT RH FENDER	Distorted	361.00 FL	*361.00 FL
26	1		*FRT RH FENDER INNER COWLING	Torn	165.00 FL	*165.00 FL
27	10		*INNER COWLING CLIPS	Necessary	50.00 FL	*50.00 FL
28	1		*FRT RH FENDER TOP CORNER GARNISH	Distorted	35.00 FL	*35.00 FL
29	1		*FRT RH WHEEL HOUSING PANEL	Badly Dented	880.00 FL	*880.00 FL
30	1		*FRT RH SHOCK ABSORBER	Bent	395.00 FL	*395.00 FL
31	1		*FRT RH SHOCK ABSORBER MOUNTING	Not Necessary	125.00 FL	*- FL
32	1		*FRT RH LOWER ARM	Bent	221.70 FL	*221.70 FL
33	1		*FRT RH LOWER ARM BALL JOINT	Bent	105.00 FL	*105.00 FL
34	1		*FRT RH KNUCKLE ARM	Bent	305.90 FL	*305.90 FL
35	1		*FRT RH DRIVE SHAFT	Not Necessary	666.70 FL	*- FL
36	1		*STEERING RACK ASSY	Bent / Twisted	2,516.00 FL	*2,516.00 FL
37	1		*STEERING CROSSMEMBER	Bent	588.00 FL	*588.00 FL
38	1		*ANTI ROLL BAR LINK RH	Not Necessary	90.00 FL	*- FL
39	1		*FRT ENGINE UNDER COVER	Torn	111.80 FL	*111.80 FL
40	6		*UNDER COVER CLIPS	Necessary	30.00 FL	*30.00 FL
41	1		*FRT RH KNUCKLE BEARING	Necessary	139.00 FL	*139.00 FL
42	1		*FRT RH TYRE	Serviceable	220.00 FS	*- FS
43	1		*FRT RH SPORT RIM	Bent	250.00 FS	*250.00 FS
44	1		*RADIATOR COOLANT	Not Necessary	25.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$) 12,254.10 10,253.40

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	WIRE CHECKING	New	30.00	20.00
2	REMOVE & REFIX AIRCON AND GAS	New	100.00	100.00
3	REMOVE & REFIX FRT RH UNDER CARRIAGE (WITH CROSSMEMBER AND RACK)	New	350.00	300.00
4	4 WHEEL ALIGNMENT	New	80.00	80.00
5	LABOUR CHARGE	New	1,100.00	1,000.00
6	SPRAY PAINTING	New	1,200.00	1,000.00
Gross Labour Cost (\$)			2,860.00	2,500.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >