

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CS/AIG21008444/ETF3N2**Date:** 01/09/2021**REFERENCE****Insured/Claimant:** CLYDE CLIFFORD GREGORY**Policy No:****Date of Loss:** 11/08/2021**Nature of Claim:** OD **Claim No:** 4067499677SG**DESCRIPTION & IDENTIFICATION OF VEHICLE****Reg No:** SMM5084C**Make & Model:** MITSUBISHI ATTRAGE, 1.2 CVT (A)**Engine No:** 3A92UHS9513**Reg. Date:** 01/07/2019 (Man. Year: 2019)**Chassis No:** MMBSTA13AKH001827**Colour:** Grey**Odometer:** 30300 km**Engine Capacity:** 1193 cc**Market Value/New Car Price:** S\$60,000.00**Sum Insured (S\$):** **Market Value/New Car Price****CONDITION OF VEHICLE AT THE TIME OF SURVEY****General Condition:** Steering (Serviceable):

Yes

Footbrake (Serviceable):

Yes

Handbrake (Serviceable): Yes **Engine Modification:**

No

Pre-accident Condition:**CONDITION OF TYRES****Front Tyre Size:** 185/60 R15**Rear Tyre Size:** 185/60 R15**Front Left Side:** Continental 4 mm**Rear Left Side:** Continental 4 mm**Front Right Side:** Continental 4 mm**Rear Right Side:** Continental 4 mm*The above values represent the remaining tyre tread depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	8,597.57	4,947.79	3,649.78	42.45
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,760.00	4,045.00	715.00	15.02
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	13,357.57	8,992.79	4,364.78	32.68
- Excess (S\$)	300.00	300.00	0.00	0.00
(S\$)	13,057.57	8,692.79	4,364.78	33.43
+ GST 7.00/7.00% (S\$)	914.03	608.50	305.53	33.43
Nett Amount (S\$)	13,971.60	9,301.29	4,670.31	33.43

INSPECTION**Date of Assignment:** 12/08/2021**Date Inspected:** 12/08/2021 **Inspected At:**

Cycle & Carriage Automotive Pte Ltd (Pandan Gardens)

209 Pandan Gardens

Singapore 609339

Estimated Period of Repair: 7.0 days**Adjuster:** CHEN TSUE YEE**Manager:** DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FACE,FR BUMPER	Dented	706.00 FL	*706.00 FL
2	1		*COVER,FR BUMPER	Crushed	12.00 FL	*12.00 FL
3	1		*COVER,HEADLAMP SUPT PANEL	Broken	62.00 FL	*62.00 FL
4	5		*CLIP,FR BUMPER	Necessary	20.00 FL	*20.00 FL
5	1		*BRACKET,FR BUMPER,LH	Not Necessary	13.00 FL	*- FL
6	1		*BRACKET,FR BUMPER,RH	Not Necessary	13.00 FL	*- FL
7	1		*GRILLE,FR UNDER	Broken	165.00 FL	*165.00 FL
8	1		*GARNISH,FR BUMPER,RH	Not Necessary	127.00 FL	*- FL
9	1		*MARK,THREE-DIA	Necessary	70.00 FL	*70.00 FL
10	1		*GRILLE,RADIATOR	Necessary	557.00 FL	*557.00 FL
11	1		*HOOD	Dented	737.00 FL	*737.00 FL
12	8		*CLIP,HOOD INSULATOR	Necessary	24.00 FL	*24.00 FL
13	1		*HINGE,HOOD LH	Not Necessary	56.00 FL	*- FL
14	1		*HINGE,HOOD RH	Not Necessary	56.00 FL	*- FL
15	1		*LATCH,HOOD	Not Necessary	69.00 FL	*- FL
16	1		*FENDER,FR RH	Dented	500.00 FL	*500.00 FL
17	1		*SHIELD,FR WHEELHOUSE RH	Not Necessary	98.00 FL	*- FL
18	6		*CLIP,INNERSHIELD	Not Necessary	24.00 FL	*- FL
19	1		*PANEL ASSY,FR END	Not Necessary	1,055.00 FL	*- FL
20	1		*PANEL,HEADLAMP SUPPORT,UPR	Not Necessary	66.00 FL	*- FL
21	1		*HEADLAMP ASSY,LH	Not Necessary	663.00 FL	*- FL
22	1		*HEADLAMP ASSY,RH	Broken	663.00 FL	*663.00 FL
23	1		*CONDENSER ASSY,A/C REFRIGE	Not Necessary	762.00 FL	*- FL
24	1		*PANEL,AIR GUIDE,LH	Not Necessary	11.00 FL	*- FL
25	1		*PANEL,AIR GUIDE,RH	Not Necessary	11.00 FL	*- FL
26	1		*PANEL,AIR GUIDE	Broken	112.00 FL	*112.00 FL
27	1		*RADIATOR ASSY	Not Necessary	972.00 FL	*- FL
28	1		*FAN,COOLING	Not Necessary	77.00 FL	*- FL
29	1		*SHROUD,COOLING FAN	Not Necessary	131.00 FL	*- FL
30	1		*MOTOR,COOLING FAN	Not Necessary	484.00 FL	*- FL
31	1		*LLC 4L	Not Necessary	26.00 FL	*- FL
32	1		*UNPAINTED BODYKITS	Broken	1,643.00 FS	*1,643.00 FS
33	1		*EMBLEM ECO	Necessary	17.00 FS	*17.00 FS
34	1		*SUNDRIES	Necessary	20.00 FS	*20.00 FS
35	1		*BODY PNL SEALANT	Necessary	60.00 FS	*40.00 FS
36	1		*FR NUMBER PLATE WITH CASING	Bent	50.00 FS	*50.00 FS
37	1		*REINFORCEMENT, FR BUMPER	Dented	469.00 FL	*469.00 FL
			Supplementary			
38	1		*RIVET, FR BUMPER (6PCS)	Necessary	30.00 FL	*30.00 FL
			Supplementary			

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	10,631.00	5,897.00
- List Item Discount on L Items 23.00/23.00% (\$)	2,033.43	949.21
Total Parts (\$)	8,597.57	4,947.79

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
<u>Miscellaneous Items</u>				
1	1	*OD/TP Case (Insurer)	-	0.00
Sub Total (\$\$)			0.00	0.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	RENEW FR BUMPER & BODY KIT,FR SUPPORT,BONNET & RHF FENDER,REPAIR LHF FENDER	New	2,250.00	2,105.00
2	RESPRAY FR BUMPER,FR BUMPER BODY KIT,FR SUPPORT,BONNET,LHF FENDER & RHF FENDER	New	2,100.00	1,750.00
3	REMOVE & REFIT AC COND & RADIATOR	New	100.00	0.00
4	TOP UP AC GAS	New	80.00	0.00
5	CHECK WIRING ELECTRICAL SYSTEM & ADJUST HEADLAMP AIM	New	30.00	30.00
6	TO CARRY OUT DIAGNOSTIC CHECK ON ELECTRONIC CONTROL SYSTEM	New	120.00	120.00
7	APPLY ANTI CORROSION ON AFFECTED AREAS	New	80.00	40.00
Gross Labour Cost (\$\$)			4,760.00	4,045.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >