

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/AIG21008643/KUF3N2**Date:** 10/09/2021REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd.

Policy No:

Claimant Vehicle No : SMT2285Y**Insured Vehicle No :** SJY1356S

Date of Loss: 13/08/2021

Nature of Claim: TP

Claim No: 8286200442SG

DESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **SMT2285Y**

Make & Model: HONDA JAZZ, 1.3 (A)

Engine No: L13B15000546

Reg. Date: 01/04/2020 (Man. Year: 2020)

Chassis No: JHMGK3850LS217725

Colour: Metallic Grey

Odometer: 28220 km

Engine Capacity: 1318 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable):

Yes Footbrake (Serviceable):

Yes

Handbrake (Serviceable): Yes Engine Modification:

No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 175/65R15

Rear Tyre Size: 175/65R15

Front Left Side: Dunlop 8 mm

Rear Left Side: Dunlop 8 mm

Front Right Side: Dunlop 8 mm

Rear Right Side: Dunlop 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	10,460.12	5,600.56	4,859.56	46.46
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,635.00	2,180.00	1,455.00	40.03
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	14,095.12	7,780.56	6,314.56	44.80
Approved Total (Overridden) (S\$)		7,000.00		
Nett Amount (S\$)	14,095.12	7,000.00	7,095.12	50.34

INSPECTION

Date of Assignment: 18/08/2021

Date Inspected: 18/08/2021 Inspected At:

BLK 5038 ANG MO KIO INDUSTRIAL PARK 2,
#01-405

SINGAPORE 569541.

REPAIRER: LIAN HER MOTORS

Estimated Period of Repair: 8.0 days

Adjuster: KENNETH KONG**Manager:** Tan Hui Zhen*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR TAIL-GATE ASSY	Bent	885.40 FL	*885.40 FL
2	1		*REAR TAIL-GATE GLASS	Shattered	808.30 FL	*808.30 FL
3	2		*REAR TAIL-GATE GLASS INNER SIDE GARNISH	Serviceable	110.20 FL	*- FL
4	1		*REAR TAIL-GATE GLASS INNER TOP GARNISH	Serviceable	65.20 FL	*- FL
5	1		*REAR TAIL-GATE GLASS MOULDING	Necessary	97.20 FL	*97.20 FL
6	1		*REAR TAIL-GATE TOP SPOILER	Serviceable	458.70 FL	*- FL
7	1		*REAR THIRD BRAKE LIGHT	Serviceable	195.30 FL	*- FL
8	2		*REAR TAIL-GATE LAMP	Serviceable	303.00 FL	*- FL
9	1		*REAR TAIL-GATE EMBLEM JAZZ	Necessary	40.10 FL	*40.10 FL
10	1		*REAR EMBLEM H	Necessary	35.60 FL	*35.60 FL
11	1		*REAR TAIL-GATE OUTER GARNISH	Cracked	193.70 FL	*193.70 FL
12	1		*REAR TAIL-GATE INNER LOCK SENSOR	Serviceable	185.70 FL	*- FL
13	1		*REAR TAIL-GATE INNER LOCK	Dented	195.10 FL	*195.10 FL
14	1		*REAR TAIL-GATE INNER TRIM BOARD	Buckled/Mtg Distorted	152.60 FL	*152.60 FL
15	2		*REAR NO PLATE LAMP	Serviceable	110.20 FL	*- FL
16	1		*REAR TAIL-GATE WIPER MOTOR	Bent/Jammed	287.10 FL	*287.10 FL
17	2		*REAR FENDER	Repair	1,371.20 FL	*- FL
18	2		*REAR FENDER INNER TRIM BOARD	Deformed	410.20 FL	*410.20 FL
19	1		*REAR N/S FENDER AIR VENT	Serviceable	57.10 FL	*- FL
20	1		*REAR END PANEL	Bent	398.20 FL	*398.20 FL
21	1		*REAR END PANEL INNER GARNISH	Distorted/Dented	155.20 FL	*155.20 FL
22	1		*REAR BOOT RUBBER	Distorted/Cut	103.40 FL	*103.40 FL
23	1		*REAR SPARE TYRE PANEL	Repair	1,072.50 FL	*- FL
24	1		*REAR SPARE TYRE PANEL TOP COVER BOARD	Deformed	215.90 FL	*215.90 FL
25	2		*REAR TAIL-LAMP ASSY	O/s Cut/N/s Cracked	712.20 FL	*712.20 FL
26	2		*REAR TAIL-LAMP PANEL	Bent	216.20 FL	*216.20 FL
27	1		*REAR BUMPER	Bent	575.60 FL	*549.20 FL
28	1		*REAR BUMPER LOWER GARNISH (CENTRE PORTION)	Distorted	95.10 FL	*95.10 FL
29	2		*REAR BUMPER REFLECTOR GARNISH	Serviceable	230.40 FL	*- FL
30	2		*REAR BUMPER SIDE RETAINER	Distorted	90.20 FL	*90.20 FL
31	1		*REAR BUMPER SPONGE	No such part	75.10 FL	*- FL
32	1		*REAR ANTENNA	Serviceable	95.60 FL	*- FL
33	1		*REAR BUZZER	Serviceable	92.10 FL	*- FL
34	1		*REAR EXHAUST SILENCER	Repair	495.30 FL	*- FL
35	1		*REAR EXHAUST SILENCER HEAT SHIELD	Repair	45.10 FL	*- FL
36	1		*REAR REVERSE SENSOR (4 Pcs)	Dented/Shorted (3 Pcs only)	1,151.60 FL	*863.70 FL
37	1		*REAR REVERSE CAMERA	Serviceable	450.00 FS	*- FS
38	1		*REAR NO PLATE	Dented	40.00 FS	*40.00 FS
39	1		*REAR WINDSCREEN SEALANT	Necessary	55.00 FS	*40.00 FS
40	20		*REAR BUMPER CLIP	Necessary	60.00 FS	*60.00 FS
41	1		*REAR BOOT TOP COVER	Distorted	165.90 FL	*165.90 FL
42	1		*TOOL SPONGE	Cracked	155.20 FL	*155.20 FL
43	2		*TAIL-LAMP PANEL	Repeated	216.20 FL	*- FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$) 12,923.90 6,965.70
- List Item Discount on L Items 20.00/20.00% (\$\$) 2,463.78 1,365.14

Total Parts (\$\$) 10,460.12 5,600.56

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	REMOVE/RENEW THE ABOVE PARTS INCLUDING KNOCKING,WELDING & CUTTING	New	1,500.00	1,000.00
2	TO PUTTY & SPRAY PAINT REAR ACCIDENT AFFECTED PORTION	New	1,500.00	800.00
3	CHECK/RECONNECT WIRING	New	45.00	20.00
4	TO SPRAY ANTI RUST ON ACCIDENT AFFECTED PORTION	New	200.00	60.00
5	REMOVE/REFIT REAR TAIL-GATE WIPER MOTOR AND LOCK MECHANISM AND REAR BOOT UPHOLSTERY	New	150.00	100.00
6	REMOVE/REPAIR REAR EXHAUST SILENCER	New	120.00	80.00
7	REMOVE/REFIT REAR WINDSCREEN TO FACILITATE REPAIR	New	120.00	120.00
Gross Labour Cost (\$\$)			3,635.00	2,180.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >